Global Component Asia Sdn. Bhd.

COMPONENT REPAIR REPORT

1. Customer: Galaxy Aerospace	4. Cust PO#: MMA-23-716	7. TSN /CSN : 4944.0 / -
2. WO #: 1003	5. Qty:1	8. TSO /CSO : 374.9 / -
3. PN #: 524-031	6. SN: 4686	9. TSR /CSR : - / -

A. Removal Reason

No 2 gen Inop with white smoke occur – Overhaul.

B. Receiving Findings

- 1. Unit received normal in carton box and no shipping damaged.
- 2. Unit internal and external surface are dirty.
- 3. Amendment status A, B, C, D, E, F, G, H are previously complied.

C. Shop Findings

- 1. Disassembled unit for overhaul, details inspection and replacement of carbon brushes & bearings.
- 2. Inspection found armature assy (PN 505455-1) insulation test failed. Armature assy (PN 505455-1) will be repaired.
- 3. Other hardware found normal wear and tear.
- 4. The unit would be overhauled and tested during this shop visit.
- 5. No AD or SB required to comply in this shop visit.

D. This component repair report is prepared by (Name & Date): Samhari Abd Majid / 8 Aug 2023

FRM032 Rev C (01 SEP 2021)



Attachment 1: Material Report

PART NUMBER	DESCRIPTION	QTY	REASON
505455-1	Armature assy	1	Insulation failed - repaired
22296AG030008L	Screw	4	Overhaul. Replaced new
R9QV030AL	Flat washer	4	Overhaul. Replaced new
R9QV040AL	Washer	4	Overhaul. Replaced new
V025051H	Nut	4	Overhaul. Replaced new
408764B	Brush	4	Overhaul. Replaced new
DZQ1QG040008UL	Screw	4	Overhaul. Replaced new
S4	Spring washer	4	Overhaul. Replaced new
22541N060	Check nut	1	Overhaul. Replaced new
46208A	Flat washer	1	Overhaul. Replaced new
V052170D	Lock washer	1	Overhaul. Replaced new
409190	Screw	4	Overhaul. Replaced new
46100	Tab washer	4	Overhaul. Replaced new
410997EH	Bearing	1	Overhaul. Replaced new
B8Q1ZH040010APA	Screw	4	Overhaul. Replaced new
41096EH	Bearing	1	Overhaul. Replaced new
B8Q1QV030010AL	Screw	4	Overhaul. Replaced new
MS16628-4078	Retaining ring	1	Overhaul. Replaced new
P723856	Screw	8	Overhaul. Replaced new
409258	Gasket	1	Overhaul. Replaced new
401219	Tab washer	2	Overhaul. Replaced new
VTQV050L	Spring washer	2	Overhaul. Replaced new
P722699	Nut	2	Overhaul. Replaced new
90006604	Spring washer	3	Overhaul. Replaced new

FRM032 Rev C (01 SEP 2021) Page 2 of 2