

COMPONENT REPAIR REPORT

1. Customer: Galaxy Aerospace (M) S/B	4. Cust PO#: GAM/DO/18/002	7. TSN /CSN: - / -
2. WO #: 145	5. Qty: 1	8. TSO /CSO : - / -
3. PN #: 0230390-202	6. SN: 102114	9. TSR /CSR : - / -
<u>A. Removal Reason</u> Search light extend motor not function.		
<u>B. Receiving Findings</u> 1. Unit normal condition. 2. Unit external dirty.		
<u>C. Shop Findings</u> 1. Carry out trouble shooting and confirmed search light unable to extend due to motor (PN 932-130-00) and limit switch (PN 404-040-00) faulty. 2. Motor (PN 932-130-00) and retract & extend limit switch (PN 404-040-00, Qty 2) replaced new in this shop visit. 3. Unit repaired and final test found satisfactory. 4. No SB or AD required to comply in this shop visit.		
D. This component repair report is prepared by (Name & Date) : Samhari / 25 JAN 2018		

Attachment 1: Material Report

PART NUMBER	DESCRIPTION	REPAIR QTY	REPLACE QTY	REASON
932-130-00	Motor, extend/retract		1	Faulty. Replaced new.
404-040-00	Extend and Retract Limit switch		2	Faulty. Replace new.