Ruag Aviation Malaysia Sdn. Bhd.

COMPONENT REPAIR REPORT

| 1. Customer: Galaxy Aerospace | 4. Cust PO#: GAM/PO/19/578 | 7. TSN /CSN: - / - | | |
|---|----------------------------|---------------------|--|--|
| 2. WO #: 392 | 5. Qty: 1 | 8. TSO /CSO : - / - | | |
| 3. PN #: 0230390-202 | 6. SN: 150602 | 9. TSR /CSR : - / - | | |
| A. Removal Reason | | | | |
| Unable to extend. Repair and test. | | | | |
| B. Receiving Findings | | | | |
| Unit normal condition. Unit external dusty and dirty. | | | | |
| C. Shop Findings | | | | |
| 1. Carry out trouble shooting and confirmed search light unable to extend or retract due to Ext/Ret motor (PN | | | | |
| 932-130-00) defective. | | | | |
| 2. The rotation motor (PN 932-230-00) found intermittent and motor cover corroded. | | | | |
| 3. Ext/Ret motor (PN 932-130-00), Rotation motor (PN 932-230-00) and Limit Switch (PN 404-04-000) | | | | |
| replaced new in this shop visit. | | | | |
| 4. Unit is repaired and final test found satisfactory. | | | | |
| 5. No SB or AD required to comply in this shop visit. | | | | |
| | | | | |
| ~ | | | | |
| D. This component repair report is prepared by (Name & Date) : Samhari Abd Majid / 19 Dec 2019 | | | | |

Attachment 1: Material Report

| PART NUMBER | DESCRIPTION | QTY | REASON |
|-------------|-----------------------|-----|----------------------------|
| 404-040-00 | Limit switch | 2 | Replaced with new. |
| 932-130-00 | Ext /Ret motor | 1 | Defective. Replaced new. |
| 932-230-00 | Rotation motor | 1 | Intermittent. Replaced new |
| 350-271-00 | Washer, internal star | 5 | Discard. Replaced new. |