

COMPONENT REPAIR REPORT

1. Customer: Galaxy Aerospace	4. Cust PO#: PO-21-2081	7. TSN /CSN: - / -
2. WO #: 537	5. Qty: 1	8. TSO /CSO : - / -
3. PN #: 0230390-202	6. SN: 111728	9. TSR /CSR : - / -
<u>A. Removal Reason</u>		
Cannot return to original position		
<u>B. Receiving Findings</u>		
<ol style="list-style-type: none"> 1. The unit received in forward extended condition. 2. External condition is dusty. 3. Rotation motor badly corroded. See Photo (1) 4. Scratch marks at the base plate and motor control cover. See Photo (2) 5. The PN 0239390-202 stated in PO was incorrect and corrected to PN 0230390-202 by Galaxy shipping. 6. The SN 102103 stated in PO was incorrect and corrected to SN 111728 by Galaxy shipping. 		
<u>C. Shop Findings</u>		
<ol style="list-style-type: none"> 1. Carry out trouble shooting and confirmed the removal reason “Cannot return to original position”. The defects were due to ext/ret motor (PN 932-130-00) defective. 2. The extend/retract motor (PN 932-130-00) and limit switch (PN 404-040-00) are replaced new in this shop visit. 3. The rotation motor (PN 932-230-00) is replaced new due to corrosion. 4. All scratch marks are polish smooth. 5. Other hardware found satisfactory. 6. Unit is repaired and final test found satisfactory. 7. No SB or AD required to comply in this shop visit. 		
D. This component repair report is prepared by (Name & Date) : Samhari Abdul Majid / 11 Jan 2021		

Attachment 1: Material Report

PART NUMBER	DESCRIPTION	QTY	REASON
404-040-00	Limit switch	2	Replaced with motor.
932-130-00	Ext /Ret motor	1	Defective. Replaced new
932-230-00	Rotation motor	1	Badly corroded. Replaced new

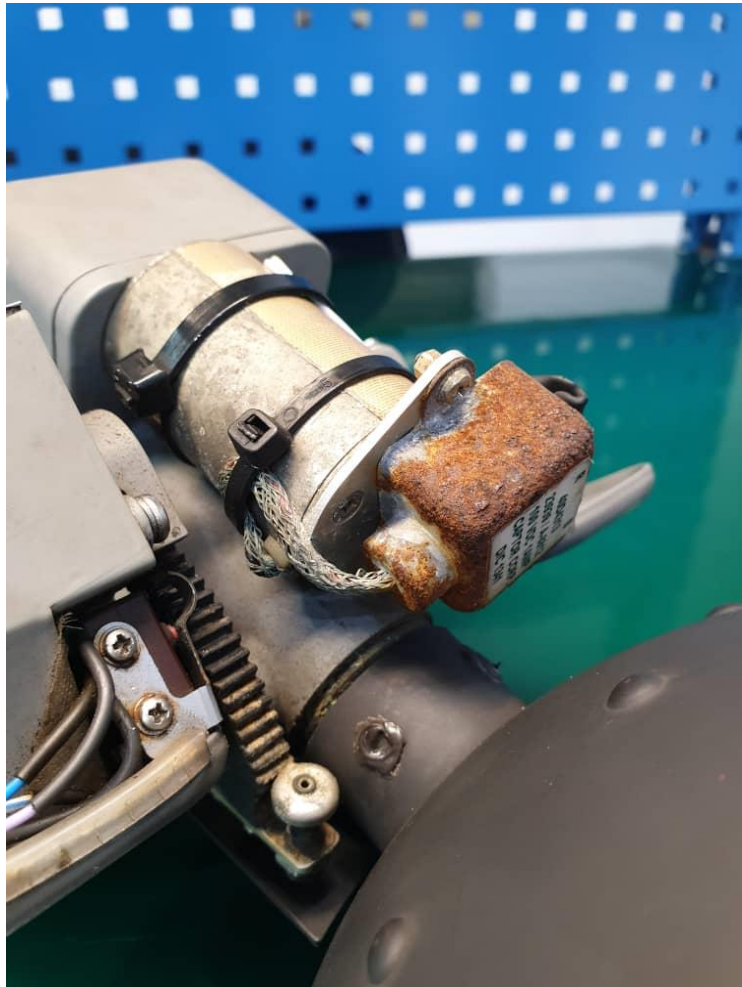


Photo (1): Rotation motor badly corroded

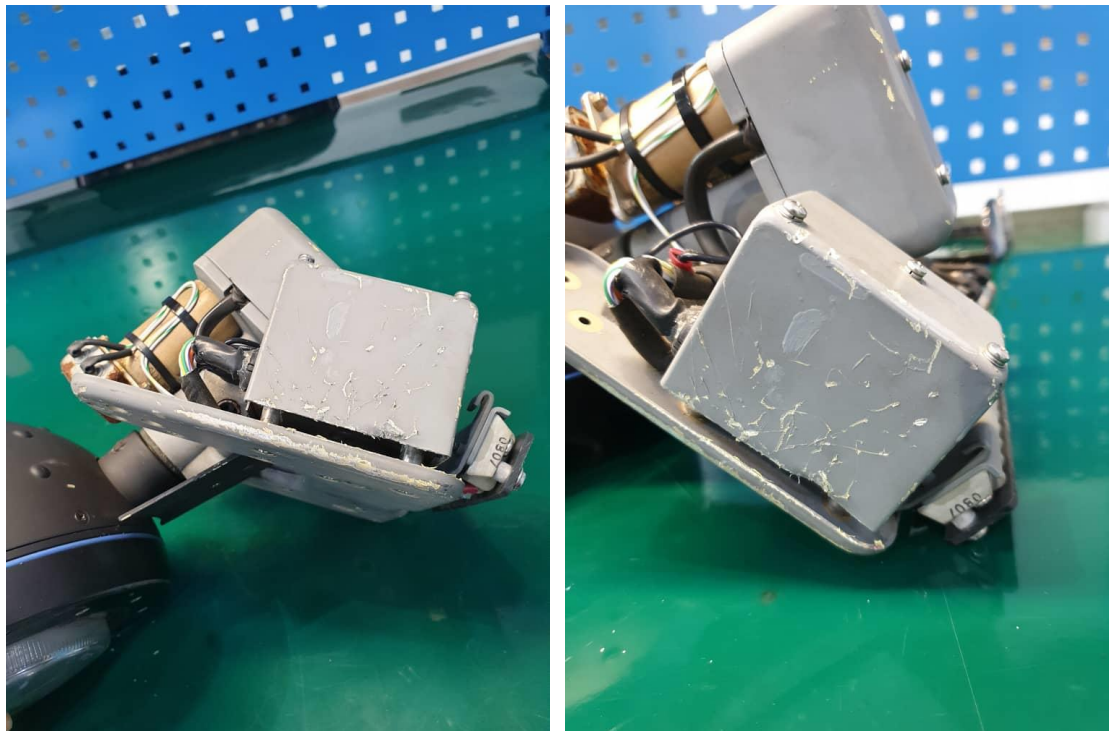


Photo (2): Scratch marks at motor control cover and side of base plate