

Leonardo Malaysia Sdn. Bhd.

Blade Repair Workshop Inspection Report

Customer:	Galaxy Aerospace
Part Number:	3G6210A00131
Serial Number:	V159
TTSN:	4356.3
Date:	27 October 2023

The above blade has been inspected by LM Blade Repair Workshop with the following findings noted:

Inspection findings:


1. Aft Root Bushing found damaged at the edge of the lower surface.



1.1 Rectification required:

- Aft Root Bushing to be replaced.


2. Modification Tag found defonded.

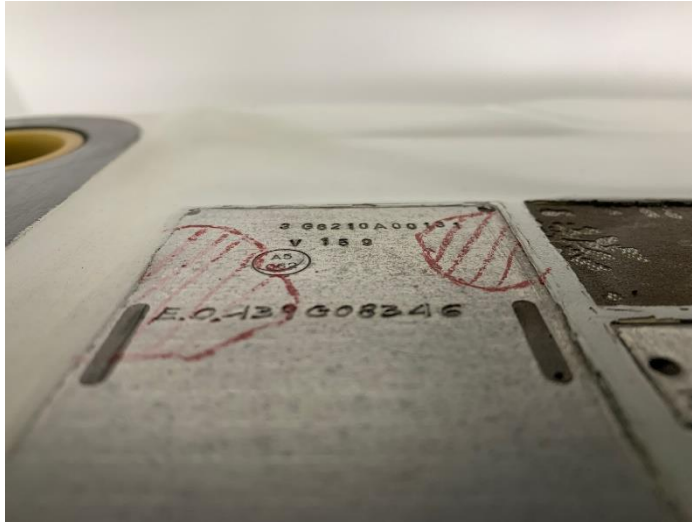

2.1 Rectification required:

- Modification Tag to be rebonded.



3. Lightning Conductor Strip found heavily corroded.

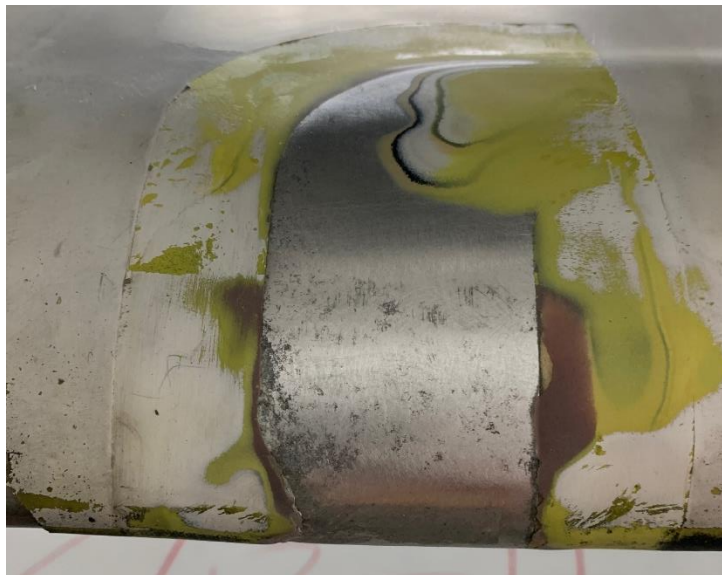

3.1 Rectification required:

- Lightning Conductor Strip to be replaced.
- SB139-617 to be complied for corrosion protective layer.


4. Erosion Shield found crack at STA6215

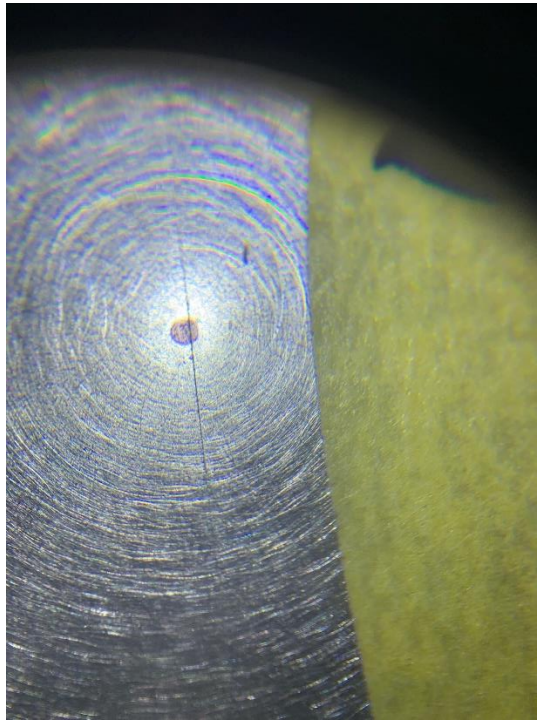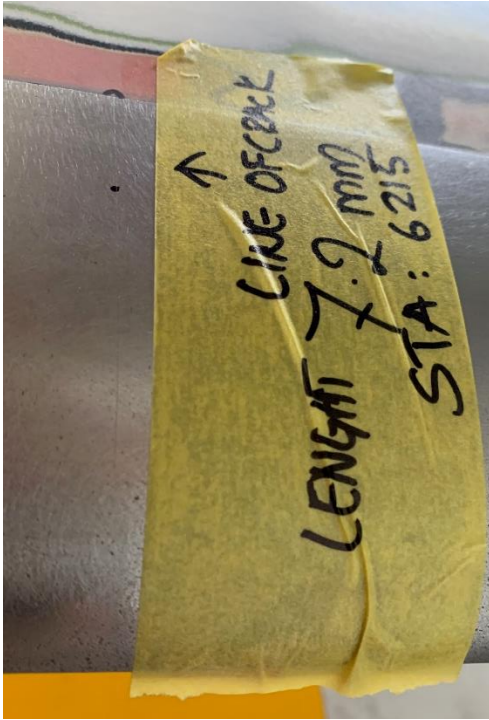

4.1 Rectification required:

- Erosion Shield to be replaced.
- Leading Edge Closure Cover to be replaced in conjunction with erosion shield replacement.

5. Inboard trim tab found debonded and corroded.

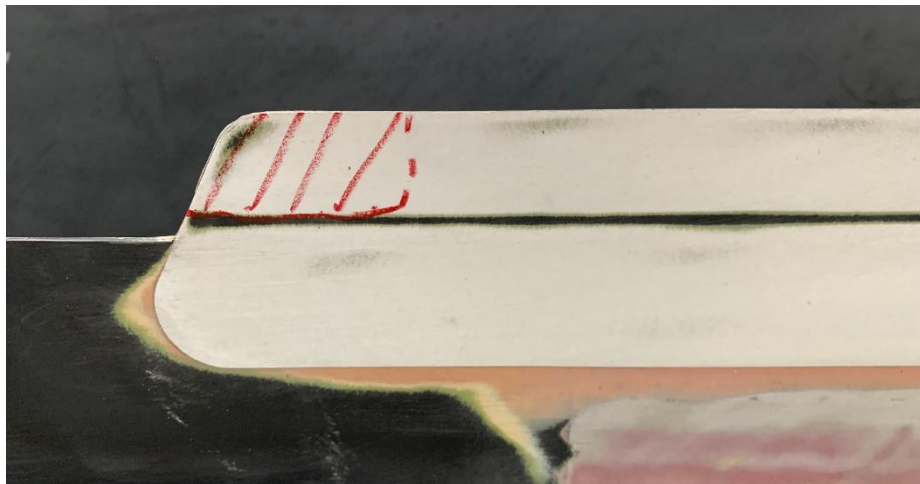

5.1 Rectification required:

- Inboard trim tab to be replaced/upgraded to stainless steel tab.
- Outboard trim tab to be replaced/upgraded in conjunction to Inboard tab replacement.
- Complied with SB139-501 Rev B

6. Trailing Edge found grinding.



6.1 Rectification required:

- Superficial repair to be performed.

7. Data tag found missing.



7.1 Rectification required:

- Data tag to be bonded.

8. SB139-501 Rev B to be complied.


8.1 Rectification required:

- Inboard and Outboard Tabs to be replaced and upgraded (**See Discrepancy No. 5**)
- Lightning Conductor Strip to be replaced (**See Discrepancy No. 3**)
- Tip Weight Balance Pocket Cover to be replaced/upgraded to Titanium.

9. Complete Refinish and Static Balance to be performed at the end of the repairs.

Name: Justin Kok

Signature:

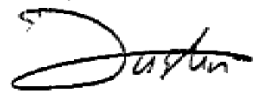A handwritten signature in black ink, appearing to read "Justin", written in a cursive style.