

**Blade Repair Workshop Inspection Report**

<i>Customer:</i>	Galaxy Aerospace
<i>Part Number:</i>	<b>3G6210A00131</b>
<i>Serial Number:</i>	AW4236E
<i>TTSN:</i>	1917.15
<i>Date:</i>	2 April 2024

**The above blade has been inspected by Leonardo Malaysia Blade Repair Workshop with the following findings noted:**

**Defect reported by customer:** Found deformed on tip





**Rectification required:-**

- ❖ *Tip Cap to be replaced*
- ❖ *Blade to body cover to be replaced in conjunction with tip cap replacement*


**Inspection findings:**

1. Tip weight pocket cover found heavily corroded




**Rectification required:** *Tip weight pocket cover to be replaced*

**2. Both root end bushings found crack**

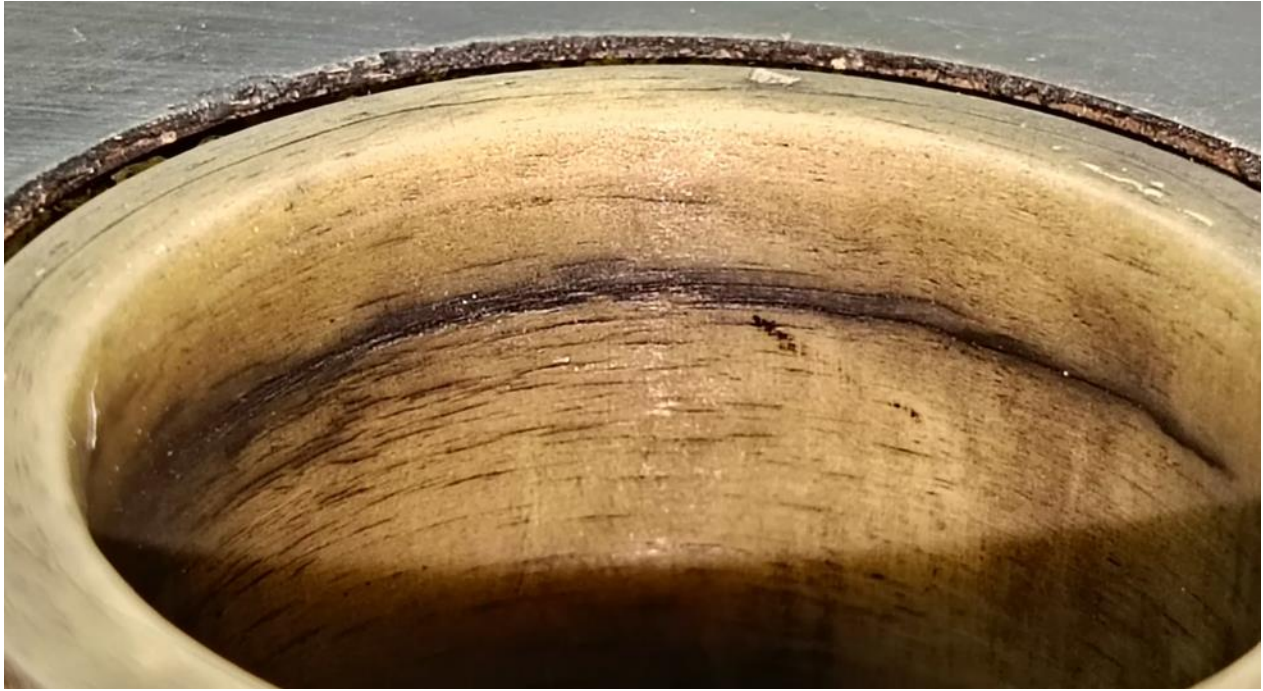

**FWD**

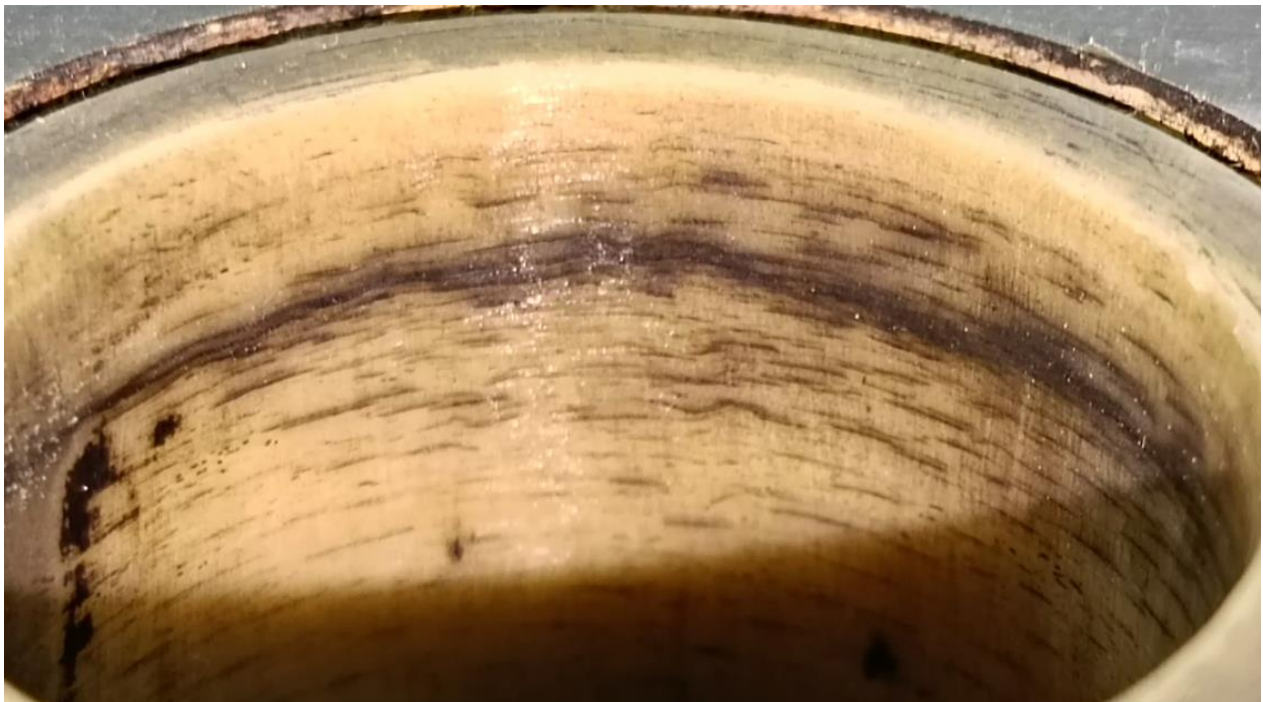

**AFT**

**Rectification required: Both bushings to be replaced**

**3. Leading Edge cover to be replaced to facilitate static balance**



**4. Complete refinish to standard scheme required due to nature of repair**



**5. Complied with SB139-617, LCS corrosion protection layer**