
 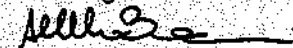


1. Approving Competent Authority/Country ENAC / ITALY	2. AUTHORIZED RELEASE CERTIFICATE EASA FORM 1			3. Form Tracking Number AGU-2022-80040	
4. Organisation name and address: Leonardo S.p.A. HELICOPTERS Stabilimento di Cascina Costa via G. Agusta, 520 - 21017 Cascina Costa di Samarate (VA) ITALY				5. Work Order/Contract/Invoice AT40000131-14-E20.1227	
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
1	MAIN GEARBOX, ASSY	3G6320A00134	1	Q221	REPAIRED
12. Remarks REF WORK REPORT n° 65899328 TOTAL TIME: 3125.20 T.S.O.: 48.45 LANDINGS: 9121 REMOVED FROM: AW139 31726 9M-PMB INTERNAL INHIBITION PERFORMED ON 16/02/2022; EXPIRING DATE SEE TAG ENCLOSED "The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR Part 43 and in respect to that work, the items are approved for return to service under certificate no. U3GY111D"					
13. Certifies that the work identified in block 11 was performed in accordance with the applicable regulations of Part 145 and in respect to that work the items are considered ready for return to service.			14a. <input checked="" type="checkbox"/> Part-145 A.50 Release to Service <input type="checkbox"/> Other regulation specified in block 12		
			Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready to release to service		
			14b. Authorised Signature  C.A. n° 35 - C.I.T. N° 35		
14d. Name Alberto Baroni			14e. Date (dd mmm yyyy) 17 feb 2022		
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s) Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensure that his/her airworthiness authority accept items from the airworthiness authority specified in block 1 Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulation by the user/installer before the aircraft may be flown					



Leonardo Helic. - Cs. Costa R.G

N. 65899328

MANUALI di RIFERIMENTO
REF. MANUALS

AW139 I.E.T.P. issue 40th issued 10 Dec.2021

BOLLETTINI TECNICI P.A. APPLICATI
TECHNICAL BULLETINS AND AIRWORTHINESS / DIRECTIVES COMPLIED WITH
///

PROPRIETARIO/ESERCENTE Leonardo Malaysia
CUSTOMER

DENOMINAZIONE GEARBOX ASSY MAIN
PART NAME

PIN IN 3G6320A00134
PIN OUT 3G6320A00134

S/N IN Q221
S/N OUT Q221

ORE TOTALI 3125.20
TOTAL TIME

ORE D.U.R. 48.45
T.S.O.

SBARCATO DA AW139 N/C: 31726 MARKS: 9M-PMB
REMOVED FROM

CAUSA
REASON

Lightning strike (S.I. n° IT40/21/0702)

OPERAZIONI DI MANUTENZIONE
MAINTENANCE OPERATIONS

Repaired
-L.A.W. Activity program n° AW139-641.rev. B
-Performed disassembly at sub-assembly level, visual inspection, reassembly, running-in, post-running inspection, leak testing, sealing and painting.

MODIFICHE
MODIFICATIONS

///

LUOGO E DATA
PLACE AND DATA

LEONARDO
HELICOPTERS
Cascina Costa

16 FEB 2022

CERTIFYING STAFF
FIRMA(SIGNATURE)

G.S. 174
035
Alberto Baroni
///

CONTROLLORE
FIRMA(SIGNATURE)

A14
001
Bojars
///


AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

///

Questo rapporto è costituito da n. 8 fogli
This report consists of n. 8 sheets

RAPPORTO DI LAVORO WORK REPORT		DATA 24.01.2022	NR. DOCUMENTO RV 30001122221	PAG. SHEET 1	DI OF 1
DATA 12.11.2021		WBS 40000131-14-E20.1227			

 

Leonardo Helic. - Cs. Costa R.G
N. 65899328

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
24.01.2022

NR. DOCUMENTO
RV 30001122221

PAG. DI
1 1

DATA 12.11.2021

WBS A40000131-14-E20.1227

**RIPARAZIONI
REPAIRS**

REF.ASSY GEARBOX ASSY MAIN

P/N IN 3G6320A00134
P/N OUT 3G6320A00134

S/N IN Q221
S/N OUT Q221

PART NUMBER N.PEZZI
N.PIECES

DENOMINAZIONE
PART NAME

W.O. PR.

ATTEST. ESECUZIONE
ATTEST. EXECUTION

DATA
DATE

FIRMA
SIGNATURE

3G6330A00532 1,000
SN P364

ANTITORQUE BEAM ASSY

16 FEB 2022

**A14
001**

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 010 DANNI Replaced n° 1 bush

Installed Antitorque Beam same p/n OVERHAULED

LUOGO E DATA
PLACE AND DATA

LEONARDO
HELICOPTERS
Cascina Costa

16 FEB 2022

CERTIFYING STAFF
FIRMA(SIGNATURE)

C.S. A14
035

Alberto Baroni

Alberto Baroni

CONTROLLORE
FIRMA(SIGNATURE)

**A14
001**

Alberto Baroni

AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni



Leonardo Helic. - Cs. Costa R.G.
N. 65899328

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
24.01.2022

NR. DOCUMENTO
RV 30001122221

PAG. OF
1 4

DATA 12.11.2021

WBS#40000131-14-E20.1227

**SOSTITUZIONI
REPLACEMENT**

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N Q221

**P/N E DENOMINAZIONE
P/N AND PART NAME**

**N.PEZZI
N.PIECES**

**MOTIVO DELLA SOSTITUZIONE
REASON OF SUBSTITUTION**

AW002GR-B001CD
GUARNIZIONE A "C" CON MOLLA

4,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3K6320V02053
BUSH ASSY, GIMBAL

4,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3K6320A06051
WASHER, CUP LOCK SPINNER NUT

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3K6320V00952
FACE SEAL ASSY

2,000

010 DANNI
DAMAGE

S/N: KHI-REX-1813; KHI-REX-1812

3G6320L00251
SEAL PUMP

4,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3G6320L00151
SEAL PTFE 28X48X7

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3G6320V00451
SEAL, LIP 170.5X195.5X12

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

A866A65803W
GUARNIZIONE AD ANELLO

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3G6320V04453
FILTER, ELEMENT

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

A866A31603W
GUARNIZIONE AD ANELLO

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

**LUOGO E DATA
PLACE AND DATA**

LEONARDO
HELICOPTERS
Cascina Costa

16 FEB 2022

**CERTIFYING STAFF
FIRMA(SIGNATURE)**

C.S. 474
035

Alberto Baroni

Alberto Baroni

**CONTROLLORE
FIRMA(SIGNATURE)**

A14
001

[Signature]

**AUTORIZZAZIONE
AUTHORIZATION**

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni

Leonardo Helic. - Cs. Costa R.G.
N. 65899328

RAPPORTO DI LAVORO
WORK REPORT

DATA
24.01.2022

NR. DOCUMENTO
RV 30001122221

PAG.
SHEET
2

DI
OF
4

DATA 12.11.2021

WBS A40000731-14-E20.1227

SOSTITUZIONI
REPLACEMENT

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N Q221

P/N E DENOMINAZIONE
P/N AND PART NAME

N.PEZZI
N.PIECES

MOTIVO DELLA SOSTITUZIONE
REASON OF SUBSTITUTION

3G6320V01151
SEAL, LIP TAIL ROTOR

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

A866A31802W
GUARNIZIONE AD ANELLO

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

3G6320V01252
BEARING, BALL ACCESSORY

5,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n: 08269; 19433; 08268; 19431; 07442

3K6320V00551
BEARING, BALL CLUTCH SUPPORT OUTBOARD

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n khi-koyo-1181; khi-koyo-m83

3K6320V00651
BEARING BALL, CLUTCH SUPPORT INBOARD

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n khi-koyo-r08; khi-koyo-r09

3K6320V00154
BRG BALL, DUPLEX SET INPUT PINION

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n khi-snfa-07258; khi-snfa-07259

3G6320V00551
BEARING, BALL TRIPLEX

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n 1188; 19169

3G6320V00751
BEARING, BALL COLLECTOR

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n 20120

3G6320V01051
BEARING, BALL TAIL ROTOR

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n 117

3G6320A01154
GEAR, RING FIXED 125T

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n p156/1

LEONARDO
HELICOPTERS

3G6320V00651a, Costa
BEARING, BALL MAST

1,000

046 RIMESSA IN EFFICIENZA



Alberto Baroni

16 FEB 2022

Alberto Baroni

A14
001

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni

Leonardo Helic. - Cs. Costa R.G.
N. 65899328

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
24.01.2022

NR. DOCUMENTO
RV 3000112221

PAG. DI
SHEET OF
3 4

DATA 12.11.2021

WBS 40000131-14-E20.1227

**SOSTITUZIONI
REPLACEMENT**

REF. ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N Q221

**P/N E DENOMINAZIONE
P/N AND PART NAME**

**N.PEZZI
N.PIECES**

**MOTIVO DELLA SOSTITUZIONE
REASON OF SUBSTITUTION**

3G6330A00234
UPPER FITTING ASSY

4,000

SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n 19-16726

3G6230A02231
FORWARD SERVO BRACKET ASSY

1,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE
(Lightning strike) See Activity program
s/n r1740; r1739; r1745; r1746
Out p/n dash 232

3G6230A02331
AFT SERVO BRACKET ASSY

2,000

034 MANCANTE IN RICEZIONE
INCOMPLETE

3G6320A01853
SHAFT, MAIN ROTOR

1,000

034 MANCANTE IN RICEZIONE
INCOMPLETE

3G6320V00251
BEARING, ROLLER MAST

1,000

025 INCIVOLO
AIRCRAFT ACCIDENT
s/n p227
EVIDENCE PASSING LIGHTNING ON THE TRACK BEARING (Ref p/n
3g6320v00251)

Scrapped assy p/n 3G6320A07234 s/n Q203

3G6320V00651
BEARING, ROLLER 2ND STAGE

1,000

025 INCIVOLO
AIRCRAFT ACCIDENT
s/n 20110
EVIDENCE PASSING LIGHTNING ON THE TRACK AND ROLLER

007 CORROSIONE
CORROSION
s/n:08142

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

LCD-CORR A120 Corrosion

3K6320V00451
BEARING BALL, INPUT GEAR

2,000

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

 
S/N:KHI-NTN-R72;KHI-NTN-515
DESTROYED FOR INSPECTION

3G6320A18951
ECS PLUG

1,000

034 MANCANTE IN RICEZIONE
INCOMPLETE

LEONARDO
3G6320A10051 HELICOPTERS
WASHER scina Costa



Alberto Baroni

16 FEB 2022

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

046 RIMESSA IN EFFICIENZA
SERVICEABLE RELEASE

A14
001

Alberto Baroni

N. 65899328
Leonardo Helic. - Cs. Costa R.G

RAPPORTO DI LAVORO
WORK REPORT

DATA 12.11.2021

DATA
24.01.2022

NR. DOCUMENTO
RV 30001122221

PAG. 4
DI 4
SHEET OF

WBS 40000131-14-E20.1227

SOSTITUZIONI
REPLACEMENT

REF. ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N Q221

P/N E DENOMINAZIONE
P/N AND PART NAME

N. PEZZI
N. PIECES

MOTIVO DELLA SOSTITUZIONE
REASON OF SUBSTITUTION

3G6320A13731
GAUGE ASSY. MGB OIL LEVEL

1,000

010 DANNI
DAMAGE



Leonardo Helic. - Cs. Costa R.G
N. 65899328

**RAPPORTO DI LAVORO
WORK REPORT**

DATA 12.11.2021

WBS 40000131-14-E20.1227

NR. DOCUMENTO
RV 3000112221

PAG.
SHEET
1

DI
OF
1

PRINCIPALI COMPONENTI INSTALLATI SULL' ASSIEME
MAIN COMPONENTS INSTALLED ON THE ASSEMBLY

(CON LIMITI DI VITA E/O REQUISITI DI ISPEZIONE)
(WITH RETIREMENTS LIFE AND/OR INSPECTION REQUIREMENTS)

DENOMINAZIONE PART NAME	P/N	S/N	ORE TOTALI	ORE D.U.R.	TOTAL TIME	T.S.O.
REF. ASSY GEARBOX ASSY MAIN			P/N 3G6320A00134		S/N Q221	
GIMBAL SUPPORT ASSY	3K6320A01132		KHI-MMC-669	3125.20		48.45
GIMBAL SUPPORT ASSY	3K6320A01132		KHI-MMC-686	3125.20		48.45
CASE, TOP ASSY	3G6320A01035		CN00012	22553 LDGS		27 LDGS
SHAFT, MAIN ROTOR	3G6320A01853		P192 (8477 LDG)	4721.39		00.00
CASE, MAIN ASSY	3G6320A02739		AW301 (27 LDGS)	48.45		NEW
UPPER FITTING ASSY	3G6330A00234		ACC0142	00.00		NEW
UPPER FITTING ASSY	3G6330A00234		ACC0144	00.00		NEW
UPPER FITTING ASSY	3G6330A00234		ACC0145	00.00		NEW
UPPER FITTING ASSY	3G6330A00234		ACC0082	00.00		NEW
ANTITORQUE BEAM ASSY	3G6330A00532		LMA402 (5021 LDGS)	4086.50		00.00
NUT, BEARING LOCK	3G6320A09152		DAT4607 (27 LDGS)	48.45		NEW
NUT, BEARING LOCK	3G6320A09152		DAT4615 (27 LDGS)	48.45		NEW
NUT, BEARING LOCK	3G6320A09152		DAT4616 (27 LDGS)	48.45		NEW
NUT, BEARING LOCK	3G6320A09152		DAT4617 (27 LDGS)	48.45		NEW
NUT, BEARING LOCK	3G6320A09152		DAT4868 (27 LDGS)	48.45		NEW
PUMP, LUBRICATION	3G6320V04252		2482	48.45		NEW
PUMP, LUBRICATION	3G6320V04252		2483	48.45		NEW

LUOGO E DATA
PLACE AND DATA

LEONARDO
HELICOPTERS

Cascina Costa

16 FEB 2022

CERTIFYING STAFF
FIRMA(SIGNATURE)



Alberto Baroni

Alberto Baroni

CONTROLLORE
FIRMA(SIGNATURE)

 


Alberto Baroni

AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni



Leonardo Helic. - Cs. Costa R.G
N. 65689326

**RAPPORTO DI LAVORO
WORK REPORT**

DATA 12.11.2021

WBS# 40000131-14-E20.1227

REF.ASSY: GEARBOX ASSY MAIN

P/N IN 3G6320A00134
P/N OUT 3G6320A00134

S/N IN Q221
S/N OUT Q221

**NOTE
NOTES**

At present time, MGB has performed 9121 total landings.
(27 landings T.S.O.)

NR. DOCUMENTO
RV 30001122221

DATA
24.01.2022

PAG. DI
SHEET OF
1 1

LUOGO E DATA
PLACE AND DATA

LEONARDO
HELICOPTERS
Cascina Costa
16 FEB 2022

CERTIFYING STAFF
FIRMA(SIGNATURE)

C.S. 414
035
Alberto Baroni
Musa

CONTROLLORE
FIRMA(SIGNATURE)

A14
001

zagoss

AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Musa



LOG CARD

NOTICE: WHEN THIS ASSY IS RETURNED FOR ANY REASON TO AN AGUSTA GROUP FACILITY, PLEASE SEND THIS FORM UPDATED.

Serial no 1

Chapter n° 63
Part n°

DESCRIPTION (1) MAIN GEARBOX ASSY.	P/N (2) 3G6320A00134	S/N (3) Q221	MANUFACTURER NAME (4) AGUSTA	ASSEMBLY DATE (5) SEPTEMBER 08	RETIREMENT LIFE (6) 5000 FH OH
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE (11)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE (11)

NOTES (12)
ENSURE ALL COMPONENT CARDS SUBJECT TO LIFE PENALTIES ARE UPDATED AT ASSEMBLY REMOVAL **NO FLIGHTS WITH CAT. A, EXT. HOIST, EXT. LOAD LPF**

ASSEMBLY HISTORICAL RECORD

INSTALLATION							REMOVAL							
DATE (13)	A/C		ASSY		ORGANIZATION (19)	STAMP AND SIGNATURE (20)	DATE (21)	A/C TOTAL TIME (22)	ASSY		REASON OF REMOVAL (25)	ORGANIZATION (26)	STAMP AND SIGNATURE (27)	
	R. MARKS (14)	N/C (15)	TOTAL TIME (16)	TOTAL TIME (17)					TIME SINCE OH (18)	TOTAL TIME (23)				TIME SINCE OH (24)
OCT. 08	I-LIDE	31227	00.00	00.00	NEW	AGUSTA		27/07/2020	3076.59	3076.59	NEW	ALIDAUNIA S.p.A.		
26 APR 2011 (9M-PMB-5874-002)	9M-PMB	31726	1646:05	9094.606 3076.59	00.00	GIAM		23 JUN 2021	3066.00 1694:50	9121 3125:20	27.009 48.45	STRUCK BY LIGHTNING STRIKE	GIAM (9M-PMB-6985)	
				9121 LRV 3125 FH	27.009 63.45 FH									



LOG CARD

Section 2

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

ATA Chapter

COMPONENTS INSTALLED ON ASSY											
ASSY P/N (26)		3G6320A00134				ASSY S/N (27)		Q221			
COMPONENT DATA			INSTALLATION				REMOVAL				
DESCRIPTION (28)	P/N (29)	MANUFACTURING DATE (31)	ASSY TOTAL HOURS (33)	COMPONENT TOTAL HOURS (34)	TIME SINCE OH (35)	DATE (36)	ASSY TOTAL HOURS (38)	COMPONENT TOTAL HOURS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	TIME SINCE OH (41)	DATE (42)
	S/N (30)	RETIREMENT LIFE / TIME LIMITS (32)	TOTAL LANDINGS (33)	TOTAL LANDINGS (34)	LANDINGS SINCE OH (35)	STAMP AND SIGNATURE (37)	TOTAL LANDINGS (38)	TOTAL LANDINGS (39)	TOTAL LANDINGS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	STAMP AND SIGNATURE (43)
			TOTAL LIFTS/CYCLES (33)	TOTAL LIFTS/CYCLES (34)	LIFTS/CYCLES SINCE OH (35)		TOTAL LIFTS/CYCLES (38)	TOTAL LIFTS/CYCLES (39)		LIFTS/CYCLES SINCE OH (41)	
Anti Torque SEAM	3G6330A00332		3135 ²⁰	6096 ⁵⁰	60,00	16 FEB 2022					
	LRAC02	22005FH 63002DC	9121	5021	0	B (A1) (001)					
Upper Fitting Assy	3G6330A00234					16 FEB 2022					
	ACC0163	LDG 133260	9121	00,00	NEW	B (A1) (001)					
Upper Fitting Assy	3G6330A00234					16 FEB 2022					
	ACC0164	LDG 133260	9121	00,00	NEW	B (A1) (001)					
Upper Fitting Assy	3G6330A00234					16 FEB 2022					
	ACC0165	LDG 133260	9121	00,00	NEW	B (A1) (001)					
Upper Fitting Assy	3G6330A00234					16 FEB 2022					
	ACC0082	LDG 133260	9121	00,00	NEW	B (A1) (001)					

AGUSTA

AGUSTAWESTLAND

LOG CARD

Sezione 2

NOTICE: WHEN THIS ASSY IS RETURNED FOR ANY REASON TO AN AGUSTA GROUP FACILITY, PLEASE SEND THIS FORM UPDATED.
REF. P/N: 3G6320A00134 S/N: Q221

Chapter n° 63
Part n°

LIMITED LIFE COMPONENTS INSTALLED ON ASSY

COMPONENT DATA				INSTALLATION				REMOVAL			
DESCRIPTION (28)	P/N (29)	S/N (30)	RETIREMENT LIFE (31)	ASSY TOTAL TIME (32)	COMP. TOTAL TIME (33)	COMP. TIME SINCE OH (34)	STAMP AND SIGNATURE (35)	ASSY TOTAL TIME (36)	COMP. TOTAL TIME (37)	COMP. TIME SINCE OH (38)	STAMP AND SIGNATURE (39)
FWR SERVO BRACKET ASSY	3G6230A02231	P211	On Condition	00.00	00.00	NEW	(A1) 234				
AFT SERVO BRACKET ASSY	3G6230A02331	P484	On Condition	00.00	00.00	NEW	(A1) 234				
AFT SERVO BRACKET ASSY	3G6230A02331	P487	On Condition	00.00	00.00	NEW	(A1) 234				
PF MAIN ROTOR SHAFT	3G6320A01853	P227	15300 FH/ 54000 Land	00.00	00.00	NEW	(A1) 234	9024 LDC 3125 ²⁰ FH	9121 LDC 3125 ²⁰ FH	29 LDC 68.45 FH	(A14) 001
PF MAIN CASE ASSY	3G6320A02738	P51	10000 FH/ 77500 Land	00.00	00.00	NEW	(A1) 234	9096 LDC 3076 ⁵⁹ FH	9096 LDC 3076 ⁵⁹ FH	NEW	(A14) 001
TOP CASE ASSY	3G6320A01035	P164	17000 FH	00.00	00.00	NEW	(A1) 234	9096 LDC	9096 LDC	NEW	(A14) 001
PF ANTITORQUE BEAM ASSY	3G6330A00532	P364	20000 FH/ 63000 Land	00.00	00.00	NEW	(A1) 234	9121 LDC 3125 ²⁰	9121 LDC 3125 ²⁰	68.45	(A14) 001
MODULE INPUT SHAFT	3K6320A00136	KHI-475	On Condition	00.00	00.00	NEW	(A1) 234				
MODULE INPUT SHAFT	3K6320A00136	KHI-476	On Condition	00.00	00.00	NEW	(A1) 234				
PUMP, LUBRIFICATION	3G6320V04252	0512	2500 OH	00.00	00.00	NEW	(A1) 234	3076 ⁵⁹	3076 ⁵⁹	NEW	(A14) 001
PUMP, LUBRIFICATION	3G6320V04252	0513	2500 OH	00.00	00.00	NEW	(A1) 234	3076 ⁵⁹	3076 ⁵⁹	NEW	(A14) 001
UPPER FITTING ASSY	3G6330A00232	P1167	95800 Land	00.00	00.00	NEW	(A1) 234	3076 ⁵⁹ FH 9093 Land	3076 ⁵⁹ FH 9093 Land	NEW	(A14) 001



LOG CARD

Sezione 2

NOTICE: WHEN THIS ASSY IS RETURNED FOR ANY REASON TO AN AGUSTA GROUP FACILITY, PLEASE SEND THIS FORM UPDATED.

Chapter n° 63

REF. P/N: 3G6320A00134 S/N: Q221

Part n°

LIMITED LIFE COMPONENTS INSTALLED ON ASSY

COMPONENT DATA				INSTALLATION				REMOVAL			
DESCRIPTION (28)	P/N (29)	S/N (30)	RETIREMENT LIFE (31)	ASSY TOTAL TIME (32)	COMP. TOTAL TIME (33)	COMP. TIME SINCE OH (34)	STAMP AND SIGNATURE (35)	ASSY TOTAL TIME (36)	COMP. TOTAL TIME (37)	COMP. TIME SINCE OH (38)	STAMP AND SIGNATURE (39)
UPPER FITTING ASSY	3G6330A00232	P1168	95800 Land	00.00	00.00	NEW	(A1 234)	3076.59 FH 9093 Land	3076.59 9093 Land	NEW	DAUNIA S.R.L.
UPPER FITTING ASSY	3G6330A00232	P1169	95800 Land	00.00	00.00	NEW	(A1 234)	3076.59 FH 9093 Land	3076.59 9093 Land	NEW	DAUNIA S.R.L.
UPPER FITTING ASSY	3G6330A00232	P1170	95800 Land	00.00	00.00	NEW	(A1 234)	3076.59 FH 9093 Land	3076.59 9093 Land	NEW	DAUNIA S.R.L.
UPPER FITTING	3G6330A00232	R1739	133240 Land	3076.59	8730.36 32436 Land	5223.37	DAUNIA S.R.L.	LDC 3121	LDC 32463	NEW	(A14 001)
UPPER FITTING	3G6330A00232	R1740	133240 Land	3076.59	8730.36 32436 Land	5223.37	DAUNIA S.R.L.	LDC 3121	LDC 32463	NEW	(A14 001)
UPPER FITTING	3G6330A00232	R1745	133240 Land	3076.59	8730.36 32436 Land	5223.37	DAUNIA S.R.L.	LDC 3121	LDC 32463	NEW	(A14 001)
UPPER FITTING	3G6330A00232	R1746	133240 Land	3076.59	8730.36 32436 Land	5223.37	DAUNIA S.R.L.	LDC 3121	LDC 32463	NEW	(A14 001)
CASE TOP ASSY	3G6320A01035	01000012	LDC 120000	3076.59 FH 9094 LDC	6974.00 FH 27526 LDC	00.00	(A14 001)				
CASE MAIN ASSY	3G6320A02735	12500 FH 61800 LDC	AW 301	3076.59 9094 LDC		00.00	NEW				(A14 001)
PUMP LUBRICATION	3G6320V04252	5000 OVH	2482	3076.59		00.00	NEW				(A14 001)
PUMP LUBRICATION	3G6320V04252	5000 OVH	2483	3076.59		00.00	NEW				(A14 001)
W/Bear with Lock	3G6320A09152	28000 LDC 6000 FH	DAF 4607				W. ROUC & S. RY				(A14 001)



LOG CARD

Section 2

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

ATA Chapter

COMPONENTS INSTALLED ON ASSY

ASSY P/N (26)		3G6320A00134				ASSY S/N (27)		Q221			
COMPONENT DATA			INSTALLATION				REMOVAL				
DESCRIPTION (28)	P/N (29)	MANUFACTURING DATE (31)	ASSY	COMPONENT			ASSY	COMPONENT			
	S/N (30)	RETIREMENT LIFE / TIME LIMITS (32)	TOTAL HOURS (33)	TOTAL HOURS (34)	TIME SINCE OH (35)	DATE (36)	TOTAL HOURS (38)	TOTAL HOURS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	TIME SINCE OH (41)	DATE (42)
			TOTAL LANDINGS (33)	TOTAL LANDINGS (34)	LANDINGS SINCE OH (35)	STAMP AND SIGNATURE (37)	TOTAL LANDINGS (38)	TOTAL LANDINGS (39)	TOTAL LANDINGS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	STAMP AND SIGNATURE (43)
TOTAL LIFTS/CYCLES (33)	TOTAL LIFTS/CYCLES (34)	LIFTS/CYCLES SINCE OH (35)		TOTAL LIFTS/CYCLES (38)	TOTAL LIFTS/CYCLES (39)		LIFTS/CYCLES SINCE OH (41)				
NUT BEARING LOCK	3G6320A09152		3076.59	00.00	NEW	23 Mar.2021					
	DAT4607	6000 FH 28000 LDG	9094	0	NEW	<i>[Signature]</i> A14 001					
NUT BEARING LOCK	3G6320A09152		3076.59	00.00	NEW	23 Mar.2021					
	DAT4615	6000 FH 28000 LDG	9094	0	NEW	<i>[Signature]</i> A14 001					
NUT BEARING LOCK	3G6320A09152		3076.59	00.00	NEW	23 Mar.2021					
	DAT4616	6000 FH 28000 LDG	9094	0	NEW	<i>[Signature]</i> A14 001					
NUT BEARING LOCK	3G6320A09152		3076.59	00.00	NEW	21 Mar.2021					
	DAT4617	6000 FH 28000 LDG	9094	0	NEW	<i>[Signature]</i> A14 001					
NUT BEARING LOCK	3G6320A09152		3076.59	00.00	NEW	23 Mar.2021					
	DAT4868	6000 FH 28000 LDG	9094		NEW	<i>[Signature]</i> A14 001					
SWIFT Main ROTOR	3G6320A09153		3125.20	4721.13	0000	16 Feb 2022					
	P-158	15000 FH 50000 LDG	8121	8477	9	<i>[Signature]</i> A14 001					



LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 2

ATA Chapter

COMPONENTS INSTALLED ON ASSY

ASSY P/N (26)		3G6320A00134				ASSY S/N (27)		Q221				
COMPONENT DATA			INSTALLATION				REMOVAL					
DESCRIPTION (28)	P/N (29)	MANUFACTURING DATE (31)	ASSY		COMPONENT		DATE (36)	ASSY		COMPONENT		
			TOTAL HOURS (33)	TOTAL HOURS (34)	TIME SINCE OH (35)	TOTAL HOURS (38)		TOTAL HOURS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	TIME SINCE OH (41)	DATE (42)	
	S/N (30)	RETIREMENT LIFE / TIME LIMITS (32)	TOTAL LANDINGS (33)	TOTAL LANDINGS (34)	LANDINGS SINCE OH (35)	STAMP AND SIGNATURE (37)	TOTAL LANDINGS (38)	TOTAL LANDINGS (39)	TOTAL LANDINGS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	STAMP AND SIGNATURE (43)	
			TOTAL LIFTS/CYCLES (33)	TOTAL LIFTS/CYCLES (34)	LIFTS/CYCLES SINCE OH (35)		TOTAL LIFTS/CYCLES (38)	TOTAL LIFTS/CYCLES (39)		LIFTS/CYCLES SINCE OH (41)		
Anti Torque SEAT	3G6330A00532		3135 ²⁰	4086 ³⁰	00,00	16 FEB 2022						
	LTA02	20000 FH 62000 LDC	9121	5021	0	3 (A14 001)						
Upper Fitting Assy	3G6330A00234					16 FEB 2027						
	ACC01G	LDC 133260	9121	00,00	NEW	3 (A14 001)						
Upper Fitting Assy	3G6330A00234					16 FEB 2022						
	ACC01UG	LDC 133260	9121	00,00	NEW	5 (A14 001)						
Upper Fitting Assy	3G6330A00234					16 FEB 2022						
	ACC01UG	LDC 133260	9121	00,00	NEW	3 (A14 001)						
Upper Fitting Assy	3G6330A00234					16 FEB 2027						
	ACC0082	LDC 133260	9121	00,00	NEW	3 (A14 001)						



LOG CARD

Section 1

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

ATA Chapter

DESCRIPTION (1) INPUT MODULE assy	P/N (2) 3K6320A00136	S/N (3) KHI-475	MANUFACTURER NAME (4) KAWASAKI	ASSEMBLY/MANUFACTURING DATE (5)	RETIREMENT LIFE / TIME LIMITS (6)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE / TIME LIMITS (11)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE / TIME LIMITS (11)

NOTES

DUPLICATE

ASSEMBLY HISTORICAL RECORD

INSTALLATION						REMOVAL						
DATE (12)	R. MARKS (13)	AC			ORGANIZATION, STAMP AND SIGNATURE (18)	DATE (19)	AC			REASON FOR REMOVAL (24)	ORGANIZATION, STAMP AND SIGNATURE (25)	
		TOTAL FLIGHT HOURS (15)	TOTAL HOURS (16)	TIME SINCE OH (17)			TOTAL FLIGHT HOURS (20)	ACTUAL TOTAL HOURS (21)	TOTAL HOURS WITH PENALTY FACTOR (22)			TIME SINCE OH (23)
		TOTAL LANDINGS (15)	TOTAL LANDINGS (16)	LANDINGS SINCE OH (17)			TOTAL LANDINGS (20)	ACTUAL TOTAL LANDINGS (21)	TOTAL LANDINGS WITH PENALTY FACTOR (22)			LANDINGS SINCE OH (23)
	S/N (14)	TOTAL LIFTS/CYCLES (15)	TOTAL LIFTS/CYCLES (16)	LIFTS/CYCLES SINCE OH (17)		TOTAL LIFTS/CYCLES (20)	ACTUAL TOTAL LIFTS/CYCLES (21)	TOTAL LIFTS/CYCLES WITH PENALTY FACTOR (22)	LIFTS/CYCLES SINCE OH (23)			
26 APR 2011 CPMB-0014	9M-PMB 31726	1646:05 3039	3076.59 9094	00.00 NEW	GAM [Signature]	23 JUN 2011 9M-PMB-6953	1694:50 3066	3125:20 2492:912	- - NEW 48-49 NEW 57	STRUCK BY LIGHTNING STRIKE	GAM [Signature]	
			3125:20	48.45								



LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 3

ATA Chapter

ASSEMBLY ACTIVITY HISTORY

ASSY P/N (44)		INPUT MODULE assy		ASSY S/N (45)	KHI-475	
DATE (46)	TOTAL HOURS (47)	TASKS (48)	ACTIVITIES (49)	ORGANIZATION (50)	STAMP AND SIGNATURE (51)	
	TOTAL LANDINGS (47)					
	TOTAL LIFTS/CYCLES (47)					
23 Mar 2021	3076.59	Unusual noise fan drive quill zone (MGB)	OVERHAULED	LEONARDO C.COSTA		
16 FEB 2022	3129.20	LIGHTNING STRIKE	REQUIRED IAW WR 65893328	LEONARDO C.COSTA		



LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY.

Section 3

ATA Chapter

ASSEMBLY ACTIVITY HISTORY

ASSY P/N (44)		INPUT MODULE, assy	ASSY S/N (45)	KHI-475	
DATE (46)	TOTAL HOURS (47)	TASKS (48)	ACTIVITIES (49)	ORGANIZATION (50)	STAMP AND SIGNATURE (51)
	TOTAL LANDINGS (47)				
	TOTAL LIFTS/CYCLES (47)				
23 Mar. 2021	3076.59	Unusual noise fan drive quill zone (MGB)	OVERHAULED	LEONARDO C.COSTA	
15 FEB 2022	3125.20	Lightning Strike	Repaired IAW WR 65893328	LEONARDO C.COSTA	



LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 4

ATA Chapter

AIRWORTHINESS DIRECTIVES AND BULLETINS COMPLIANCE

ASSY PIN (52)

INPUT MODULE, assy

ASSY S/N (53)

KHI-475

AIRWORTHINESS DIRECTIVES AND MANDATORY BULLETINS

OPTIONAL BULLETINS

AIRWORTHINESS DIRECTIVE/MANDATORY BULLETIN NUMBER (54)		ASSY TOTAL HOURS (57)		ORGANIZATION (58)	STAMP AND SIGNATURE (59)	OPTIONAL BULLETIN NUMBER (59)		ASSY TOTAL HOURS (57)		ORGANIZATION (58)	STAMP AND SIGNATURE (59)
ISSUE / REVISION (55)	DATE OF COMPLIANCE (56)	ASSY TOTAL LANDINGS (57)	ASSY TOTAL LIFTS/CYCLES (57)			ISSUE / REVISION (55)	DATE OF COMPLIANCE (56)	ASSY TOTAL LANDINGS (57)	ASSY TOTAL LIFTS/CYCLES (57)		



LOG CARD

Section 1

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

ATA Chapter

DESCRIPTION (1) INPUT MODULE assy	P/N (2) 3K6320A00136	S/N (3) KHI-476	MANUFACTURER NAME (4) KAWASAKI	ASSEMBLY/MANUFACTURING DATE (5)	RETIREMENT LIFE / TIME LIMITS (6)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE / TIME LIMITS (11)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE / TIME LIMITS (11)

NOTES
DUPLICATE

ASSEMBLY HISTORICAL RECORD

INSTALLATION						REMOVAL						
DATE (12)	A/C	ASSY			ORGANIZATION, STAMP AND SIGNATURE (18)	DATE (19)	A/C	ASSY			REASON FOR REMOVAL (24)	ORGANIZATION, STAMP AND SIGNATURE (25)
	R. MARKS (13)	TOTAL FLIGHT HOURS (15)	TOTAL HOURS (16)	TIME SINCE OH (17)			TOTAL FLIGHT HOURS (20)	ACTUAL TOTAL HOURS (21)	TOTAL HOURS WITH PENALTY FACTOR (22)	TIME SINCE OH (23)		
	S/N (14)	TOTAL LANDINGS (15)	TOTAL LANDINGS (16)	LANDINGS SINCE OH (17)			TOTAL LANDINGS (20)	ACTUAL TOTAL LANDINGS (21)	TOTAL LANDINGS WITH PENALTY FACTOR (22)	LANDINGS SINCE OH (23)		
		TOTAL LIFTS/CYCLES (15)	TOTAL LIFTS/CYCLES (16)	LIFTS/CYCLES SINCE OH (17)		TOTAL LIFTS/CYCLES (20)	ACTUAL TOTAL LIFTS/CYCLES (21)		LIFTS/CYCLES SINCE OH (23)			
26 APR 2021 (9M-PMB-5874)	9M-PMB 31726	1646.05 3029	3076.59 9094	00.00 NEW	GAM 	23 JUN 2021 (9M-PMB-6785)	1694.50 3066	3125.20 * 9142 9121	-	NEW NEW	STRUCK BY LIGHTNING STRIKE	GAM
			3126.0	48.15								



LOG CARD

NOTICE THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 3

ATA Chapter

ASSEMBLY ACTIVITY HISTORY

ASSY P/N (44)		INPUT MODULE assy		ASSY S/N (45)	KHI-476	
DATE (46)	TOTAL HOURS (47)	TASKS (48)	ACTIVITIES (49)	ORGANIZATION (50)	STAMP AND SIGNATURE (51)	
	TOTAL LANDINGS (47)					
	TOTAL LIFTS/CYCLES (47)					
23 Mar 2021	3076.59	Unusual noise fan drive quill zone (MGB)	OVERHAULED	LEONARDO C.COSTA	<i>[Signature]</i> PA14 2021	
15 FEB 2022	3125.20	Lightning Strike	REPAIRED IAW WR 100589320	LEONARDO E. COSTA	<i>[Signature]</i> PA14 2021	



LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 3

ATA Chapter

ASSEMBLY ACTIVITY HISTORY

ASSY P/N (44)		INPUT MODULE, assy		ASSY S/N (45)	KHI-476	
DATE (46)	TOTAL HOURS (47)	TASKS (48)	ACTIVITIES (49)	ORGANIZATION (50)	STAMP AND SIGNATURE (51)	
	TOTAL LANDINGS (47)					
	TOTAL LIFTS/CYCLES (47)					
23 Mar. 2021	3076.59	Unusual noise fan drive quill zone (MGB)	OVERHAULED	LEONARDO C.COSTA		
16 FEB 2022	3125.20	Lightning Strike	REPAIRED 1AW WR #065893328	LEONARDO E. COSTA		

