

WORK ORDER 2019 281 001 (SMI)

A/C Reg:	9M-LKE
S/N:	8297
A/C Type:	AS 350 B3

Schedule Maintenance Inspection / Retrofit/Others MRO/Defect Rectification	Man Hours
- 3M Inspection	
- 150H // 3M Inspection	
- 1M Inspection	
- 150H Punctual Inspection - MRB, TRB, Tail Rotor Drive Shaft, TGB	
- 165H ASB 62.00.42 R0	
- 165H ASB 01.00.70 R1	
-	
-	
-	
-	
-	
-	
-	
-	
-	
-	



SUMMARY WORK ORDER SIGNOFF SHEET						
CUSTOMER	A/C Registration	A/C MSN	Work Order No			
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000002			

MI No: ASB 01.00.70 R1 -EQUIPPED AS PER §1.A.1B

MI Title: LIMITATIONS- TAIL ROTOR DRIVE SHAFT BEARINGS

Work Description:

For helicopters equipped with the tail rotor drive shaft bearing specified in paragraph 1.A.1.b.:

- Comply with the maintenance instructions given in the ALS (Airworthiness Limitations Section).
- Perform a visual check at intervals not exceeding 165 flying hours:

Ensure:

. that the bearing damper bushes are in good condition as per paragraph 2.2.2 of Maintenance Manual (MET) Work Card 65.10.00.601 or Aircraft Maintenance Manual (AMM)

Task 65-11-00, 6-15b.

- . that the stainless steel bearing is in good condition as per paragraph 3.2.4.b. of MET Work Card 65.10.00.601 or AMM Task 65-11-00, 6-15b.
- . that the bearing support is in good condition as per MET Work Card 53.00.00.606 or AMM Task 53-31-00, 6-4.

hat the sleeves did not rotate on the tail rotor shaft tube as per paragraph 2.2.3 of MET Work and 65.10.00.601 or AMM Task 65-11-00, 6-13.

Life	0:00AH	Work Card	ASB 01.00.70 R1	
		Work Card Task Reference	N/A	

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n°: LKE0010 AS350-BALL BEARING P/N: 704A33-651-181 S/N: AMD 0753	165:00AH		4.	fr.	M513	18/7/299	Found satisfactions

MI No: AS350B3/25/66/20/000/000/010

MI Title: 1M-EMERGENCY LOCATOR TRANSMITTER

Work Description :

P/N: S1854501-01 (704A45737078) KANNAD INTEGRA AP-H (ER). Emergency locator transmitter autotest.

ET

aW AMM 25 66 20, 5-1

Life	1M	Work Card	AS350B3.25.66.20.§5-1	
		Work Card Task Reference	AMM 25-66-20 5-1	

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n°: LKE0011 AS350-EMERGENCY LOCATOR TRANSMITTER KANNAD P/N: S1854501-01 S/N: LX1100333169	25/07/2019	N/A	4.	Shi A	M53 a	18/07/19	CARRIED OUT, FOUND SATIS FACTORY.

'Certifies that the work specified, except as otherwise specified was carried out i.a.w CAAM Part 145 and in that respect the aircraft/ aircraft component is considered ready to release to service."

Issue date: 22/07/2019 09:45 AM AHM.F.099, Rev 0 Page: 7 of 10