



Annex 1 - AIRWORTHINESS DIRECTIVES STATUS LIST

Helicopter type: AW139
S/N: 31903

Last Check:

EASA: 2020-0271

Date: 18/12/2020
Signature: Zantomio

AUTHORITY	APPLICABLE AD	ISSUE DATE	TITLE	RELATED INFORMATION	STATUS	NOTES
EASA	2018-0112R1	04/06/2018	ATA 62 – Main Rotor – Main Rotor Damper – Inspection / Replacement		C.W. (SEE NOTE)	MR DAMPER INSTALLED WITH CORRECT TORQUE VALUES, I.A.W. PART A OF THE AD PART B IS NOT APPLICABLE TO MR DAMPERS P/N 3G6220V01353
EASA	2018-0130	18/06/2018	ATA 62 – Main Rotor – Main Rotor Blades – Inspection	ASB 139-520	N.A.	COMPONENT NOT AFFECTED
EASA	2018-0132	21/06/2018	ATA 05 – Time Limits / Maintenance Checks – Airworthiness Limitation Section – Amendment / Implementation	AW139 MM 39-A-AMPI-00-P, Chapter IV	C.W.	
EASA	2018-0208	20/09/2018	ATA 95 – Emergency Flotation System – Aft Float Assembly Inflation System – Removal / Installation	SB 139-533	N.A.	DIFFERENT P/N INSTALLED
EASA	2018-0292	28/12/2018	ATA 64 – Tail Rotor – Tail Rotor Slider Assembly – Inspection	SB 139-569	N.C.W.	accumulated less than 2400 FH
EASA	2019-0022	01/02/2019	ATA 64 – Tail Rotor – Duplex Bearings – Replacement	SB 139-571 SB 169-134 SB 189-221	N.A.	COMPONENT NOT AFFECTED
EASA	2019-0036	15/02/2019	ATA 63 – Main Rotor Drive – Main Gearbox Bearing Lock-Nut – Replacement	SB 139-567	N.A.	SUPERSEDED BY EASA AD 2019-0174
EASA	2019-0073	28/03/2019	ATA 64 – Tail Rotor – Full Ice Protection System Tail Rotor Blades – Inspection / Replacement	SB 139-580	N.A.	FIPS KIT NOT INSTALLED
EASA	2019-0149	24/06/2019	ATA 71 – Powerplant – Engine Mounting Rods – Replacement	SB 139-593	N.A.	COMPONENT NOT AFFECTED
EASA	2019-0174	18/07/2019	ATA 63 – Main Rotor Drive – Main Gearbox Bearing Lock-Nut – Replacement	SB 139-567	N.A.	SUPERSEDED BY EASA AD 2020-0011
EASA	2019-0235	20/09/2019	ATA 25 – Equipment / Furnishings – Emergency Locator Transmitter – Inspection / Modification / Replacement	ACR Electronics, Inc. SB1000 original is:	N/A	DIFFERENT P/N INSTALLED
EASA	2019-0311	19/12/2019	ATA 25, 95 – Equipment / Furnishings, Emergency Flotation System – Inflation Hoses – Inspection	Leonardo S.p.A. Alert SB 139-610	N.A.	DIFFERENT P/N INSTALLED
EASA	2020-0011R1	20/11/2020	ATA 63 – Main Rotor Drive – Main Gearbox Bearing Lock Nut – Replacement	SB 139-609	N.C.W.	AFTER REACHED 26000 LANDINGS ACCUMULATED, TO BE APPLIED WITHIN 2000 LANDINGS OR NEXT OVERHAUL (SEE SB 139-609)
EASA	2020-0013	29/01/2020	ATA 26 - Fire Protection - Hand-held Fire Extinguishers - Replacement		N.A.	INSTALLED COMPONENT NOT AFFECTED
EASA	2020-0131	05/06/2020	ATA 25 – Equipment / Furnishings – Hoist Cable Cutter Frame – Modification	SEE SB 139-637	N.A.	S/N NOT AFFECTED
EASA	2020-0185	19/08/2020	ATA 25 – Equipment / Furnishings – Life Raft Reservoir and Actuator Cable – Replacement / Inspection	SEE SB 139-648	N.A.	N.A. BY S/N INSTALLED
EASA	2020-0191	04/09/2020	ATA 25 – Equipment / Furnishings – Forward Facing Central Seat(s) – Removal	SEE SB 139-633	N.A.	S/N NOT AFFECTED
EASA	2020-0271	08/12/2020	ATA 62 – Main Rotor – Swashplate Boot – Inspection	SEE SB 139-654	N.C.W.	INSPECTION/ADHESIVE RESTORING PERFORMED AT 11.55 FH. REPETITIVE DETAILED INSPECTIONS REQUIRED

C.W. = Compliant With
N.C.W. = Not Complied With
N.A. = Not Applicable