


SAFETY INFORMATION NOTICE

SUBJECT: EQUIPMENT AND FURNISHINGS

Belt buckle: Distribution of Service Information Letters 159-007, 169-003, 170-001 and 171-001 from Safran Seats France

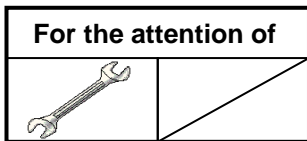

| AIRCRAFT CONCERNED | Version(s) | |
|--------------------|--------------------------|------------------------|
| | Civil | Military |
| EC120 | B | |
| AS350 | B, BA, BB, B1, B2, B3, D | L1 |
| AS550 | | A2, C2, C3, U2 |
| AS355 | E, F, F1, F2, N, NP | |
| AS555 | | AF, AN, SN, UF, UN, AP |
| EC130 | B4, T2 | |
| EC155 | B, B1 | |

SAFRAN SEATS France has issued several SIL following the distribution of FAA AD No. 2024-01-11 and EASA AD No. US-2024-01-11. These SIL concern batches of belt buckles manufactured by PARKER MEGGITT and installed on the helicopters listed in the table above.

The ADs follow the breakage of a belt buckle during an accident. Investigations revealed a manufacturing defect in the screws used in the belt buckles concerned.

SIL 159-007, 169-003, 170-001 and 171-001 are available in the appendix and require the belt buckles to be inspected to identify whether the screws are impacted by this manufacturing defect.

CAGE CODE : F0465

SERVICE INFORMATION LETTER
SIL 159-007

SUBJECT : Rotary buckle inspection

MODEL : 159-series seats P/N 1591718-XX (all S/N)

APPLICATION : Restraint system P/N 2000115-101 and P/N 2000115-121

TOOLING : Standard tools

REASON : This Service Information Letter indicates the P/N of the 159-series seats on which the restraint system buckles concerned by FAA AD 2024-01-11, Meggitt SB 1111475-25-001-2023 and SB 1111548-25-001-2023 are installed

EFFECTIVITY : N/A

WEIGHT CHANGE : N/A

IDENTIFICATION : N/A

ESTIMATED TIME : N/A

N. SCHWARTZ
Product Support
Coordinator

A. VEAUX
Product Support
Team Leader

ISSUE : 0

REF. : SIL 159-007

DATE : 23/02/2024

PAGE : 1 / 5

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / *This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization*

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

INDEX OF REVISION

| Revision | Date | Description of revision |
|-----------------|-------------|--------------------------------|
| 0 | 23/02/2024 | Original release |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

ISSUE : 0

REF. : SIL 159-007

DATE : 23/02/2024

PAGE : 2 / 5

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / *This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization*

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats

Safran Seats France

SERVICE INFORMATION LETTER

ACCOMPLISHMENT INSTRUCTIONS :

A - INSTRUCTIONS

1. List of seats P/N on which affected buckles can be installed

Below is the list of the P/N of 159-series seats on which the buckles concerned by Meggitt SB 11475-25-001-2023 can be installed

| Seat P/N | Restraint system P/N | Rotary buckle P/N |
|-----------------|-----------------------------|--------------------------|
| 1591718-02 | 2000115-101 | 1111475-01 |
| 1591718-03 | 2000115-101 | 1111475-01 |
| 1591718-04 | 2000115-101 | 1111475-01 |
| 1591718-05 | 2000115-121 | 1111475-01 |
| 1591718-06 | 2000115-101 | 1111475-01 |
| 1591718-08 | 2000115-121 | 1111475-01 |
| 1591718-15 | 2000115-121 | 1111475-01 |
| 1591718-20 | 2000115-101 | 1111475-01 |
| 1591718-30 | 2000115-101 | 1111475-01 |
| 1591718-31 | 2000115-101 | 1111475-01 |
| 1591718-32 | 2000115-101 | 1111475-01 |
| 1591718-33 | 2000115-101 | 1111475-01 |
| 1591718-40 | 2000115-101 | 1111475-01 |
| 1591718-44 | 2000115-101 | 1111475-01 |
| 1591718-47 | 2000115-101 | 1111475-01 |

NOTE : Rotary buckle P/N 1111548 is not used on 159-series seats

ISSUE : 0

REF. : SIL 159-007

DATE : 23/02/2024

PAGE : 3 / 5

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

SERVICE INFORMATION LETTER

NOTE : The rotary buckle is a sub-component of the restraint system. The date of manufacturing of the rotary buckle is indicated on the buckle as shown below :



Example of a rotary buckle
manufactured in January 2020



Example of a rotary buckle with
unknown date of manufacturing

- FIGURE 1 -

ISSUE : 0

REF. : SIL 159-007

Form PP5-040 – 021950 V2

DATE : 23/02/2024

PAGE : 4 / 5

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

SERVICE INFORMATION LETTER**2. Procedure to remove and install the restraint system**

The application of Meggitt SB 1111475-25-001-2023 may require the removal (and the installation) of the restraint system.

The references of the corresponding subtasks are given below

| Seat P/N | CMM | Removal procedure | Install procedure |
|-----------------|------------|----------------------------------|----------------------------------|
| 1591718-02 | 25-11-73 | Subtask 25-11-73-040-008-A001 | Subtask 25-11-73-440-008-A001 |
| 1591718-03 | | | |
| 1591718-04 | | | |
| 1591718-05 | | | |
| 1591718-06 | | | |
| 1591718-08 | | | |
| 1591718-15 | | | |
| 1591718-20 | | | |
| 1591718-30 | | | |
| 1591718-31 | | | |
| 1591718-32 | | | |
| 1591718-33 | | | |
| 1591718-40 | 25-12-41 | Subtask 25-12-41-040-004-A01 | Subtask 25-12-41-440-008-A01 |
| 1591718-44 | | | |
| 1591718-47 | | | |

ISSUE : 0**REF. : SIL 159-007****DATE : 23/02/2024****PAGE : 5 / 5**

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

CAGE CODE : F0465

SERVICE INFORMATION LETTER
SIL 169-003

SUBJECT : Rotary buckle inspection

MODEL : 169-series seats P/N 1691958-XX (all S/N)

APPLICATION : Restraint system P/N 2000029-01

TOOLING : Standard tools

REASON : This Service Information Letter indicates the P/N of the 169-series seats on which the restraint system buckles concerned by FAA AD 2024-01-11, Meggitt SB 1111475-25-001-2023 and SB 1111548-25-001-2023 are installed

EFFECTIVITY : N/A

WEIGHT CHANGE : N/A

IDENTIFICATION : N/A

ESTIMATED TIME : N/A

N. SCHWARTZ
Product Support
Coordinator

A. VEAUX
Product Support
Team Leader

ISSUE : 0

REF. : SIL 169-003

DATE : 23/02/2024

PAGE : 1 / 5

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats
Safran Seats France

SERVICE INFORMATION LETTER

INDEX OF REVISION

| Revision | Date | Description of revision |
|-----------------|-------------|--------------------------------|
| 0 | 23/02/2024 | Original release |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

ISSUE : 0

REF. : SIL 169-003

DATE : 23/02/2024

PAGE : 2 / 5

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

SERVICE INFORMATION LETTER**ACCOMPLISHMENT INSTRUCTIONS :****A - INSTRUCTIONS****1. List of seats P/N on which affected buckles can be installed**

Below is the list of the P/N of 169-series seats on which the buckles concerned by Meggitt SB 11475-25-001-2023 can be installed

| Seat P/N | Restraint system P/N | Rotary buckle P/N |
|-----------------|-----------------------------|--------------------------|
| 1691958-03 | 2000029-01 | 1111475-03 |
| 1691958-05 | 2000029-01 | 1111475-03 |
| 1691958-06 | 2000029-01 | 1111475-03 |
| 1691958-07 | 2000029-01 | 1111475-03 |
| 1691958-12 | 2000029-01 | 1111475-03 |
| 1691958-13 | 2000029-01 | 1111475-03 |
| 1691958-15 | 2000029-01 | 1111475-03 |
| 1691958-16 | 2000029-01 | 1111475-03 |
| 1691958-21 | 2000029-01 | 1111475-03 |
| 1691958-22 | 2000029-01 | 1111475-03 |
| 1691958-24 | 2000029-01 | 1111475-03 |

NOTE : Rotary buckle P/N 1111548 is not used on 169-series seats

ISSUE : 0**REF. : SIL 169-003****DATE : 23/02/2024****PAGE : 3 / 5**

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

SERVICE INFORMATION LETTER

NOTE : The rotary buckle is a sub-component of the restraint system. The date of manufacturing of the rotary buckle is indicated on the buckle as shown below :



Example of a rotary buckle
manufactured in January 2020



Example of a rotary buckle with
unknown date of manufacturing

- FIGURE 1 -

ISSUE : 0

REF. : SIL 169-003

Form PP5-040 – 021950 V2

DATE : 23/02/2024

PAGE : 4 / 5

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats

Safran Seats France

SERVICE INFORMATION LETTER

2. Procedure to remove and install the restraint system

The application of Meggitt SB 1111475-25-001-2023 may require the removal (and the installation) of the restraint system.

The references of the corresponding subtasks are given below

| Seat P/N | CMM | Removal procedure | Install procedure |
|-----------------|------------|---------------------------------|---------------------------------|
| 1691958-03 | 25-11-89 | Subtask 25-11-89-040-002-A01 | Subtask 25-11-89-440-003-A01 |
| 1691958-05 | | | |
| 1691958-06 | | | |
| 1691958-07 | | | |
| 1691958-12 | | | |
| 1691958-13 | | | |
| 1691958-15 | | | |
| 1691958-16 | | | |
| 1691958-21 | | | |
| 1691958-22 | | | |
| 1691958-24 | | | |

ISSUE : 0

REF. : SIL 169-003

DATE : 23/02/2024

PAGE : 5 / 5

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

CAGE CODE : F0465

SERVICE INFORMATION LETTER

SIL 170-001

SUBJECT : Rotary buckle inspection

MODEL : 170-series seats P/N 1701958-XX (all S/N)

APPLICATION : Restraint system P/N 2000029-03

TOOLING : Standard tools

REASON : This Service Information Letter indicates the P/N of the 170-series seats on which the restraint system buckles concerned by FAA AD 2024-01-11, Meggitt SB 1111475-25-001-2023 and SB 1111548-25-001-2023 are installed

EFFECTIVITY : N/A

WEIGHT CHANGE : N/A

IDENTIFICATION : N/A

ESTIMATED TIME : N/A

N. SCHWARTZ
Product Support
Coordinator

A. VEAUX
Product Support
Team Leader

ISSUE : 0

REF. : SIL 170-001

DATE : 23/02/2024

PAGE : 1 / 4

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / *This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization*

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats

Safran Seats France

SERVICE INFORMATION LETTER

INDEX OF REVISION

| Revision | Date | Description of revision |
|----------|------------|-------------------------|
| 0 | 23/02/2024 | Original release |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

ISSUE : 0

REF. : SIL 170-001

DATE : 23/02/2024

PAGE : 2 / 4

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

SERVICE INFORMATION LETTER

ACCOMPLISHMENT INSTRUCTIONS :

A - INSTRUCTIONS

1. List of seats P/N on which affected buckles can be installed

Below is the list of the P/N of 187-series seats on which the buckles concerned by Meggitt SB 11475-25-001-2023 can be installed

| Seat P/N | Restraint system P/N | Rotary buckle P/N |
|------------|----------------------|-------------------|
| 1701958-03 | 2000029-03 | 1111475-03 |
| 1701958-05 | 2000029-03 | 1111475-03 |
| 1701958-06 | 2000029-03 | 1111475-03 |
| 1701958-07 | 2000029-03 | 1111475-03 |
| 1701958-11 | 2000029-03 | 1111475-03 |
| 1701958-14 | 2000029-03 | 1111475-03 |

NOTE : Rotary buckle P/N 1111548 is not used on 170-series seats

NOTE : The rotary buckle is a sub-component of the restraint system. The date of manufacturing of the rotary buckle is indicated on the buckle as shown below :



Example of a rotary buckle manufactured in January 2020



Example of a rotary buckle with unknown date of manufacturing

- FIGURE 1 -

ISSUE : 0

REF. : SIL 170-001

DATE : 23/02/2024

PAGE : 3 / 4

Form PP5-040 - 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior - Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats

Safran Seats France

SERVICE INFORMATION LETTER

2. Procedure to remove and install the restraint system

The application of Meggitt SB 1111475-25-001-2023 may require the removal (and the installation) of the restraint system.

The references of the corresponding subtasks are given below

| Seat P/N | CMM | Removal procedure | Install procedure |
|-----------------|------------|---------------------------------|---------------------------------|
| 1701958-03 | 25-11-90 | Subtask 25-11-90-020-002-A01 | Subtask 25-11-90-420-003-A01 |
| 1701958-05 | | | |
| 1701958-06 | | | |
| 1701958-07 | | | |
| 1701958-11 | | | |
| 1701958-14 | | | |

ISSUE : 0

REF. : SIL 170-001

DATE : 23/02/2024

PAGE : 4 / 4

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

CAGE CODE : F0465

SERVICE INFORMATION LETTER

SIL 171-001

SUBJECT : Rotary buckle inspection

MODEL : 171-series seats P/N 1711952-00 (all S/N)

APPLICATION : Restraint system P/N 2000029-01

TOOLING : Standard tools

REASON : This Service Information Letter indicates the P/N of the 171-series seats on which the restraint system buckles concerned by FAA AD 2024-01-11, Meggitt SB 1111475-25-001-2023 and SB 1111548-25-001-2023 are installed

EFFECTIVITY : N/A

WEIGHT CHANGE : N/A

IDENTIFICATION : N/A

ESTIMATED TIME : N/A

N. SCHWARTZ
Product Support Coordinator

A. VEAUX
Product Support Team Leader

ISSUE : 0

REF. : SIL 171-001

DATE : 23/02/2024

PAGE : 1 / 4

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats
Safran Seats France

SERVICE INFORMATION LETTER

INDEX OF REVISION

| Revision | Date | Description of revision |
|----------|------------|-------------------------|
| 0 | 23/02/2024 | Original release |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

ISSUE : 0

REF. : SIL 171-001

DATE : 23/02/2024

PAGE : 2 / 4

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00

SERVICE INFORMATION LETTER**ACCOMPLISHMENT INSTRUCTIONS :****A - INSTRUCTIONS****1. List of seats P/N on which affected buckles can be installed**

Below is the list of the P/N of 171-series seats on which the buckles concerned by Meggitt SB 11475-25-001-2023 can be installed

| Seat P/N | Restraint system P/N | Rotary buckle P/N |
|------------|----------------------|-------------------|
| 1711952-00 | 2000029-01 | 1111475-03 |

NOTE : Rotary buckle P/N 1111548 is not used on 171-series seats

NOTE : The rotary buckle is a sub-component of the restraint system. The date of manufacturing of the rotary buckle is indicated on the buckle as shown below :



Example of a rotary buckle manufactured in January 2020



Example of a rotary buckle with unknown date of manufacturing

- FIGURE 1 -

ISSUE : 0**REF. : SIL 171-001****DATE : 23/02/2024****PAGE : 3 / 4**

Form PP5-040 - 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior - Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00



Safran Seats

Safran Seats France

SERVICE INFORMATION LETTER

2. Procedure to remove and install the restraint system

The application of Meggitt SB 1111475-25-001-2023 may require the removal (and the installation) of the restraint system.

The references of the corresponding subtasks are given below

| Seat P/N | CMM | Removal procedure | Install procedure |
|-----------------|------------|---------------------------------|---------------------------------|
| 1711952-00 | 25-11-91 | Subtask 25-11-91-020-002-A01 | Subtask 25-11-91-420-003-A01 |

ISSUE : 0

REF. : SIL 171-001

DATE : 23/02/2024

PAGE : 4 / 4

Form PP5-040 – 021950 V2

Ce document et les informations qu'il contient sont la propriété de Safran. Ils ne doivent être copiés ni communiqués à un tiers sans autorisation préalable et écrite de Safran / This document and the information contained herein are the property of Safran. They must not be copied or disclosed to third parties without prior Safran written authorization

Rue Robert Marechal Sénior – Z.I.La limoise - 36100 ISSOUDUN, FRANCE TELEPHONE: 33 (0) 2 54 03 39 39 FAX: 33 (0) 2 54 03 39 00