

- (1) Particulars of all maintenance work done on the aircraft.
- (2) Particulars of all overhauls, repairs, replacements, modifications and mandatory inspections relating to the aircraft or its equipment.
- (3) Particulars of any defects occurring in the aircraft or its equipment and of the rectification of such defects including a reference to the relevant entries in the technical log.
- (4) Certificate that in carrying out the overhaul, repairs, etc. all mandatory requirements applicable thereto have been complied with.

(5)

LOG BOOK ENTRY					9M-PEA	9M-PEA	9M-PEA	9M-PEA		
	A/C Type EC 120B	A/C SN 1275	A/C TT 4036.40	A/F Cyl 5946	For details of work performed, refer to AHM Work Order No. 2016 0045-065 001 	2016 0045 065 001 	2016 0045 065 001 	2016 0045 065 001 		
Engine Type & S/N: #1 : ARRIUS 2F 34241	TT 2340.20	HQ 2583.25	HP 3324.15							
#2 : NA	-	-	-							
100H/24M, 500H/24M, 100H/12M Insp. Annual Radio Insp. Airframe / 550H/24M, 100H/12M Engine inspection performed in accordance with the requirements of the Malaysian Civil Aviation Regulation for the time being in force and in that respect the aircraft/equipment is considered fit for Release to Service under CRS-SMI # 2016-SMI-010 .									No. of the Malaysian Civil 15-SMI-010	Malaysian Civil 010
Defect / Rectification / Out of Phase Inspection: -100h visual insp. on the repaired structure performed law EG1510046: PHS/MS/EC120B/SS.1_APP.H3 -100H tail rotor balancing law PHS/MS/EC120B/SS.1_APP.H3 - safe. -100H/SM AH 19A, para 5 battery check carried out law PHS/ME/EC120B/SS.1_APP.C2 - safe. -1M E1 self-test carried out law Poinier Avionics Manual sect. 4.2-3 & 4.3 -SM insp. performed law PHS/ME/EC120B/SS.1_APP.C2 -12M visual insp. performed on Garmin GAX 200 EC120B/178/VCA [APP H3] - safe -Continue to the next page:					hel P/N EN2138-04014	ped with 5/N	0-10. Nut with dome P/N			
AD / SR performed during this inspection: -IN 2769-1-01: Seat belt and shoulder restraint system performed safe. -AD 2007-0211 (ASB 05A006 R0) check of damper friction ring carried out - safe					Engine AD / SR performed during this inspection: -ML	2. Wash P/N	02e-2. Nut P/N			
Place and date: Subang, 11 April 2016					Sign and stamp: AHM.51.019a Rev 2 (06/06/2014)	4. 227196C040019.	46204E-0408CL Pin. 46204E-0408CL Pin. 46204E-0408CL Pin. 430234 Qty. 1. Qty. 1. 4629C100.			
-Continue to the next page- AD / SR performed during this inspection: -IN 2769-1-25: Seat belt and shoulder restraint system -AD 2007-0211 (ASB 05A006 R0) check of damper friction ring carried out - safe					Engine AD / SR performed during this inspection: -ML	Sign and stamp: AHM.51.019a Rev 2 (06/06/2014)	AHM.51.019a Rev 2 (06/06/2014)			