

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	1
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
SBs						
Types	SB Number	Subject	Last Done	Next Due	Interval	Limitation Notes
Repetitive SBs	SBA139-724 REV. B (EASA AD No.: 2022-0205)	ATA 64 - TAIL ROTOR DAMPER BRACKET INSPECTION	1600:25	1650:25	50	TIC-AW139-22-0158 DATED 28 JULY 2022 APPLICABLE DUE TO COMPONENT TAIL ROTOR DAMPER BRACKET ASSEMBLIE P/N 3G6420A06131 AND AFFECTED S/N FITTED ON AIRCRAFT
Repetitive SBs	SBA139-724 REV. B (EASA AD No.: 2022-0205)	ATA 64 - TAIL ROTOR DAMPER BRACKET INSPECTION	31/01/2023	31/07/2023	6	TIC-AW139-22-0158 DATED 28 JULY 2022 APPLICABLE DUE TO COMPONENT TAIL ROTOR DAMPER BRACKET ASSEMBLIE P/N 3G6420A06131 AND AFFECTED S/N FITTED ON AIRCRAFT
Repetitive SBs	SB N° 139-728 PART I	TAIL ROTOR DUPLEX BEARING REPETITIVE INSPECTIONS	-	00/00/0000	2	
Repetitive SBs	SB N° 139-728 PART I	TAIL ROTOR DUPLEX BEARING REPETITIVE INSPECTIONS	0:00	0:00	50	
Repetitive SBs	SBA139-661 REV.B PART II (EASA AD NO.: 2021-0044R1 PARA	300FH//1Y - ATA 24 OVERHEAD PANEL INSPECTION	1581:47	1881:47	300	TIC-AW139-22-0116 DATED 09 MAY 2022 9M-PMA-10005 @ 1347:55 FH ON 26/03/2022 (AJL 00021)
Repetitive SBs	SBA139-661 REV.B PART II (EASA AD NO.: 2021-0044R1 PARA	300FH//1Y - ATA 24 OVERHEAD PANEL INSPECTION	09/01/2023	09/01/2024	1	TIC-AW139-22-0116 DATED 09 MAY 2022 9M-PMA-10005 @ 1347:55 FH ON 26/03/2022 (AJL 00021)
Repetitive SBs	BT 139-443 REV A PART III (EASA AD 2015-0226R7)	GOODRICH RESCUE HOIST OVERLOAD CLUTCH INSPECTION	07/10/2022	07/04/2023	6	SN 40542 9M-PMA-8348 (AJL 04062) ON 12/10/2021 @ 1158:00 FH SN 40542 9M-PMA-10237 (AJL 00025) ON 12/04/2022 @ 1349:20 FH

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	2
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive SBs	SB139-526 PART I	ATA 63 - MGB OIL COOLING FAN INSPECTION	0:00	1846:40	200	<p>9M-PMA MGB COOLING FAN SB139-526 INFO (UPDATED 10/10/2021)</p> <p>FOR SN 141600635 9M-PMA, TERMINATING ACTION FOR PART I WILL BE THE INITIAL COMPLIANCE OF PART 2 (DUE 1200:00FH), CARRIED OUT IN 9M-PMA-7012 @ 1146:40 FH ON 27/09/2021 (AJL 04050)>> REPLACE WITH SN 141601271</p> <p>INITIAL COMPLIANCE PART 1 WP-PMA-20-2246 @ 676:05 FH ON 12/11/2020 (AJL 03149)</p> <p>REPETITIVE 200 FH FOR PART 1 2ND DUE ON 876:05 FH (CARRIED OUT IN 9M-PMA-6003 ON 25/02/2021 @ 865:00 FH (AJL 03732) 3RD DUE ON 1065:00 FH, CARRIED OUT IN 9M-PMA-7072 ON 21/06/2021 @ 1046:15FH (AJL 04007)</p> <p>FOR SN 141601271 9M-PMA, TERMINATING ACTION FOR PART I WILL BE THE INITIAL COMPLIANCE OF PART 2 (DUE 2346:40 FH), CARRIED OUT IN >> REPLACE WITH SN</p> <p>INITIAL COMPLIANCE PART 1 - SN 141601271 DUE AT 1846:40FH: CARRIED OUT IN</p> <p>REPETITIVE 200 FH FOR PART 1 2ND DUE ON</p>

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	3
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive SBs	50FH ASB139-654 PART II (EASA AD 2020-0271 PARA (2))	ATA 62 - MAIN ROTOR SWASHPLATE BOOT INSPECTION	1600:25	1650:25	50	TIC-AW139-20-199 9M-PMA-9764 @ 1306:45 FH ON 26/02/2022 (AJL 00002) 9M-PMA-10295 @ 1347:55 FH ON 23/03/2022 (AJL 00020) 9M-PMA-10657 @ 1393:45 FH ON 16/05/2022 (AJL 00047) 9M-PMA-11161 @ 1427:10 FH ON 06/06/2022 (AJL 00064) 9M-PMA-12012 @ 1493:45 FH ON 07.09.2022 (AJL 00105)
Repetitive SBs	BT 139-443 REV A PART III (EASA AD 2015-0226R7)	GOODRICH RESCUE HOIST OVERLOAD CLUTCH INSPECTION	0:00	400:00	400	LCO: WP-PMA-19-347-002 @ 159:50 FH ON 29.05.2019 WP-PMA-19-601-002 @ 219:20FH ON 15/08/2019 WP-PMA-19-600-002 @ 219:20FH ON 16/08/2019
Repetitive SBs	BT 139-443 REV A PART III (EASA AD 2015-0226R7)	GOODRICH RESCUE HOIST OVERLOAD CLUTCH INSPECTION	-	-	6	LCO: WP-PMA-19-347-002 @ 159:50 FH ON 29.05.2019 WP-PMA-19-601-002 @ 219:20FH ON 15/08/2019 WP-PMA-19-600-002 @ 219:20FH ON 16/08/2019
Repetitive SBs	SB 139-526 REV / PART II	ATA 63 MGB OIL COOLING FAN INSPECTION	1146:40	2346:40	1200	PART II: TO BE COMPLIED UPON REACHING 1200 FH AND THEN REPEATED EVERY 1200 FH.
Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	4
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SBEA 139-725 REV. A PART I (EASA AD 2022-0182 PARA 1)	ATA 64 - TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT	1551.84	1561.84	-/Required	TIC-AW139-22-0167 DATED 10 AUGUST 2022 9M-PMA-12169 @ 1469:50 FH ON 30.07.2022 (AJL 00089) - 1ST COMPLIANCE 9M-PMA-12249 @ 1477:35 FH ON 23.08.2022 (AJL 00098) 9M-PMA-12249 @ 1481:55 FH ON 26.08.2022 (AJL 00099) 9M-PMA-12249 @ 1489:15 FH ON 31.08.2022 (AJL 00101) 9M-PMA-12627 @ 1493:45 FH ON 07.09.2022 (AJL 00105) 9M-PMA-12627 @ 1500:40 FH ON 11.09.2022 (AJL 00109) 9M-PMA-12627 @ 1505:45 FH ON 13.09.2022 (AJL 00110)
Standard SBs	SBEA 139-731 REV./ PART II (EASA AD 2022-0209-E)	ATA 00 FORWARD CABIN ROOF CEILING HARNESS INSPECTION	-	-	-/Required	
Standard SBs	SBEA 139-731 REV./ PART I (EASA AD 2022-0209-E)	ATA 00 FORWARD CABIN ROOF CEILING HARNESS INSPECTION	-	-	-/Required	
Standard SBs	SB NO. 139-564,NEW ISSUE	AV900 CABIN STATION, POWER SOCKET AND AVIONIC VARIANT INSTALLATION	-	-	-/Required	
Standard SBs	SB NO. 139-672, NEW ISSUE (PART I)	NUMBER 4 PUMP LINE INSTALLATION VISUAL INSPECTION AND MODIFICATION	-	-	-/Required	
Standard SBs	SB NO. 139-672, NEW ISSUE (PART II)	NUMBER 4 PUMP LINE INSTALLATION VISUAL INSPECTION AND MODIFICATION (MMIR)	-	-	-/Required	
Standard SBs	SB NO. 139-723, NEW ISSUE	CABIN PROVISION MODIFICATION	-	-	-/Required	
Standard SBs	SBEA 139-725 REV. A PART II (EASA AD2022-0182 PARA 2)	ATA 64- TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT	1531.34	1581.34	-/Required	TIC-AW139-22-0167 DATED 10 AUGUST 2022 9M-PMA-12168 @ 1469:50 FH ON 30.07.2022 (AJL 00089) - 1ST COMPLIANCE 9M-PMA-12690 @ 1493:45 FH ON 07.09.2022 (AJL 00105)
Standard SBs	EVERY 25FH INSPECTION SB139-539 PART I	ATA 53 - TRDL BEARING SUPPORT PANEL REINFORCEMENT (PART I COMPLIANCE UNTIL ACCOMPLISHMENT PART III)	-	-	-/NOT APPLICABLE	TIC-AW139-22-0007 DATED 27 JANUARY 2022 NOT APPLICABLE DUE TO AFFECTED TAIL BOOM ASSY NOT FITTED ON AIRCRAFT.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	5
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-642, REV. A PART II	ATA 64 - TAIL ROTOR HEAD INSPECTION AND MODIFICATION	-	-	-/CANCELLED	LAST DONE 9M-PMA-74042 AT 1118:25FH ON 31/07/2021 (AJL 04036) SB139-642 REV. A DATED 27 SEP 2021 ISSUED IN ORDER TO CANCEL THIS SB SINCE CONTENT OF PART II HAS BEEN INTRODUCED IN AMPI CHAP 5 (TASK 64-38) AND PART 1 HAS EXPIRED.
TEMPORARY MAINTENANCE INSTRUCTION (TMI)						
Standard SBs	TMI 139-345 Rev B	REAR FUSELAGE CENTRAL FITTING AT STA8700 P/N 3P5340A14153 REPLACEMENT PROCEDURE AW139	-	-	-/FOR INFO ONLY	TIC-AW139-21-0266 APPLICABILITY: APPLICABLE DUE TO COMPONENT MIDDLE LEFT BRACKET STA 8700 P/N 3P5340A14153 AND REAR FUSELAGE ASSY P/N 3P5340A00133 FITTED ON AIRCRAFT WITHOUT REAR FITTING REINFORCEMENT RETRO-MOD P/N 3G5306P38811 (SB 1390418). REFER TO SB STATUS.
SERVICE BULLETIN AIRFRAME						
Standard SBs	SB 139-710, NEW ISSUE	ATA 23 - SATCOM FLIGHTCELL IMPROVEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0149 DATED 15 JULY 2022 NOT APPLICABLE TO THIS AIRCRAFT DUE TO AFFECTED ITEM NOT FITTED TO AIRCRAFT.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	6
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-515 REV B	ATA 46 - "PRIMUS EPIC®" FLIGHT SOFTWARE RELEASE 7.12.2 & 7.14.2 UPGRADE	-	-	-/NOT APPLICABLE	TIC-AW139-21-0353 DATED 06 OCTOBER 2021. PART I: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED. PART II: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED. PART III: NOT APPLICABLE DUE TO COMPONENT PRIMUS EPIC FLIGHT SOFTWARE RELEASE NOT AFFECTED. PART IV: NOT APPLICABLE DUE TO COMPONENT PRIMUS EPIC FLIGHT SOFTWARE RELEASE NOT AFFECTED. PART V: NOT APPLICABLE DUE TO COMPONENT PRIMUS EPIC FLIGHT SOFTWARE RELEASE NOT AFFECTED. PART VI: NOT APPLICABLE DUE TO COMPONENT PRIMUS EPIC FLIGHT SOFTWARE RELEASE NOT AFFECTED. COMPLIANCE IS AT CUSTOMER'S OPTION.
Standard SBs	SB NO. 139-647,NEW ISSUE	INTERSEAT CONSOLE CONNECTORS REPOSITIONING	-	-	-/NOT APPLICABLE	TIC-AW139-22-0118 DATED 11 MAY 2022 NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-669, NEW ISSUE	SATCOM FLIGHTCELL DZMX ELECTRICAL VARIANT INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-22-0129 DATED 01 JUNE 2022 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED
Standard SBs	SB NO. 139-035 REV D	ATA 25 - AUTOMATICALLY DEPLOYABLE ELT INSTALLATION.	-	-	-/OPEN	TIC-AW139-22-0028 DATED 21 MARCH 2022
Standard SBs	SB NO. 139-681, NEW ISSUE	ATA 33 - HELICOPTER EMERGENCY EXIT LIGHTS SYSTEM INSTALLATION.	-	-	-/NOT APPLICABLE	TIC-AW139-22-0029 DATED 21 MARCH 2022
Standard SBs	SB NO. 139-398 REV A	ATA 52 INSTALLATION OF FOOTSTEP FAST REMOVAL KIT.	-	-	-/OPEN	TIC-AW139-22-0052 DATED 24 MARCH 2022
Standard SBs	SB NO. 139-651, NEW ISSUE	ATA 34 - ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS) COMPUTER CONVERSION TO P/N 965-1595-034.	-	-	-/OPEN	TIC-AW139-22-0114 DATED 09 MAY 2022
Standard SBs	SB NO. 139-600, NEW ISSUE	ATA 46 - "PRIMUS EPIC®" FLIGHT SOFTWARE RELEASE 8 UPGRADE.	-	-	-/OPEN	TIC-AW139-22-0113 DATED 09 MAY 2022
Standard SBs	SB NO. 139-715, NEW ISSUE	ATA 62 - MAIN ROTOR BLADE S/N MARKING	-	-	-/OPEN	REFER TIC-AW139-22-0122 DATED 17 MAY 2022

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	7
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-360 REV B PART III	ATA 24 - KIT BATTERY START IN PARALLEL 44 Ah AND 27 Ah	-	-	-/NOT APPLICABLE	TIC-AW139-22-0126 PART III: NOT APPLICABLE TO THIS AIRCRAFT DUE TO SERIAL NUMBER NOT AFFECTED OPTIONAL SB
Standard SBs	SB139-539 PART II (3M BEFORE COMPLIANCE PART III) (MMIR	ATA 53 - TRDL BEARING SUPPORT PANEL REINFORCEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0007 DATED 27 JANUARY 2022 NOT APPLICABLE DUE TO AFFECTED TAIL BOOM ASSY NOT FITTED ON AIRCRAFT.
Standard SBs	SB139-539 PART III (1500H//2Y)	ATA 53 - TRDL BEARING SUPPORT PANEL REINFORCEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0007 DATED 27 JANUARY 2022 NOT APPLICABLE DUE TO AFFECTED TAIL BOOM ASSY NOT FITTED ON AIRCRAFT.
Standard SBs	SB139-539 PART III (1500H//2Y)	ATA 53 - TRDL BEARING SUPPORT PANEL REINFORCEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0007 DATED 27 JANUARY 2022 NOT APPLICABLE DUE TO AFFECTED TAIL BOOM ASSY NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-483	ATA 23- MR6000R RADIO SYSTEM INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0402 DATED 18 NOVEMBER 2021 APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED. COMPLIANCE AT CUSTOMER'S OPTION.
Standard SBs	SB NO. 139-636 ,NEW ISSUE	ATA 78 - REAR FIREWALL MODULE ASSY RETROMOD INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0232 DATED 12 MAY 2021 APPLICABLE TO THIS AIRCRAFT WITH THIS SERIAL NUMBER. AIRCRAFT IS FITTED WITH PART NUMBER 3G7810A02033, PART NUMBER 3G7810A02034 AND PART NUMBER 3G7810A02035.
Standard SBs	SB NO. 139-660	ATA 46 - "PRIMUS EPIC" FLIGHT SOFTWARE RELEASE UPGRADE FROM PHASE 7.12 & 7.14 TO PHASE 7.12.2 & 7.14.2	-	-	-/OPTIONAL	TIC-AW139-21-0348 DATED 28 SEPTEMBER 2021 APPLICABLE DUE TO COMPONENT PRIMUS EPIC FLIGHT SOFTWARE RELEASE AFFECTED. COMPLIANCE AT CUSTOMER'S OPTION.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	8
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-664	ATA 25 - D-LOCK HOOK BREEZE HOIST INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0379 DATED 29 OCTOBER 2021 NOT APPLICABLE DUE TO COMPONENT BREEZE EASTERN 90M RESCUE HOIST KIT PART NUMBER 3G2591F00113 NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-684	ATA 93 - TURRET FLIR UNIT REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0394 DATED 11 NOVEMBER 2021 NOT APPLICABLE TO THIS AIRCRAFT SERIAL NUMBER.
Standard SBs	SB NO. 139-576	ATA 21-VENTILATION AND WATER DRAIN LINES VARIANT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0401 DATED 18 NOVEMBER 2021 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-496	ATA 06 - AVIONIC VARIANT INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0400 DATED 18 NOVEMBER 2021 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-502 REV./	ATA 95 - COCKPIT AND CABIN PASSENGER FLOOR BALLISTIC PROTECTIONS INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0397 DATED 18 NOVEMBER 2021 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-503 REV. /	ATA 00 INTERIOR RECONFIGURATION FROM UTILITY TO VIP	-	-	-/NOT APPLICABLE	TIC-AW139-21-0398 DATED 18 NOVEMBER 2021 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-615 NEW ISSUE	ATA 00 INSTALLATION OF SPECIFIC VARIANTS FOR OFFSHORE CONFIGURATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0406 DATED 02 DECEMBER 2021 NOT APPLICABLE DUE TO AICRAFT SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB 139-601 REV A PART II	ATA 33 - INSPECTION AND REINFORCEMENT OF SEARCHLIGHT SUPPORT	-	-	-/OPTIONAL	REFER TIC-AW139-22-0119 DATED 12 MAY 2022. APPLICABLE. ORDINE DI LAVORO MARK: OD434609. REFER PHYSICAL CHECK IN 9M-PMA-9369 ON 31.12.2021 AT 1247:25 FH.
Standard SBs	SB 139-601 REV A PART I	ATA 33 - INSPECTION AND REINFORCEMENT OF SEARCHLIGHT SUPPORT	06/01/2022	-	-/COMPLIED WITH	TIC-AW139-22-0119 DATED 12 MAY 2022. CARRIED OUT IN 9M-PMA-9431 @ 1254:20 FH ON 06/01/2022 (AJL 05520).

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	9
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB 139-601 REV A PART I	ATA 33 - INSPECTION AND REINFORCEMENT OF SEARCHLIGHT SUPPORT	1254.33	-	-/COMPLIED WITH	TIC-AW139-22-0119 DATED 12 MAY 2022. CARRIED OUT IN 9M-PMA-9431 @ 1254:20 FH ON 06/01/2022 (AJL 05520).
Standard SBs	ASB NO. 139-686, NEW ISSUE PART I (EASA AD 2021-0259)	ATA 53 - TAIL GEAR BOX FITTING INSPECTION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0392 APPLICABILITY: NOT APPLICABLE DUE TO COMPONENT TGB FITTING P/N 3G5351A01152 FITTED ON AIRCRAFT IS NOT MORE THAN 3000FH. REFER LOG CARD
Standard SBs	ASB NO. 139-686, NEW ISSUE PART II	ATA 53 - TAIL GEAR BOX FITTING INSPECTION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0392 APPLICABILITY: NOT APPLICABLE DUE TO COMPONENT TGB FITTING P/N 3G5351A01152 FITTED ON AIRCRAFT IS NOT MORE THAN 3000FH. REFER LOG CARD
Standard SBs	SB NO. 139-559, NEW ISSUE PART I	ATA 71 - FIREWALLS RETROMOD	-	-	-/OPTIONAL	TIC-AW139-21-0246 OPTIONAL SB - PART I: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-559, NEW ISSUE PART II	ATA 71 - FIREWALLS RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-21-0246 OPTIONAL SB: PART II: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-559, NEW ISSUE PART III	ATA 71 - FIREWALLS RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-21-0246 OPTIONAL SB - PART III: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-649, NEW ISSUE	ATA 67 TAIL ROTOR ACTUATOR UPGRADE	0.00	3579.00	-/TO BE COMPLIED	TIC-AW139-21-0393 APPLICABLE TO THIS AIRCRAFT DUE FITTED WITH PN 3G6730V00731 TO BE COMPLIED NEXT REPAIR/OVERHAUL
Standard SBs	SB NO. 139-671, NEW ISSUE (ERRATA CORRIGE)	ATA 26- FIRE EXTINGUISHER REPLACEMENT (ERRATA CORRIGE)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0373 NOT APPLICABLE DUE TO COMPONENT FIRE EXTINGUISHER P/N P3APP003010A NOT FITTED ON AIRCRAFT. (FITTED WITH PN A344)
Standard SBs	SB NO. 139-666, NEW ISSUE	ATA 23 - KIT SATCOM FLIGHTCELL DZMX (4G) INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0261 OPTIONAL SB - NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-271, REVISION A (PART I)	ATA 23 - INSTALLATION OF KIT RADIO V/UF FLEXCOMM II P/N 3G2310F00111	-	-	-/NOT APPLICABLE	TIC-AW139-21-0260 OPTIONAL SB - PART I: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	10
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-271, REVISION A (PART II)	ATA 23 - INSTALLATION OF KIT RADIO V/UF FLEXCOMM II P/N 3G2310F00111	-	-	-/OPTIONAL	TIC-AW139-21-0260 OPTIONAL SB - PART II: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-271, REVISION A (PART III)	ATA 23 - INSTALLATION OF KIT RADIO V/UF FLEXCOMM II P/N 3G2310F00111	-	-	-/OPTIONAL	TIC-AW139-21-0260 OPTIONAL SB - PART III: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-348, REV A PART I	ATA 34 - KIT TCAS II INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0259 OPTIONAL SB - PART I: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-348, REV A PART II	ATA 34 - KIT TCAS II INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0259 OPTIONAL SB - PART 2: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-348, REV A PART III	ATA 34 - KIT TCAS II INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0259 OPTIONAL SB - PART III: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-665 REV A	ATA 34 - EGPWS INSTALLATION, ATA 34 - ENHANCED GROUND PROXIMITY WARNING SYSTEM INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0258 OPTIONAL SB - APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-663, NEW ISSUE	ATA 30 - WIPER BLADESPRAY NOZZLE REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0257 NOT APPLICABLE DUE TO AIRCRAFT NOT FITTED WITH COMPONENT KIT WINDSHIELD WASHING P/N 4G3040F00116, WIPER BLADE SPRAY NOZZLE P/N 3G3040V01151 & WIPER BLADE ASSY P/N 3G3040A02931 OR P/N 3G3040A03031.
Standard SBs	SB NO. 139-518, NEW ISSUE	ATA 33 - HELICOPTER EMERGENCY EXIT LIGHTS SYSTEM INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0247 OPTIONAL SB - NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-625, NEW ISSUE	ATA 33 - UTILITY LIGHT IMPROVEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0243 NOT APPLICABLE DUE TO COMPONENT NVG UTILITY LIGHT P/N 3G3310A00231 OR LIGHT ASSY P/N 90-004-1 NOT EQUIPPED ON AIRCRAFT.
Standard SBs	SBEA NO. 139-679, NEW ISSUE	ATA 25 - HOIST RATED LOAD CHECK (BREEZE)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0267 NOT APPLICABLE DUE FITTED WITH GOODRICH HOIST (REFER LOG CARD/EQUIPMENT LIST)

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	11
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-455, PART I, REVISION A	ATA 53 - TRANSMISSION DECK AND MGB REINFORCEMENT FITTINGS REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0237 OPTIONAL SB - PART I: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED.
Standard SBs	SB NO. 139-455 PART II, REVISION A	ATA 53 - TRANSMISSION DECK AND MGB REINFORCEMENT FITTINGS REPLACEMENT	-	-	-/OPTIONAL	TIC-AW139-21-0237 OPTIONAL SB - PART II: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED.
Standard SBs	SB NO. 139-455 PART III, REVISION A	ATA 53 - TRANSMISSION DECK AND MGB REINFORCEMENT FITTINGS REPLACEMENT	-	-	-/OPTIONAL	TIC-AW139-21-0237 OPTIONAL SB - PART III: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED.
Standard SBs	SB NO. 139-455 PART IV, REVISION A	ATA 53 - TRANSMISSION DECK AND MGB REINFORCEMENT FITTINGS REPLACEMENT	-	-	-/OPTIONAL	TIC-AW139-21-0237 OPTIONAL SB - PART IV: APPLICABLE DUE TO AIRCRAFT S/N AFFECTED.
Standard SBs	SB NO. 139-674, NEW ISSUE	ATA 93 - AIRCRAFT SURVIVABILITY EQUIPMENT (ASE) RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-21-0245 NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-658, NEW ISSUE	ATA 23 - SATCOM FLIGHTCELL DZMX (4G) RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-21-0256 NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-629, REVISION A	ATA 95 FORWARD FLOATS COVERS UPGRADE	-	-	-/NOT APPLICABLE	TIC-AW139-21-0220 NOT APPLICABLE DUE TO COMPONENT LH FORWARD COVER ASSY P/N 3G9560V04131 & RH FORWARD COVER ASSY P/N 3G9560V04231 NOT FITTED ON AIRCRAFT.(APPLICABLE FLOAT DART SYSTEM)
Standard SBs	SB NO. 139-578, NEW ISSUE	ATA 23 KIT RADIO MOTOROLA XiR 8268 PROVISION INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0226 OPTIONAL SB - NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-575, NEW ISSUE	ATA 23 COMMUNICATION CUSTOMIZATION RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-21-0225 OPTIONAL SB - NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-553, REVISION A	ATA 23 - KIT RADIO MOTOROLA XiR INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0224 OPTIONAL SB - APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	ASB NO. 139-609, REVISION A (EASA AD 2020-0011R1)	ATA 63 - MGB BEARING LOCK-NUT REPLACEMENT	0.00	28000.00	-/TO BE COMPLIED	TIC-AW139-21-0218 APPLICABLE DUE TO AFFECTED MGB PN 3G6320A00134 FITTED ON AIRCRAFT.
Standard SBs	ASB NO. 139-609, REVISION A (EASA AD 2020-0011R1)	ATA 63 - MGB BEARING LOCK-NUT REPLACEMENT	0.00	6000.00	-/TO BE COMPLIED	TIC-AW139-21-0218 APPLICABLE DUE TO AFFECTED MGB PN 3G6320A00135 FITTED ON AIRCRAFT.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	12
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-646, NEW ISSUE	ATA 23 - RADIO HARRIS KIT INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0215 OPTIONAL SB - NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-240, REVISION D	ATA 67 - INSTALLATION OF PILOT/CO-PILOT COLLECTIVE GRIP P/N 3G6711V00951 AND P/N 3G6711V01051	-	-	-/OPTIONAL	TIC-AW139-21-0214 APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-587, NEW ISSUE	ATA 30 - WINDSHIELD WASHING SYSTEM INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0206 (WP# 9M-PMA-6528)
Standard SBs	SB NO. 139-613, NEW ISSUE	ATA 95 - IMPROVEMENT OF EMERGENCY FLOATS RIGID COVER	-	-	-/OPTIONAL	TIC-AW139-21-0216 COMPLIANCE: APPLICABLE BY PN AND SN AND COMPLIANCE AT CUSTOMER OPTION
Standard SBs	SB NO. 139-581, NEW ISSUE	ATA 21 - VENTILATION INSULATION IMPROVEMENT	-	-	-/NOT APPLICABLE	OPTIONAL SB - NOT APPLICABLE DUE TO A/C SERIAL NUMBER NOT AFFECTED
Standard SBs	SB NO. 139-588, NEW ISSUE	ATA 28 - AUXILIARY LONGITUDINAL FUEL TANK COMPLETION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0205 COMPLIANCE: OPTIONAL SB - NOT APPLICABLE DUE TO A/C SERIAL NUMBER NOT AFFECTED
Standard SBs	SB NO. 139-605, REVISION A	ATA 32 - ELECTRICAL WHEEL BRAKE CABLE ASSY REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0078 NOT APPLICABLE DUE COMPONENT KIT POWERED PARKING BRAKE MODULE P/N 3G3240F00111 NOT FITTED ON AIRCRAFT AND NOT COMPLY WITH SB 139-137 BEFORE ITS REVISION C
Standard SBs	SB NO. 139-617, NEW ISSUE	ATA 62 - MAIN ROTOR BLADE LIGHTNING STRIP CORROSION PROTECTION IMPROVEMENT	25/03/2022	-	-/COMPLIED WITH	TIC-AW139-21-0208 CARRIED OUT IN 9M-PMA-8543 @ 1347:55 FH ON 25/03/2022 (AJL 00021)
Standard SBs	SB NO. 139-574, NEW ISSUE	ATA 24 LH UTILITY CB PANEL RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-21-0079 COMPLIANCE: OPTIONAL SB AND NOT APPLICABLE DUE TO AIRCRAFT SN NOT AFFECTED TO ALL AW139 UNDER CAMO
Standard SBs	SB NO. 139-543, NEW ISSUE	ATA 71 - TUNNEL ASSY AND FIREWALLS RETROMOD	-	-	-/OPTIONAL	TIC-AW139-21-0018 OPTIONAL SB TO PERFORM PHYSICAL CHECK ON AIRCRAFT
Standard SBs	SB NO. 139-463, NEW ISSUE	ATA 46 - INSTALLATION OF KIT CENTRAL DISPLAY	-	-	-/OPTIONAL	TIC-AW139-21-0035 APPLICABLE DUE TO AIRCRAFT S/N AFFECTED - COMPONENT KIT CENTRAL DISPLAT SIRIO PANEL P/N 4G630F00312 ALREADY FITTED TO AIRCRAFT

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	13
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-548, REVISION A PART III	ATA 30 - LH VERNIER ICE DETECTOR WITH LIGHT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0033 PART III: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-548, REVISION A PART II	ATA 30 - LH VERNIER ICE DETECTOR WITH LIGHT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0033 PART II: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-464, NEW ISSUE	ATA 93 - INSTALLATION OF KIT SKYFORCE DIGITAL MAP	-	-	-/OPTIONAL	TIC-AW139-21-0037 OPTIONAL SB - APPLICABLE DUE TO AIRCRAFT S/N AFFECTED
Standard SBs	SB NO. 139-462, NEW ISSUE	ATA 25 - INSTALLATION OF ACTIVE NOISE REDUCTION HEADSET	-	-	-/OPTIONAL	TIC-AW139-21-0034 APPLICABLE BY AIRCRAFT SN
Standard SBs	SB NO. 139-643, NEW ISSUE	ATA 25 - SINGLE TO DOUBLE HOIST CONVERSION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0030 NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB 139-593 REV. A	ATA 71 - ENGINE MOUNTING RODS REPLACEMENT	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO COMPONENT SERIAL NUMBER NOT AFFECTED
Standard SBs	SB NO 28312 (ENG NO 2)	TURBOSHAFT ENGINE IGNITION EXCITER - REPLACEMENT OF	-	-	-/Category 7	TIC-AW139-21-0025 APPLICABLE DUE TO ENGINE S/N (PCE-KB2067)
Standard SBs	SB139-557 REV. A	ATA 25 HOIST CABLE CUTTER FRAME INSTALLATION	-	-	-/CANCELLED	TIC-AW139-21-0016 SB139-557 REV. A IS TO CANCELLED SB139-557 REV./
Standard SBs	SB NO 139-439, REVISION A PART I	ATA 22 - INSTALLATION OF KIT FOUR AXIS ENHANCED FLIGHT	-	-	-/NOT APPLICABLE	PART I: NOT APPLICABLE BY AIRCRAFT SERIAL NUMBER
Standard SBs	SB NO. 139-630, NEW ISSUE	ATA 46 COMPLETION OF KIT PRIMUS EPIC PHASE 8 SOFTWARE RELEASE INSTALLATION	-	-	-/NOT APPLICABLE	SB NO. 139-630, OPTIONAL SB NOT APPLICABLE DUE ONLY APPLICABLE TO AIRCRAFT SN 31869.
Standard SBs	SB NO. 139-622, NEW ISSUE	ATA 28 - KIT CLOSED CIRCUIT REFUELLING RECEIVER (CCRR)	-	-	-/OPTIONAL	TIC-AW139-20-211 OPTIONAL SB APPLICABLE DUE AIRCRAFT SN AFFECTED.
Standard SBs	SB NO 139-554, REVISION B	ATA 28 FEEDING LINE FUEL DRAIN INSTALLATION.	-	-	-/NOT APPLICABLE	TIC-AW139-20-214 NOT APPLICABLE DUE AIRCRAFT NOT OPERATED UNDER ANAC ADMINISTRATION
Standard SBs	SB NO. 139-639, NEW ISSUE	ATA 53 UPPER DECK PANEL REINFORCEMENT	-	-	-/OPTIONAL	TIC-AW139-20-215 APPLICABLE TO 9M-PMA (31807), DUE TO AIRCRAFT S/N AND COMPONENT KIT AIR CONDITIONING P/N 3G2150F00512 FITTED ON AIRCRAFT. OPTIONAL SB

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	14
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	MSB NO. 139-325, REVISION A	MAIN ROTOR SERVOACTUATOR INSPECTION AND REPAIR	-	-	-/NOT APPLICABLE	TIC-AW139-20-128 NOT APPLICABLE TO 9M-PMA (31807) DUE TO COMPONENT P/N 3G6730V00532 FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-584, NEW ISSUE	ATA 25 - KIT PILOT/COPILOT GENERAL HOLDERS	-	-	-/OPTIONAL	REFER TO TIC-AW139-20-191 APPLICABLE TO DUE TO COMPONENTS CHART HOLDER P/N 4G2510F00112.
Standard SBs	SB NO. 139-157, REV C	ATA 46 - "PRIMUS EPIC®" FLIGHT SOFTWARE RELEASE 5.6.0	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-196 NOT APPLICABLE DUE TO AIRCRAFT S/N
Standard SBs	SB NO. 139-284, REVISION F PART II	ATA 31 - INSTALLATIONS OF FDR AND RIPS VARIANTS P/N 3G3106P01311 AND P/N 3G3106P01312	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-197 PART II: NOT APPLICABLE DUE TO AIRCRAFT S/N
Standard SBs	SB NO. 139-284, REVISION F PART I	ATA 31 - INSTALLATIONS OF FDR AND RIPS VARIANTS P/N 3G3106P01311 AND P/N 3G3106P01312	-	-	-/NOT APPLICABLE	TIC-AW139-20-197 PART I: NOT APPLICABLE TO DUE TO AIRCRAFT S/N
Standard SBs	SB NO. 139-620, REVISION B PART II	ATA 31 - INSTALLATION OF MPFR P/N D51615-142-090	-	-	-/NOT APPLICABLE	TIC-AW139-20-198 PART I: NOT APPLICABLE TO DUE TO COMPONENT MPFR P/N D51615-1142 FITTED ON AIRCRAFT PART II: APPLICABLE IF COMPLIANCE TO PART I OF THIS SERVICE BULLETIN
Standard SBs	SB NO. 139-620, REVISION B PART I	ATA 31 - INSTALLATION OF MPFR P/N D51615-142-090	-	-	-/NOT APPLICABLE	TIC-AW139-20-198 PART I: NOT APPLICABLE TO DUE TO COMPONENT MPFR P/N D51615-1142 FITTED ON AIRCRAFT PART II: APPLICABLE IF COMPLIANCE TO PART I OF THIS SERVICE BULLETIN
Standard SBs	SB NO. 139-655, NEW ISSUE	ATA 63 - MGB INPUT MODULES MARKING	-	-	-/NOT APPLICABLE	TIC-AW139-20-190 NOT APPLICABLE DUE TO COMPONENT INPUT MODULE ASSY S/N LISTED IN TABLE 1 ARE NOT FITTED ON AIRCRAFT REASON: THIS SERVICE BULLETIN IS ISSUED IN ORDER TO PRESCRIBE THE REMARK OF THE MGB INPUT MODULES.
Standard SBs	SB NO. 139-512, NEW ISSUE	ATA 53 TAIL PLANE FITTING BUSHINGS INSPECTION	-	-	-/NOT APPLICABLE	TIC-AW139-20-185 NOT APPLICABLE TO 9M-PMA (31807) DUE TO FITTING ASSEMBLIES HAVE NEVER BEEN REPLACED IN SERVICE.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	15
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-634, NEW ISSUE	ATA 34 - ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS)	-	-	-/OPTIONAL	TIC-AW139-20-186 - OPTIONAL SB APPLICABLE TO 9M-PMA (31807), DUE TO COMPONENT EGPWS P/N 965-1595-030 FITTED ON AIRCRAFT.
Standard SBs	SB NO.139-599 PART II	ATA 18 - ACTIVE VIBRATION CONTROL SYSTEMS (AVCS) OMNI CONTROL PANEL & SOFTWARE UPGRADE	-	-	-/OPTIONAL	TIC-AW139-20-181 - OPTIONAL SB APPLICABLE TO 9M-PMA (31807) DUE TO AIRCRAFT S/N AND COMPONENT AVCS CC APPLICATION SOFTWARE P/N 3G1830VA0100 AND COMPONENT CGF COMMAND LANE SOFTWARE P/N 3G1830VS0100 FITTED ON AIRCRAFT.
Standard SBs	SB NO.139-599 PART I	ATA 18 - ACTIVE VIBRATION CONTROL SYSTEMS (AVCS) OMNI CONTROL PANEL & SOFTWARE UPGRADE	-	-	-/NOT APPLICABLE	TIC-AW139-20-181 - OPTIONAL SB NOT APPLICABLE TO 9M-PMA (31807)DUE TO COMPONENT P/N 3G1830V00251 NOT FITTED ON AIRCRAFT.
Standard SBs	SBA 139-637 REV. A (EASA AD 2020-0131)	ATA 25 HOIST CABLE CUTTER FRAME INSTALLATION	-	-	-/COMPLIED WITH	ALREADY COMPLIED WITH SBA 139-637 REV./ REFER TO WP# WP-PMA-20-1112
Standard SBs	SB 139-635 REV./	ATA 29 TORQUE CHECK OF THE POWER CONTROL MODULE BOLTS	672.08	-	-/COMPLIED WITH	WP-PMA-20-1898 @ 672:05 FH ON 06/11/2020 (AJL 03146)
Standard SBs	SB 139-635 REV./	ATA 29 TORQUE CHECK OF THE POWER CONTROL MODULE BOLTS	06/11/2020	-	-/COMPLIED WITH	AS PER BIWEEKLY MEETING PGU 23/09/2020 REFER MINUTE MEETING - TO COMPLY WITH WP-PMA-20-1898 @ 672:05 FH ON 06/11/2020 (AJL 03146)
Standard SBs	SB NO. 139-583 (PART II)	ATA 62 - ROTATING SWASHPLATE ASSY P/N 3G6230A00333	-	-	-/NOT APPLICABLE	TIC-AW139-20-125 NOT APPLICABLE DUE TO COMPONENT P/N 3G6230A00333 ALREADY FITTED ON AIRCRAFT
Standard SBs	SB NO. 139-545 REVISION A	ATA 78 - EXHAUST RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-20-098 - NOT APPLICABLE DUE TO PN 3G7810A02132 AND PN 3G7810A02232 NOT FITTED
Standard SBs	ASB 139-648, NEW ISSUE	ATA 25 - LIFERAFT RESERVOIR INSPECTION AND REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY SB 139-648 REVISION A DATED 15-FEB-2021
Standard SBs	ASB NO. 139-633, REV A	ATA 25 - RESTRICTION IN FORWARD FACING PASSENGER SEATS INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-20-131 DATED 03 SEPTEMBER 2020. NOT APPLICABLE DUE TO AIRCRAFT SEAT CONFIGURATION NOT INSTALLED FACING FORWARD.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	16
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-631, NEW ISSUE	ATA 33 - HELICOPTER EMERGENCY EXIT LIGHT SYSTEM (HEELS) INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-20-129 DATED 01 SEPTEMBER 2020. NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER.
Standard SBs	SB139-038 REV G PART IV	HUMS CAMERA TRACKER INSTALLATION	-	-	-/COMPLIED WITH	WP-PMA-20-1723
Standard SBs	SB NO. 139-642, REV A PART I	ATA 64 - TAIL ROTOR HEAD INSPECTION AND MODIFICATION	16/07/2020	-	-/COMPLIED WITH	TIC-AW139-21-0349 DATED 28 SEPTEMBER 2021 PART I: APPLICABLE DUE TO AIRCRAFT TYPE CARRIED OUT WP-PMA-20-1395 PART 1 INITIAL
Standard SBs	SB NO. 139-642, REV A PART I	ATA 64 - TAIL ROTOR HEAD INSPECTION AND MODIFICATION	547.00	-	-/COMPLIED WITH	TIC-AW139-21-0349 DATED 28 SEPTEMBER 2021 PART I: APPLICABLE DUE TO AIRCRAFT TYPE CARRIED OUT WP-PMA-20-1395 PART 1 INITIAL
Standard SBs	SB NO 139-544, REV A	ATA 25 - INSTALLATION OF KIT LIFE RAFTS	-	-	-/OPTIONAL	TIC-AW139-20-105 APPLICABLE AT CUSTOMER'S OPTION
Standard SBs	SB139-628 REV./	ATA 23 PROVISION INSTALLATION FOR KIT HF ON REPLACEMENT TAIL ASSEMBLY	-	-	-/NOT APPLICABLE	TIC-AW13920-101 (OPTIONAL SB) NOT APPLICABLE TO PGU FLEET DUE TO KIT COMPLETE PROVISIONS PN 4G2310A01314 ALREADY FITTED ON AIRCRAFT
Standard SBs	SB139-626 REV./	ATA 23 PROVISION INSTALLATION FOR KIT SATCOM SKYCONNECT ON REPLACEMENT TAIL ASSEMBLY	-	-	-/NOT APPLICABLE	TIC-AW139-20-099 NOT APPLICABLE KIT SATCOM SKYCONNECT PN 4G2310F01115 NOT FITTED TO PGU, JBPM & YTLPG FLEET
Standard SBs	SB NO. 139-627, NEW ISSUE	ATA 93 PROVISION INSTALLATION FOR KIT FLIR SAFIRE 380 HD ON REPLACEMENT TAIL ASSEMBLY	-	-	-/NOT APPLICABLE	TIC-AW139-20-100 - NOT APPLICABLE DUE FLIR KIT PN 4G9350F0111 NOT FITTED
Standard SBs	SB139-540 REV./	ATA 25 - BREEZE HOIST CHANGE FROM 90M TO 75M	-	-	-/NOT APPLICABLE	TIC-AW139-20-076 - OPTIONAL SB AND NOT APPLICABLE DUE FITTED WITH GOODRICH HOIST
Standard SBs	SB NO. 139-563, NEW ISSUE	ATA 93 - AVIONIC VARIANT	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-061 DATED 31 MARCH 2020. NOT APPLICABLE TO AIRCRAFT S/N.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	17
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-595, NEW ISSUE	ATA 52 - COCKPIT DOOR EMERGENCY RELEASE MECHANISM CHECK	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-058 DATED 26 MARCH 2020. NOT APPLICABLE DUE TO COMPONENT P/N 4G9580F00412 NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-570, NEW ISSUE	ATA 95 EFS FLOAT ASSY INFLATION SYSTEM NEW THERMOMANOMETER	-	-	-/NOT APPLICABLE	TIC-AW139-20-069 NOT APPLICABLE DUE TO COMPONENT P/N 3G9560V01432 & 3G9560V01532
Standard SBs	SB NO. 139-061, REVISION B	KIT 2ND GPS P/N 4G3450F00611 OR KIT 2ND GPS SBAS P/N 4G3450F00613, INSTALLATION OF.	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-051 APPLICABLE ONLY TO 9M-BOC & 9M-BOD DUE TO AIRCRAFT SERIAL NUMBER. COMPLIANCE AT CUSTOMER'S OPTION
Standard SBs	SB NO. 139-130, REVISION A	ATA 34- KIT 2ND GPS P/N 4G3450F00611 OR KIT GPS SBAS P/N 4G3450F00613	-	-	-/NOT APPLICABLE	TIC-AW139-20-053 APPLICABLE ONLY TO 9M-YTL & 9M -YPG DUE TO AIRCRAFT SERIAL NUMBER.
Standard SBs	SB NO. 139-550, NEW ISSUE	ATA 93 - INSTALLATION OF KIT FLIR WESCAM MX-10	-	-	-/NOT APPLICABLE	TIC-AW139-20-062 NOT APPLICABLE TO AIRCRAFT SERIAL NUMBER. COMPLIANCE AT CUSTOMER'S OPTION
Standard SBs	SB NO. 139-597 NEW ISSUE	ATA 31 - KIT FAMILY HUMS RETROMOD	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-036 DATE ISSUE 09 MARCH 2020. NOT APPLICABLE TO AIRCRAFT S/N.
Standard SBs	SB NO. 139-037 NEW ISSUE	ATA 53 - NLG ACTUATOR FITTING RETRO MODIFICATION	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-038 DATE ISSUE 09 MARCH 2020. NOT APPLICABLE TO AIRCRAFT S/N.
Standard SBs	SB NO. 139-621, NEW ISSUE	ATA 71- INSTALLATION OF EAPS REMOVABLE PARTS	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT SERIAL NUMBER. COMPLIANCE: AT CUSTOMER'S OPTION. REFER TO TIC-AW139-20-021
Standard SBs	SB NO. 139-524 REV A	ATA 25 - LIFERAFT RESERVOIR ASSEMBLY ALIGNMENT LABEL POSITIONING	-	-	-/NOT APPLICABLE	TIC-AW139-20-022 DATE ISSUE 25 FEBRUARY 2020. NOT APPLICABLE DUE TO COMPONENT P/N NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-334 REV B	ATA 23 - VHF/FM NAT NPX138 KIT P/N 4G2310F02411	-	-	-/OPTIONAL	REFER TIC-AW139-20-020 DATE ISSUE 25 FEBRUARY 2020. APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER.
Standard SBs	SB NO. 139-612	ATA 11 - FAST ROPING DECAL REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-20-024 NOT APPLICABLE DUE TO COMPONENT PN 4G2590F00211 NOT FITTED ON AIRCRAFT

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	18
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO 139-153, REVISION A	ATA 28, INSTALLATION OF LONGITUDINAL AUXILIARY FUEL TANK	-	-	-/OPTIONAL	APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TO TIC-AW139-19-113.
Standard SBs	SB NO 139-527, NEW ISSUE	ATA 95- INSTALLATION OF COCKPIT AND CABIN PASSENGER FLOOR BALLISTIC PROTECTION	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TO TIC-AW139-19-114
Standard SBs	SB NO 139-475, NEW ISSUE PART II	ATA 23- INSTALLATION OF KIT ICS 9000 CABIN STATION 4	-	-	-/OPTIONAL	PART II: APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TO TIC-AW139-19-111
Standard SBs	SB NO 139-475, NEW ISSUE PART I	ATA 23- INSTALLATION OF KIT ICS 9000 CABIN STATION 4	-	-	-/NOT APPLICABLE	PART I: NOT APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TO TIC-AW139-19-111
Standard SBs	SB NO 139-607, NEW ISSUE	ATA 21- INSTALLATION OF DUAL ZONE HEATING CABIN DUCT VARIANT	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TIC-AW139-19-130.
Standard SBs	SBA 139-614, NEW ISSUE	ATA 26 FIRE EXTINGUISHER INSPECTION AND REPLACEMENT	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO AIRCRAFTS NOT FITTED WITH FIRE EXTINGUISHER P/N P3APP003010A. REFER TO TIC-AW139-19-128

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	19
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SBA NO. 139-610, NEW ISSUE	ATA 95 - EMERGENCY FLOATATION SYSTEM, FLOAT SUPPLY HOSE INSPECTION OF.	247.83	-	-/COMPLIED WITH	<p>REFER TO TIC-AW139-19-120 DATED 17 DECEMBER 2019. APPLICABLE TO COMPONENT P/N AND S/N, REQUEST PHYSICAL INSPECTION FOR MARKED ON THE EXTERNAL IDENTIFICATION LABEL.</p> <p>CARRIED OUT AS PER WP-PME-20-1526 @ 247:50 FH ON 27/08/2020 (AJL 03207)</p> <p>A. 3G9560V02131 L/H FWD FLOAT ASSEMBLY SN: 195 B. 3G9560V02231 R/H FWD FLOAT ASSEMBLY SN: 189 C. 3G9560V02331 L/H AFT FLOAT ASSEMBLY SN: 183 D. 3G9560V02431 R/H AFT FLOAT ASSEMBLY SN: 186</p> <p>CARRIED OUT AS PER WP-PMD-20-2200 @ 419:55 FH ON 03/12/2020 (AJL 03196)</p> <p>A. 3G9560V02131 L/H FWD FLOAT ASSEMBLY SN: 174 B. 3G9560V02231 R/H FWD FLOAT ASSEMBLY SN: 165 C. 3G9560V02331 L/H AFT FLOAT ASSEMBLY SN: 163 D. 3G9560V02431 R/H AFT FLOAT ASSEMBLY SN: 140</p> <p>CARRIED OUT AS PER WP-PMB-20-1287 @ 1315:30FH ON 12/07/2020 (AJL 02599)</p> <p>ORIGINAL FLOAT SET 9M-PMA A. 3G9560V02131 L/H FWD FLOAT ASSEMBLY SN: 173 B. 3G9560V02231 R/H FWD FLOAT ASSEMBLY SN: 169 C. 3G9560V02331 L/H AFT FLOAT ASSEMBLY SN: 168</p>

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	20
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
						D. 3G9560V02431 R/H AFT FLOAT ASSEMBLY SN: 164

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	21
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SBA NO. 139-610, NEW ISSUE	ATA 95 - EMERGENCY FLOATATION SYSTEM, FLOAT SUPPLY HOSE INSPECTION OF.	27/08/2020	-	-/COMPLIED WITH	<p>REFER TO TIC-AW139-19-120 DATED 17 DECEMBER 2019. APPLICABLE TO COMPONENT P/N AND S/N, REQUEST PHYSICAL INSPECTION FOR MARKED ON THE EXTERNAL IDENTIFICATION LABEL.</p> <p>CARRIED OUT AS PER WP-PME-20-1526 @ 247:50 FH ON 27/08/2020 (AJL 03207)</p> <p>A. 3G9560V02131 L/H FWD FLOAT ASSEMBLY SN: 195 B. 3G9560V02231 R/H FWD FLOAT ASSEMBLY SN: 189 C. 3G9560V02331 L/H AFT FLOAT ASSEMBLY SN: 183 D. 3G9560V02431 R/H AFT FLOAT ASSEMBLY SN: 186</p> <p>CARRIED OUT AS PER WP-PMD-20-2200 @ 419:55 FH ON 03/12/2020 (AJL 03196)</p> <p>A. 3G9560V02131 L/H FWD FLOAT ASSEMBLY SN: 174 B. 3G9560V02231 R/H FWD FLOAT ASSEMBLY SN: 165 C. 3G9560V02331 L/H AFT FLOAT ASSEMBLY SN: 163 D. 3G9560V02431 R/H AFT FLOAT ASSEMBLY SN: 140</p> <p>CARRIED OUT AS PER WP-PMB-20-1287 @ 1315:30FH ON 12/07/2020 (AJL 02599)</p> <p>ORIGINAL FLOAT SET 9M-PMA A. 3G9560V02131 L/H FWD FLOAT ASSEMBLY SN: 173 B. 3G9560V02231 R/H FWD FLOAT ASSEMBLY SN: 169 C. 3G9560V02331 L/H AFT FLOAT ASSEMBLY SN: 168</p>

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	22
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
						D. 3G9560V02431 R/H AFT FLOAT ASSEMBLY SN: 164
Standard SBs	SB NO 139-579	ATA 99 INSTALLATION OF KIT SIAP AND RWR AND LWR	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT S/N REFER TO TIC-AW139-19-108 DATE ISSUED 29 NOVEMBER 2019
Standard SBs	SB NO. 139-491, NEW ISSUE	ATA 63 - AGB INPUT MODULE ASSY VARIANT	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO COMPONENT P/N. REFER TO TIC-AW139-19-107 DATE ISSUE 29 NOVEMBER 019
Standard SBs	SB NO 139-510, NEW ISSUE	ATA 34 - WEATHER RADAR (1500B+) 2ND CONTROL PANEL INSTALLATION	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TO TIC-AW139-19-101 DATED 15 NOVEMBER 2019.
Standard SBs	SB 139-558, NEW ISSUE	ATA 24 - UTILITY CB PANEL LH RETROMOD	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT S/N. COMPLIANCE: AT CUSTOMER OPTIONS. REFER TO TIC-AW139-19-103 DATED ISSUE: 19 NOVEMBER 2019
Standard SBs	BT 139-364 REV. /	TRAKKA SEARCHLIGHT ASSEMBLY	-	-	-/OPTIONAL	
Standard SBs	TOOL SB NO PT-962, REVISION A	TOOL MODIFICATION	-	-	-/COMPLIED WITH	APPLICABLE TO DUE TO ENGINE TYPE. REFER TO TIC-AW139-19-091
Standard SBs	SB NO 139-542, NEW ISSUE	ATA 25 - INSTALLATION OF KIT BAGGAGE BOX	-	-	-/OPTIONAL	TIC-AW139-19-080 - APPLICABLE TO AIRCRAFT S/N, COMPLIANCE AT CUSTOMER'S OPTION
Standard SBs	SB NO 139-590, NEW ISSUE	ATA 34 - INSTALLATION OF KIT DF	-	-	-/OPTIONAL	TIC-AW139-19-081 - APPLICABLE TO AIRCRAFT S/N, COMPLIANCE AT CUSTOMER'S OPTION
Standard SBs	SB NO 139-556, NEW ISSUE	ATA 64 - TAIL ROTOR BLADE LIGHTNING STRIPS P/N 3G6410A03053	-	-	-/OPTIONAL	TIC-AW139-19-060 - APPLICABLE TO AIRCRAFT TYPE, COMPLIANCE IS AT CUSTOMERS'S OPTION
Standard SBs	SB NO 139-439, REVISION A	ATA 22 - INSTALLATION OF KIT FOUR AXIS ENHANCED FLIGHT DIRECTOR	-	-	-/OPTIONAL	TIC-AW139-19-075 - APPLICABLE TO AIRCRAFT S/N (PART II)
Standard SBs	SB NO 139-316, NEW ISSUE	ATA 53 - ANCHOR NUTS IN FUEL TANK AREA	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-19-077 - NOT APPLICABLE TO AIRCRAFT SERIAL NUMBER
Standard SBs	SB NO 139-569, REVISION B PART II	ATA 64 - TAIL ROTOR SLIDER ASSY DETAILED INSPECTION	-	-	-/ON CONDITION	TIC-AW139-22-0155 DATED 26 JULY 2022 APPLICABLE DUE TO AIRCRAFT TYPE
Standard SBs	SB NO 139-487 PART II, NEW ISSUE	ATA 53 - BL 0.0 NOSE REINFORCEMENT RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-19-068 - PART II OF THIS SB NOT APPLICABLE TO ALL
Standard SBs	SB NO 139-541 PART I & II, NEW ISSUE	ATA 23 - KIT EXTERNAL LOUDSPEAKERS 900W	-	-	-/OPTIONAL	TIC-AW139-19-072 - APPLICABLE TO AIRCRAFT SERIAL NUMBER

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	23
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO 139-546, NEW ISSUE	ATA 24 - AUXILIARY OVER HEAD PANEL RETRO MODIFICATION	-	-	-/NOT APPLICABLE	TIC-AW139-19-066 - NOT APPLICABLE TO ALL AIRCRAFT SERIAL NUMBER
Standard SBs	SB NO 139-457 PART II, III, IV, VI, VII, VIII, REVISION	ATA 25 - INSTALLATION OF BREEZE-EASTERN EXTERNAL HOIST	-	-	-/NOT APPLICABLE	TIC-AW139-19-064 - APPLICABLE TO AIRCRAFT S/N (9M-YPG) 41356 AND S/N (9M-YTL) 41358
Standard SBs	SB NO 139-038 PART II, REVISION G	ATA 31- INSTALLATION OF KIT HEALTH AND USAGE MONITORING SYSTEM	-	-	-/OPTIONAL	TIC-AW139-19-063 - APPLICABLE TO ALL AIRCRAFT SERIAL NUMBER. COMPLIANCE AT CUSTOMER OPTION.
Standard SBs	SB NO 139-038 PART I, III & IV, REVISION G	ATA 31 - INSTALLATION OF KIT HEALTH AND USAGE MONITORING SYSTEM	-	-	-/NOT APPLICABLE	TIC-AW139-19-063 - PART I, III AND IV: NOT APPLICABLE TO ALL AIRCRAFT SERIAL NUMBER
Standard SBs	SB NO 139-487 PART I, NEW ISSUE	ATA 53 - BL 0.0 NOSE REINFORCEMENT RETRO MOD	-	-	-/NOT APPLICABLE	TIC-AW139-19-068 - NOT APPLICABLE TO 9M-PMA (31807) BY SERIAL NUMBER
Standard SBs	SB NO 139-603, NEW ISSUE	ATA 93 - FLIR SS380HDC TFU VARIANT	-	-	-/NOT APPLICABLE	TIC-AW139-19-071 - NOT APPLICABLE TO AIRCRAFT S/N
Standard SBs	SB NO 139-318 PART III, NEW ISSUE	ATA 33 - INSTALLATION OF STROBE LIGHTS KIT P/N 4G3340F00412	-	-	-/OPTIONAL	TIC-AW139-19-069 - APPLICABLE TO PART III OF THIS SB, AIRCRAFT EQUIPPED WITH TAIL PLANE ASY P/N 3G5510A05432
Standard SBs	SB NO 139-555, NEW ISSUE	ATA 00- INTERIORS RECONFIGURATION FROM VIP TO OFFSHORE	-	-	-/NOT APPLICABLE	TIC-AW139-19-067 - NOT APPLICABLE TO AIRCRAFT S/N
Standard SBs	SB139-591, NEW ISSUE	ATA 24 - CB PANEL VARIANT	-	-	-/NOT APPLICABLE	TIC-AW139-19-079 - REISSUED BY LEONARDO HELICOPTER TO CORRECT TYPO ERROR, NOT APPLICABLE TO AIRCRAFT S/N
Standard SBs	SB139-556 REV./	ATA 64 - TAIL ROTOR BLADE LIGHTNING STRIPS PN 3G6410A03053	-	-	-/OPTIONAL	TIC-AW139-19-060 - APPLICABLE AND COMPLIANCE AT CUSTOMER OPTION
Standard SBs	SB NO 139-495 REV.A	ATA 31 - FDR AND RIPS VARIANT ULB REPLACEMENT	-	-	-/OPTIONAL	TIC-AW139-19-053 APPLICABLE BUT COMPLIANCE AT CUSTOMER OPTION
Standard SBs	SB139-549	ATA 97- INSTALLATION OF KIT AVALEX DIGITAL VIDEO RECORDER	-	-	-/OPTIONAL	TIC-AW139-19-039 APPLICABLE AND COMPLIANCE AT CUSTOMER OPTION
Standard SBs	SB139-552 REV./	ATA 93 - AVIONIC VARIANT	-	-	-/OPTIONAL	TIC-AW139-19-037 APPLICABLE AND COMPLIANCE AT CUSTOMER OPTION
Standard SBs	SB139-551 REVISION A	ATA 93 - INSTALLATION OF KIT FLIR WESCAM MX-10	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-063. NOT APPLICABLE TO AIRCRAFT S/N.
Standard SBs	SB139-573, NEW ISSUE	ATA 31 - KIT HUMS COMPLETION	-	-	-/NOT APPLICABLE	TIC-AW139-19-035 - NOT APPLICABLE BY ACRFT SN AND THIS IS OPTIONAL SB

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	24
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB139-525, REVISION A	ATA 95 - INSTALLATION OF INFLATION SERVICE CHARTS	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO COMPONENT PART NUMBER P/N FOR THE NEW EFFECTIVITY. REFER TO TIC-AW139-19-018 DATED 22 NOVEMBER 2019
Standard SBs	GOODRICH SB 44316-12-101-07 REV.1	EQUIPMENT/FURNISHING - 44316 HOIST UPGRADE/CONVERSION - PRODUCT IMPROVEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-19-010
Standard SBs	SB139-535 REV./	ATA 23 - INSTALLATION OF KIT EXTERNAL LOUDSPEAKERS	-	-	-/OPTIONAL	TIC-YTL-19-028 - THIS SERVICE BULLETIN IS ISSUED IN ORDER TO PROVIDE THE NECESSARY INSTRUCTION FOR INSTALLATION OF THE EXTERNAL LOUDSPEAKERS (400 W).
Standard SBs	139-385 PART II	ATA 93 - INSTALLATION OF KIT VIDEO MODULE INTERFACE P/N	-	-	-/OPTIONAL	TIC-PMA-19-023 APPLICABLE AND COMPLIANCE AT CUSTOMER REQUEST
Standard SBs	SB 139-385 PART I	ATA 93 - INSTALLATION OF KIT VIDEO MODULE INTERFACE P/N 3G9310F00212, 4G9310F00211 OR P/N 4G9310F00212	-	-	-/NOT APPLICABLE	TIC-PMA-19-023 PART I: NOT APPLICABLE TO AIRCRAFT S/N PART II: APPLICABLE TO AIRCRAFT S/N COMPLIANCE AT CUSTOMERS OPTION. THIS SB PROVIDES INSTRUCTION OF THE KIT VIDEO MODULE INTERFACE (VMI).
Standard SBs	ATA 93 - VIDEO CUSTOMIZATION AND CB PANEL REPLACEMENT	SB139-561 REV. /	-	-	-/NOT APPLICABLE	N/A DUE TO A/C S/N REF: TIC-PMA-19-014
Standard SBs	B139-580, NEW ISSUE	SATA 64 - FIPS TAIL ROTOR BLADES INSPECTION	-	-	-/NOT APPLICABLE	N/A DUE TO COMPONENT NOT INSTALLED REF: TIC-PMA-19-018
Standard SBs	SB139-532 REV. /	ATA 99 - INSTALLATION OF KIT SIAP AND RWR AND LWR	-	-	-/NOT APPLICABLE	N/A DUE TO A/C S/N REF: TIC-PMA-19-019
Standard SBs	SB 139-536 REV./	ATA 23 - ICS CABIN STATION 4 REPOSITIONING	-	-	-/NOT APPLICABLE	TIC-PMA-19-011 N/A BY ACRFT SN
Standard SBs	SB 139-529 REV./	ATA 97 - INSTALLATION OF KIT AVALEX DIGITAL VIDEO AUDIO RECORDER	-	-	-/OPTIONAL	TIC-PMB-19-010 (IF TO COMPLY TO REQUEST AUX CB PANEL 3M BEFORE COMPLIANCE.
Standard SBs	SB139-521 REV./	ATA 28 - INSTALLATION OF MAIN LH AND RH SELF-SEALING FUEL TANKS	-	-	-/NOT APPLICABLE	TIC-PMA-19-009 N/A BY ACRFT SN

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	25
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	BT 139-567 REVISION B	ATA 63 - MGB BEARING LOCK-NUT REPLACEMENT	0.00	30000.00	-/SUPERSEDED	FOR COMPLIANCE AND EFFECTIVITY FOR ALL HELICOPTERS S/N REFER TIC-AW139-19-042, EXCEPT FOR 9M-PMD (31809) REFER TIC-AW139-19-094 THIS TIC HAS BEEN SUPERSEDED BY TIC-AW139-20-193 IN CONJUNCTION WITH TIC-AW139-19-126 (SBA NO. 139-609) DATED 2-NOV-2020
Standard SBs	SB139-566 REV./	ATA 99 - EWP/CDU SOFTWARE UPGRADE	-	-	-/NOT APPLICABLE	TIC-YPG-19-007 NOT APPLICABLE TO ACRFT SN
Standard SBs	SB139-531 REV./	ATA 99 - SDU SUPPORT IMPROVEMENT	-	-	-/NOT APPLICABLE	TIC-PMA-19-006 NOT APPLICABLE TO COMPONENT PART NO.
Standard SBs	SB139-560 REV./	ATA 25 - INSTALLATION OF THE TWO-PIECE DRESS COVER AND CUSHION ON OFFSHORE PASSENGER SEAT	-	-	-/NOT APPLICABLE	TIC-PMA-19-005 NOT APPLICABLE TO AIRCRAFT COMPONENT PART NO. OPTIONAL SB
Standard SBs	SB139-571, NEW ISSUE	ATA 64 - DUPLEX BEARING P/N 3G430V00153 RECALL	-	-	-/NOT APPLICABLE	TIC-PMA-19-003 N/A COMPONENT FITTED WITH SN 17196
Standard SBs	SB 139-375 REV./ PART I, II & IV	ATA 24 - AUXILIARY CIRCUIT-BREAKER PANEL MODIFICATIONS	-	-	-/NOT APPLICABLE	TIC-PMA-19-002 PART 1: N/A BY COMPONENT SN PART 2-4 N/A BY A/C SN
Standard SBs	SB139-569 REV.B PART I(AD2018-0292) COMPLIANCE	ATA 64 TAIL ROTOR SLIDER ASSY DETAILED INSPECTION	0.00	2400.00	-/TO BE COMPLIED	TIC-AW139-22-0155 DATED 26 JULY 2022 APPLICABLE DUE TO AIRCRAFT TYPE
Standard SBs	ATA 30 - ROTORS ICE PROTECTION CABLES CONNECTOR	BT139-499 REV. /	-	-	-/NOT APPLICABLE	N/A DUE TO FIPS NOT INSTALLED REF: TIC-PMA-18-045
Standard SBs	BT 139-192	SLIDING PASSENGER DOOR CHECK AND ADJUSTMENT	25/09/2018	24/09/2019	-/NOT APPLICABLE	NOT APPLICABLE DUE ONLY APPLICABLE FOR ACRFT RELEASE PRIOR 2012 REF. WP-PMA-19-587-019 @ 249:15FH ON 27/09/2019
Standard SBs	BT 139-467 PART II REV A	TAIL ROTOR DRIVE LINE (TRDL) BEARING SUPPORT BRACKET	-	-	-/CANCELLED	TIC-AW139-22-0006 DATED 27 JANUARY 2022 SB CANCELLED.
Standard SBs	BT 139-396 REV. B	ATA 25 - INSTALLATION OF KIT SINGLE HOIST GOODRICH	-	-	-/NOT APPLICABLE	TIC-PMA-19-022 SB139-396 REV.A (OPTIONAL SB) - N/A BY ACRFT SN TIC-AW139-20-095 - SB139-396 REV. B - NOT APPLICABLE

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	26
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-362, REV A	ATA 76 - ENGINE CONTROL MECHANICAL BACKUP	-	-	-/OPEN	TIC-AW139-22-0163 DATED 04 AUGUST 2022 MODIFICATION ALREADY INCORPORATED ON THE HELICOPTER
Standard SBs	SB NO. 139-284 REV F	ATA 31 - INSTALLATION OF FDR AND RIPS VARIANTS P/N 3G3106P01311 AND P/N 3G3106P01312	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-054 PART II: APPLICABLE TO 9M-BOC & 9M-BOD DUE TO AIRCRAFT SERIAL NUMBER. COMPLIANCE AT CUSTOMERS'S OPTION
Standard SBs	SB NO 139-258, REVISION A	ATA 33- INSTALLATION OF SX16 IFCO NVG VARIANT	-	-	-/NOT APPLICABLE	NOT APPLICABLE AIRCRAFT S/N. REFER TO TIC-AW139-19-088
Standard SBs	BT 139-198 REV. B	SECONDARY AVIONIC BAY, MODIFICATION OF	-	-	-/OPTIONAL	REF: TIC-PMA-19-026
Standard SBs	SB NO. 139-157 REV C	PRIMUS EPIC@ FLIGHT SOFTWARE RELEASE 5.6.0 INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-20-052 PART I: APPLICABLE ONLY TO 9M-BOC & 9M-BOD DUE TO AIRCRAFT SERIAL NUMBER. COMPLIANCE AT CUSTOMER'S OPTION
Standard SBs	SB 139-137 REV C PART I AND II	KIT POWERED PARKING BRAKE MODULE P/N 3G3240F00111, INSTALLATION OF.	-	-	-/NOT APPLICABLE	PART I: NOT APPLICABLE TO AIRCRAFT S/N PART II: NOT APPLICABLE TO AIRCRAFT S/N REFER TO TIC-AW139-19-092
Standard SBs	SB NO 139-137 REVISION C PART III	KIT POWERED PARKING BRAKE MODULE P/N 3G3240F00111, INSTALLATION OF.	-	-	-/OPTIONAL	PART III: APPLICABLE TO AIRCRAFT S/N. COMPLIANCE AT CUSTOMER'S OPTION. REFER TO TIC-AW139-19-092
Standard SBs	BT 139-132 REVISION A	COLLECTIVE EMERGENCY LIFERAFT CONVERSION	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-060 DATED 27 MARCH 2020. NOT APPLICABLE DUE TO COMPONENT P/N NOT AFFECTED.
Standard SBs	SB 139-083, REVISION A	ATA 25 - FAST ROPING KIT P/N 4G2590F00211.	-	-	-/OPTIONAL	REFER TO TIC-AW139-20-023 DATE ISSUE 25 FEBRUARY 2020. APPLICABLE DUE TO COMPONENT ALREADY FITTED ON AIRCRAFT.
Standard SBs	BT 139-027 REV B	PART I: CARGO HOOK KIT P/N 3G2592F00111 INSTALLATION. PART II: VIDEO MODULE INTERFACE KIT P/N 3G9310F00212 INSTALLATION. PART III: CARGO HOOK VIDEO CAMERA KIT P/N 3G9770F00111 INSTALLATION.	-	-	-/NOT APPLICABLE	139-027 REV.A APPLICABLE 139-027 REV.B NOT APPLICABLE AS PER TIC-PMA-19-024
Standard SBs	BT 139-025 REV.A	INSTALLATION OF THE KTA 970 TCAS I SYSTEM, WITH APPLICATION OF THE KIT P/N 3G3450F00311.	-	-	-/NOT APPLICABLE	TIC-PMA-18-018 (DTD 281118) NOT APPLICABLE BY ACRFT SN
Standard SBs	SB NO. 139-358 REV. B	ATA 71 - EXHAUST DUCTS AND REAR FIREWALL RETROMOD	-	-	-/NOT APPLICABLE	

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	27
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	ASB NO. 139-648, REVISION A	ATA 25 - LIFERAFT RESERVOIR INSPECTION AND REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-21-0023 PART I: NOT APPLICABLE DUE TO COMPONENT LIFERAFT RESERVOIR P/N 3G2560V01251 & P/N 3G2560V01951 NOT FITTED ON AIRCRAFT PART II: NOT APPLICABLE DUE TO COMPONENT KIT EMERGENCY FLOAT P/N 4G9560F00111 & P/N 4G9560F00211 NOT FITTED ON AIRCRAFT PART III: NOT APPLICABLE DUE TO COMPONENT KIT EMERGENCY FLOAT P/N 4G9560F00111 & P/N 4G9560F00211 NOT FITTED ON AIRCRAFT AIRCRAFT FITTED WITH EMERGENCY FLOAT KIT P/N 3G9560F00212. (REFER ATTACHEMENT)
Standard SBs	ASB NO. 139-662, NEW ISSUE	ATA 25 - LIFERAFT RESERVOIR INSPECTION & REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0024 NOT APPLICABLE DUE TO COMPONENT LIFERAFT RESERVOIR P/N 3G2560V01251 & P/N 3G2560V01951 NOT FITTED ON AIRCRAFT
Standard SBs	ASB139-654 PART I	MAIN ROTOR SWASHPLATE BOOT INSPECTION	-	-	-/COMPLIED WITH	TIC-AW139-20-199 DATED 2 DECEMBER 2020
Standard SBs	SB NO 139-474, NEW ISSUE	ATA 97 - INSTALLATION OF MAX VIZ UNDER FUSELAGE	-	-	-/OPTIONAL	TIC-AW139-21-0036 APPLICABLE DUE TO AIRCRAFT S/N
Standard SBs	SB NO 139-594, NEW ISSUE	ATA 32, INSPECTION OF MAIN LANDING GEAR ACTUATOR BOLTS	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO AIRCRAFT S/N FOR (31807 AND 31809). REFER TO TIC-AW139-19-121.
Standard SBs	SB NO. 139-148, REVISION A	ATA 25 - COMPLETE PROVISION FOR EMS (MEDEVAC) P/N 4G2564F00211	-	-	-/NOT APPLICABLE	TIC-AW139-20-086 DATED 14 MAY 2020 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER.
Standard SBs	SB NO. 139-157, REVISION C (PART II)	ATA 46 PRIMUS EPIC® FLIGHT SOFTWARE RELEASE 5.6.0	-	-	-/NOT APPLICABLE	TIC-AW139-20-196 REV.C NOT APPLICABLE BY AIRCRAFT SN - OPTIONAL SB
Standard SBs	SB NO. 139-357, REVISION B	ATA 34 - KIT 2ND GPS P/N 4G3450F00611 OR KIT 2ND SBAS P/N 4G3450F00613	-	-	-/NOT APPLICABLE	TIC-AW139-20-056 DATED 26 MARCH 2020. NOT APPLICABLE DUE TO HELICOPTER SERIAL NUMBER.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	28
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-407 REV C PART I	ATA 71 - INSTALLATION OF INLET BARRIER FILTER	-	-	-/OPTIONAL	TIC-AW139-21-0399 (OPTIONAL SB) DATED 18 NOVEMBER 2021 APPLICABLE TO PART I DUE TO ALL AIRCRAFT SERIAL NUMBER.
Standard SBs	SB NO. 139-537, NEW ISSUE	ATA 95 - DART EMERGENCY FLOTATION LIFE RAFT IMPROVEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-20-080 DATED 02 MAY 2020. NOT APPLICABLE DUE TO COMPONENT P/N 4G9560F00111 OR P/N 4G9560F00211 NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-548, REVISION A - PART 1	ATA 30 - LH VERNIER ICE DETECTOR WITH LIGHT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0033 PART I : NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB NO. 139-583 (PART I)	ATA 62 - ROTATING SWASHPLATE ASSY P/N 3G6230A00333	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO 9M-PMA, 9M-PMD & 9M-PME DUE TO COMPONENT P/N 3G6230A00333 ALREADY FITTED ON AIRCRAFT. REFER TO TIC-AW139-20-125
Standard SBs	SB NO. 139-598, NEW ISSUE (PART I & II)	ATA 78 - INSTALLATION OF EXHAUST NOZZLE BLANKET	-	-	-/OPTIONAL	APPLICABLE TO DUE TO COMPONENT P/N 3G7800L00732 FITTED ON AIRCRAFT. COMPLIANCE AT CUSTOMER'S OPTION
Standard SBs	SB NO. 139-598, NEW ISSUE (PART III & IV)	ATA 78 - INSTALLATION OF EXHAUST NOZZLE BLANKET	-	-	-/OPTIONAL	APPLICABLE DUE TO COMPONENT P/N 3G7800L00632 FITTED ON AIRCRAFT. COMPLIANCE: AT CUSTOMER'S OPTION.
Standard SBs	SB NO. 139-604 REV./	ATA 66 INSTALLATION OF KIT MOORING	-	-	-/OPTIONAL	TIC-AW139-20-071 - APPLICABLE, OPTIONAL
Standard SBs	SB NO. 139-608, NEW ISSUE	ATA 53 INSPECTION OF BL 275 (LH/RH) AT STA 3500	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-087. NOT APPLICABLE TO ALL AIRCRAFT SERIAL NUMBER.
Standard SBs	SB NO.139-585 (PART II)	ATA 95 - RIGHT AFT FLOAT INSPECTION AND BAGGAGE FLOOR PANEL RETROMODIFICATION	-	-	-/NOT APPLICABLE	TIC-AW139-20-170 DATED 05 OCTOBER 2020 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AND COMPONENT PART NUMBER 3G9560F00212 NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-471	ATA 52 - SOFT COVER FAIRING LIFERAFT RETROMOD	-	-	-/NOT APPLICABLE	TIC-AW139-20-104 DATED 26 JUNE 2020. NOT APPLICABLE DUE TO COMPONENT PART NUMBER NOT FITTED ON AIRCRAFT.
Standard SBs	SBA 139-661 REV. B PART I	ATA 24 - OVERHEAD PANEL INSPECTION	-	-	-/COMPLIED WITH	TIC-AW139-22-0116 DATED 09 MAY 2022 9M-PMA-5801 AT 826:30 FH ON 10/02/2021 (AJL 03717)

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	29
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	TMI 139-475, REVISION C	ENGINE LH/RH REINFORCEMENT P/N 3P5333A15352 / 3P5333A15452 REPLACEMENT PROCEDURE	-	-	-/NOT APPLICABLE	
Standard SBs	TMI 139-533, NEW ISSUE	FRAME STA 3120 - SPECIFIC REPAIR PROCEDURE	-	-	-/NOT APPLICABLE	
Standard SBs	SB 139-601 REV A PART II	ATA 33 - INSPECTION AND REINFORCEMENT OF SEARCHLIGHT SUPPORT	-	26/06/2022	-/OPTIONAL	REFER TIC-AW139-22-0119 DATED 12 MAY 2022. APPLICABLE. ORDINE DI LAVORO MARK: ODL434609. REFER PHYSICAL CHECK IN 9M-PMA-9369 ON 31.12.2021 AT 1247:25 FH.
Standard SBs	SB 139-656 NEW ISSUE	ATA 21 - INSTALLATION OF ENVIRONMENTAL CONTROL SYSTEM (ECS) HIGH EFFICIENCY PARTICULATE AIR (HEPA) FILTER	-	-	-/NOT APPLICABLE	APPLICABILITY: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED PLEASE REFER TO TIC-AW139-21-0341
Standard SBs	SB 139-667 NEW ISSUE	ATA 24 - AUXILIARY OVERHEAD PANEL AND INTERSEAT CONSOLE MODIFICATIONS	-	-	-/NOT APPLICABLE	APPLICABILITY: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED PLEASE REFER TO TIC-AW139-21-0262
Standard SBs	SB 139-675 NEW ISSUE	ATA 97 - KIT CABIN CAMERA SOFT LINER INSTALLATION	-	-	-/NOT APPLICABLE	APPLICABILITY: NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED PLEASE REFER TO TIC-AW139-21-0344
Standard SBs	SB 139-696, NEW ISSUE	ATA 63 - MAIN GEAR BOX REMARKING	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO COMPONENT MGB P/N 3G6320A00134 WITH AFFECTED S/N NOT FITTED ON THE AIRCRAFT. REFER TO TIC-AW139-21-0410
Standard SBs	SB NO. 139-577 PART I, NEW ISSUE	ATA 53 - LOWER INSPECTION COVER INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0345 DATED 28 SEPTEMBER 2021 PART I: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION
Standard SBs	SB NO. 139-596, REVISION A	ATA 21 - INSTALLATION OF INSULATION TUBES ON ECS PIPE	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-21-0346, NOT APPLICABLE DUE TO COMPONENT AIR CONDITIONING P/N P/N 3G2150A04211, OR P/N 3G2150A04811, OR P/N 3G2150A05011, OR P/N 3G2150A05411, OR P/N 3G2150A05611 AND SUBSEQUENT NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-641, NEW ISSUE	ATA 25 - COLLECTIVE EMERGENCY LIFE-RAFT NEW HANDLE COVER	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0372. NOT APPLICABLE DUE TO COMPONENT KIT EMERGENCY FLOAT AND LIFERAFTS P/N 3G9560F0011 NOT INSTALLED ON AIRCRAFT.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	30
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-670, NEW ISSUE	ATA 11 - ADDITIONAL MARKING PLACARD INSTALLATION	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-21-0347. NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SB139-539 PART III (1500H//2Y)	ATA 53 - TRDL BEARING SUPPORT PANEL REINFORCEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0007 DATED 27 JANUARY 2022 NOT APPLICABLE DUE TO AFFECTED TAIL BOOM ASSY NOT FITTED ON AIRCRAFT.
Standard SBs	SB NO. 139-135, REV. A PART I	ATA 25 - INSTALLATION OF KIT WIRE STRIKE PROTECTION SYS	-	-	-/OPTIONAL	TIC-AW139-22-0013 DATED 11 FEBRUARY 2022 PART I: APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION (OPTIONAL SB)
Standard SBs	SB NO. 139-135, REV. A PART II	ATA 25 - INSTALLATION OF KIT WIRE STRIKE PROTECTION SYS	-	-	-/OPTIONAL	TIC-AW139-22-0013 DATED 11 FEBRUARY 2022 PART II: APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION (OPTIONAL SB)
Standard SBs	SB NO. 139-135, REV. A PART III	ATA 25 - INSTALLATION OF KIT WIRE STRIKE PROTECTION SYS	-	-	-/NOT APPLICABLE	TIC-AW139-22-0013 DATED 11 FEBRUARY 2022 PART III: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED OPTIONAL SB
Standard SBs	SB NO. 139-135, REV. A PART IV	ATA 25 - INSTALLATION OF KIT WIRE STRIKE PROTECTION SYS	-	-	-/NOT APPLICABLE	TIC-AW139-22-0013 DATED 11 FEBRUARY 2022 PART IV: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED OPTIONAL SB
Standard SBs	SB NO. 139-135, REV. A PART V	ATA 25 - INSTALLATION OF KIT WIRE STRIKE PROTECTION SYS	-	-	-/OPTIONAL	TIC-AW139-22-0013 DATED 11 FEBRUARY 2022 PART V: APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED OPTIONAL SB - COMPLIANCE UPON CUSTOMER REQUEST

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	31
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB 139-516 PART I & II (NEW ISSUE)	ATA 95 EMERGENCY FLOTATION AND LIFE RAFT SYSTEMS CONVERSION TO DART INTEGRATED SYSTEM	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO COMPONENT PART NUMBER NOT AFFECTED. REFER TIC-AW139-22-0002 DATED 19.01.2022
Standard SBs	SB NO. 139-407 REV C PART II AND III	ATA 71 - INSTALLATION OF INLET BARRIER FILTER	-	-	-/NOT APPLICABLE	TIC-AW139-21-0399 DATED 18 NOVEMBER 2021 OPTIONAL SB PART II: NOT APPLICABLE DUE TO COMPONENT IBF LH ASSY P/N 3G7160V03931 NOT INSTALLED ON AIRCRAFT PART III: NOT APPLICABLE DUE TO COMPONENT IBF COMPLETE PROVISION P/N 3G7160A07811 NOT INSTALLED ON AIRCRAFT
Standard SBs	SB NO. 139-623, REV. A	ATA 00 - MISCELLANEOUS RETROFIT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0012 DATED 10 FEBRUARY 2022 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION
Standard SBs	SB NO. 139-619, REV. B (PART I & II)	ATA 56 - REPLACEMENT OF BUBBLE WINDOW WITH STANDARD WINDOW	-	-	-/NOT APPLICABLE	TIC-AW139-22-0027 DATED 21 MARCH 2022 PART I: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED PART II: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED
Standard SBs	BT 139-569 REV B	ATA 64 - TAIL ROTOR SLIDER ASSY DETAILED INSPECTION	-	-	-/OPTIONAL	TIC-AW139-22-0155 DATED 26 JULY 2022 APPLICABLE DUE TO AIRCRAFT TYPE
Standard SBs	SB 139-695 NEW ISSUE	ATA 56 - INSTALLATION OF ACRYLIC WINDSHIELDS	-	-	-/OPTIONAL	TIC-AW139-22-0131 DATED 09 JUNE 2022 APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED
Standard SBs	SB 139-699, NEW ISSUE	ATA 33 - TAIL ROTOR LIGHTS IMPROVEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0145 DATED 14 JULY 2022 NOT APPLICABLE DUE TO AIRCRAFT NOT FITTED WITH AFFECTED PART NUMBER.
Standard SBs	SB 139-719 NEW ISSUE	ATA 93 OPLS LASER SENSOR UNIT FIRMWARE UPDATE.	-	-	-/NOT APPLICABLE	TIC-AW139-22-0130 DATED 01 JUNE 2022 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	32
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-360 REV B PART I	ATA 24 - KIT BATTERY START IN PARALLEL 44 Ah AND 27 Ah	-	-	-/NOT APPLICABLE	TIC-AW139-22-0126 DATED 24 MAY 2022 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-360 REV B PART II	ATA 24 - KIT BATTERY START IN PARALLEL 44AH AND 27 AH	-	-	-/OPTIONAL	TIC-AW139-22-0126 DATED 24 MAY 2022 APPLICABLE TO THIS AIRCRAFT DUE TO SERIAL NUMBER AFFECTED
Standard SBs	SB NO. 139-406, REV. A (PART I)	ATA 97 - KIT EXTERNAL VIDEO CAMERA	-	-	-/NOT APPLICABLE	TIC-AW139-22-0025 DATED 21 MARCH 2022 PART I: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED
Standard SBs	SB NO. 139-406, REV. A (PART II)	ATA 97 - KIT EXTERNAL VIDEO CAMERA	-	-	-/NOT APPLICABLE	TIC-AW139-22-0025 DATED 21 MARCH 2022 PART II: NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED
Standard SBs	SB NO. 139-406, REV. A (PART III)	ATA 97 - KIT EXTERNAL VIDEO CAMERA	-	-	-/OPTIONAL	TIC-AW139-22-0025 DATED 21 MARCH 2022 PART III: APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION (OPTIONAL SB)
Standard SBs	SB NO. 139-406, REV. A (PART IV)	ATA 97 - KIT EXTERNAL VIDEO CAMERA	-	-	-/OPTIONAL	TIC-AW139-22-0025 DATED 21 MARCH 2022 PART IV: APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION (OPTIONAL SB)
Standard SBs	SB NO. 139-577 PART II, NEW ISSUE	ATA 53 - LOWER INSPECTION COVER INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-21-0345 DATED 28 SEPTEMBER 2021 PART II: APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION (OPTIONAL SB)
Standard SBs	SB NO. 139-586, NEW ISSUE	ATA 95 - DART INTEGRATED EMERGENCY FLOTATION AND LIFE RAFT SYSTEM KIT INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-22-0133 DATED 16 JUNE 2022 APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	33
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-624, NEW ISSUE	ATA 23 - SATCOM SKYTRACK ISAT-200A KIT INSTALLATION	-	-	-/OPTIONAL	TIC-AW139-22-0026 DATED 21 MARCH 2022 APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER AFFECTED COMPLIANCE: AT CUSTOMER'S OPTION (OPTIONAL SB)
Standard SBs	SB NO. 139-678 REV./ PART 1 (EASA AD 2020-0191 R1)	ATA 53 - MIDDLE PANEL RETROMOD INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-22-0143 DATED 05 JULY 2022 NOT APPLICABLE DUE TO AIRCRAFT CONFIGURATION INSTALLING 1ST ROW CENTRAL SEAT/SEATS FWD FACING IS NOT EQUIPPED ON AIRCRAFT.
Standard SBs	SB NO. 139-678 REV./ PART 2 (EASA AD 2020-0191 R1)	ATA 53 - MIDDLE PANEL RETROMOD INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-22-0143 DATED 05 JULY 2022 NOT APPLICABLE DUE TO AIRCRAFT CONFIGURATION INSTALLING 1ST ROW CENTRAL SEAT/SEATS FWD FACING IS NOT EQUIPPED ON AIRCRAFT.
Standard SBs	SB NO. 139-678 REV./ PART 3 (EASA AD 2020-0191 R1)	ATA 53 - MIDDLE PANEL RETROMOD INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-22-0143 DATED 05 JULY 2022 NOT APPLICABLE DUE TO AIRCRAFT CONFIGURATION INSTALLING 1ST ROW CENTRAL SEAT/SEATS FWD FACING IS NOT EQUIPPED ON AIRCRAFT.
Standard SBs	SB NO. 139-685, NEW ISSUE	LEONARDO HELICOPTERS - AW139 SERVICE BULLETIN ATA 93 - AIRCRAFT SURVIVABILITY EQUIPMENT (ASE) MODIFICATION	-	-	-/NOT APPLICABLE	TIC-AW139-22-0144 DATED 14 JULY 2022 NOT APPLICABLE DUE TO SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-692, NEW ISSUE	DRIVE PULLEY WASHER INSPECTION	-	-	-/FOR INFO ONLY	TIC-AW139-22-0192 DATED 07 SEPTEMBER 2022 NOT APPLICABLE DUE TO COMPRESSORS (FITTED ON AIRCRAFT) SERIAL NUMBER NOT AFFECTED.
Standard SBs	SB NO. 139-709, NEW ISSUE	ATA 33 PLACARD PROVISION REMOVAL	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED. REFER TO TIC-AW139-22-0015.
Standard SBs	SB NO. 139-722, NEW ISSUE	MAIN ROTOR HEAD ASSY UPGRADE	-	-	-/NOT APPLICABLE	TIC-AW139-22-0170 DATED 22 AUGUST 2022 NOT APPLICABLE DUE TO COMPONENT MAIN ROTOR HEAD ASSEMBLIES P/N 3G6220A00132 NOT FITTED ON AIRCRAFT.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	34
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	SB NO. 139-726, NEW ISSUE	MODULAR AVIONIC UNIT (MAU) MARKING	-	-	-/NOT APPLICABLE	TIC-AW139-22-0162 DATED 04 AUGUST 2022 NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED
Standard SBs	SBEA 139-725 REV. A PART III (EASA AD 2022-0182)	ATA 64 - TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0167 DATED 10 AUGUST 2022 NOT APPLICABLE DUE TO COMPONENT TAIL ROTOR DUPLEX BEARING P/N 3G6430V00153 HAS NOT LOGGED 2400 FH OR MORE.
Standard SBs	SBEA 139-725 REV.A PART IV (EASA AD 2022-0182)	ATA 64 - TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT	0.00	1669.83	-/TO BE COMPLIED	TIC-AW139-22-0167 DATED 10 AUGUST 2022 APPLICABLE TO PARAGRAPH A DUE TO COMPONENT AIL ROTOR DUPLEX BEARING P/N 3G6430V00153 HAVE LESS THAN 2400 FH AND HAVE BEEN REMOVED AND REINSTALLED ON SLIDING CONTROL ASSEMBLY P/N 3G6430A02531.
SERVICE BULLETIN ENGINE						
ENGINE #1						
Standard SBs	NO. 1 ENGINE ~ SB NO. 41119, REVISION 4	PT6C-67C SERVICE BULLETIN IGNITION EXCITER - REPLACEMENT OF	-	-	-/Category 7	TIC-AW139-21-0249 DATED 30 JUNE 2021 APPLICABLE DUE TO ENGINE BUILD SPEC AND SERIAL NUMBER AFFECTED.
Standard SBs	NO. 1 ENGINE ~ SB NO 41116, REVISION 1	TURBOSHAFT ENGINE FUEL MANAGEMENT MODULE VENT PACKING KIT - INTRODUCTION OF	-	-	-/FOR INFO ONLY	REFER TO TIC-AW139-19-076 - APPLICABLE TO ENGINE TYPE COMPLIANCE: CATEGORY 9 - SPARE PARTS INFORMATION
Standard SBs	NO. 1 ENGINE ~ SB NO. 41110 REVISION 2	PERMANENT MAGNETIC ALTERNATOR GEARSHAFT AND ROLLER BEARING REPLACEMENT OF	-	-	-/Category 7	TIC-AW139-21-0239 DATED 11 JUNE 2021 APPLICABLE DUE TO ENGINE BUILD SPECT AND SERIAL NUMBER AFFECTED
Standard SBs	NO. 1 ENGINE ~ SB NO. 41112, REVISION 1	TURBOSHAFT ENGINE - FUEL MANAGEMENT MODULE (FMM) - REPLACEMENT / MODIFICATION	-	-	-/Category 7	TIC-AW139-21-0240 DATED 11 JUNE 2021 APPLICABLE DUE TO BUILD SPEC AND ENGINE SERIAL NUMBER AFFECTED. CONCURRENT REQUIREMENT: NONE.
Standard SBs	NO. 1 ENGINE ~ SB NO. 41118, REV. 3	TURBOSHAFT ENGINE - CENTRIFUGAL IMPELLER - REPLACEMENT OF	-	-	-/NOT APPLICABLE	TIC-AW139-20-205 CAT 7, APPLICABILITY: NOT APPLICABLE ENGINE SN NOT AFFECTED.

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	35
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	NO. 1 ENGINE ~ SB NO. 41120, REVISION 2	PT6C-67C BS963 AND BS1019 TO PT6C-67C1 BS1447 AND BS1448 - CONVERSION OF	-	-	-/NOT APPLICABLE	TIC-AW139-21-0270 DATED 11 AUGUST 2021 CATEGORY 8. NOT APPLICABLE DUE TO ENGINE SERIAL NUMBER NOT AFFECTED.
Standard SBs	NO.1 ENGINE ~ SB NO. 41121 REV. 2	PT6C-67C SERVICE BULLETIN - HOUSINGS FOR ACCESSORY GEARBOX AND INLET CASE - IDENTIFICATION OF	-	-	-/Category 5	TIC-AW139-22-0112 DATED 27 APRIL 2022 CATEGORY 5. APPLICABLE DUE TO ENGINE TYPE AFFECTED.
Standard SBs	NO. 1 ENGINE ~ SB NO. 41103, REVISION 1	TURBOSHAFT ENGINE - CHECK VALVE ASSEMBLY - REPLACEMENT OF	-	-	-/COMPLIED WITH	TIC-AW139-20-188 - COMPLIED BY OEM
Standard SBs	NO. 1 ENGINE ~ SB NO. 41111	TURBOSHAFT ENGINE- DIAMETRICAL GROWTH DIMENSION COMPRESSOR TURBINE DISK - CORRECTION OF	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-044. NOT APPLICABLE TO ALL SERIAL NUMBER ENGINE TYPE.
Standard SBs	SB NO 41093, NEW ISSUE	TURBOSHAFT ENGINE - ROLLER BEARING OPTION (IC)- REPLACE	-	-	-/PARTS IS FULLY USED	REFER TO TIC-AW139-20-041. APPLICABLE TO ALL SERIAL NUMBER ENGINE TYPE. SUPPLY OF SUPERSEDED PARTS IS FULLY USED.
Standard SBs	SB NO. 41089, REVISION 3	TURBOSHAFT ENGINE - CHECK VALVE PLATE- REPLACEMENT OF	-	-	-/FOR INFO ONLY	REFER TO TIC-AW139-20-040 APPLICABLE TO ALL SERIAL NUMBER ENGINE TYPE.
Standard SBs	SB NO. 41703, REVISION 1	TURBOSHAFT ENGINE - FUEL MANAGEMENT MODULE REPLACEMENT/	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-039 NOT APPLICABLE TO ENGINE S/N
Standard SBs	SB NO 41113R1	TURBOSHAFT ENGINE COUPLING NUT TORQUE, FUEL LINE - INSPECTION OF	-	-	-/COMPLIED WITH	TIC-AW139-19-046 APPLICABLE TO ENGINE SERIAL NUMBER. COMPLIED WITH AJL NO 01743 WP# WP-PMA-19-566-001 ON 23-AUG-19 AT 223:30FH
Standard SBs	P&W SB NO. 4116 NEW ISSUE	FUEL MANAGEMENT MODULE VENT PACKING KIT - INTRODUCTION OF	-	-	-/FOR INFO ONLY	TIC-AW139-19-031 - COMPLIANCE CAT. 9SPARE PARTS INFORMATION
Standard SBs	NO. 1 ENGINE ~ SB NO. 41114 REV. 2	ENGINE INSULATION BLANKET	-	-	-/Category 7	TIC-AW139-19-009 CAT 7 WHEN SUPERSEDED PART IS FULLY USED
Standard SBs	NO. 1 ENGINE ~ SB NO. 41066 REVISION 5	POWER TURBINE SHAFT AND STATOR ASSEMBLIES - REPLACEMENT OF	-	-	-/COMPLIED WITH	TIC-AW139-19-025 DATED 23 JUNE 2019 APPLICABLE TO ENGINE TYPE
Standard SBs	NO. 1 ENGINE ~ SB NO. 41065, REVISION 3	POWER TURBINE VANE RING - REPLACEMENT/MODIFICATION OF	-	-	-/NOT APPLICABLE	TIC-AW139-19-047 DATED 17 JULY 2019 NOT APLICABLE DUE TO ENGINE SERIAL NUMBER.
Standard SBs	P&WC SB NO. 41095 REV. 1	POWER TURBINE SHAFT - INSPECTION OF	-	-	-/FOR INFO ONLY	
Standard SBs	3HRL4-HOIST-ATF-01R2	EQUIPMENT/FURNISHINGS - RESCUE HOIST LUBRICATION UPDATE - PRODUCT IMPROVEMENT	-	-	-/FOR INFO ONLY	

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	36
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	NO. 1 ENGINE ~ SB NO. 41073, REVISION 1	TURBOSHAFT ENGINE - FUEL MANAGEMENT MODULE - REPLACEMENT/MODIFICATION OF	-	-	-/N/A (POST-MOD)	TIC-AW139-20-039 DATED 11 MARCH 2020 NOT APPLICABLE TO ENGINE SERIAL NUMBER
Standard SBs	SB 42325-213-01 REV. 2	EQUIPMENT/FURNISHINGS - CABLE KICKER REPLACEMENT - PRODUCT IMPROVEMENT	-	-	-/CANCELLED	
Standard SBs	SB 49900-889-101-01 REV 1	EQUIPMENT/FURNISHINGS - GROUND SUPPORT EQUIPMENT - REMOVAL FROM SERVICE	-	-	-/FOR INFO ONLY	
Standard SBs	NO. 1 ENG - SB NO. 41057, REVISION 6	PT6C-67C SERVICE BULLETIN SHROUD HOUSING, COMPRESSOR TURBINE - REPLACEMENT/MODIFICATION OF	-	-	-/NOT APPLICABLE	TIC-AW139-21-0031 NOT APPLICABLE DUE TO #1 ESN (PCE-KB2067) NOT AFFECTED
Standard SBs	NO. 1 ENGINE ~ SB NO. 41100, REVISION 8	TURBOSHAFT ENGINE - NO. 5 BEARING OUTPUT SHAFT SEAL - REPLACEMENT/MODIFICATION OF	-	-	-/Category 8	TIC-AW139-20-090 DATED 02 JUNE 2020 APPLICABLE DUE TO ENGINE BUILD SPECIFICATION.
Standard SBs	SB NO. 41055, NEW ISSUE	TURBOSHAFT ENGINE ACCESORY GEARBOX DIAPHRAGM - REPLACEMENT/MODIFICATION OF	-	-	-/NOT APPLICABLE	NOT APPLICABLE TO ENGINE S/N. COMPLIANCE: CATEGORY 7 - YOU CAN DO THIS SERVICE BULLETIN WHEN THE SUPPLY OF SUPERSEDED PARTS IS FULLY USED.
Standard SBs	SB NO. 41061, NEW ISSUE	TURBOSHAFT ENGINE FUEL FILTER - INSPECTION OF	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO ENGINE. COMPLIANCE: CATEGORY 6 - P&WC RECOMMENDS TO DO THIS SERVICE BULLETIN AT THE NEXT SCHEDULED MAINTENANCE CHECK OR WHEN THE SUBASSEMBLY (IE. MODULE, ACCESSORIES, COMPONENTS OR BUILD GROUPS) IS DISASSEMBLED AND ACCESS IS AVAILABLE TO THE NECESSARY PART; WHICHEVER OCCURS FIRST. DO ALL SPARE SUBASSEMBLIES
Standard SBs	SB NO. 41089, REVISION 3	TURBOSHAFT ENGINE CHECK VALVE PLATE - REPLACEMENT OF	-	-	-/FOR INFO ONLY	
Standard SBs	SB NO. 41093, REVISION 1	TURBOSHAFT ENGINE ROLLER BEARING OPTION (IC) - REPLACEMENT OF	-	-	-/FOR INFO ONLY	
Standard SBs	NO. 2 ENGINE ~ SB NO. 41110 REVISION 2	PERMANENT MAGNETIC ALTERNATOR GEARSHAFT AND ROLLER BEARING REPLACEMENT OF	-	-	-/Category 7	TIC-AW139-21-0239 DATED 11 JUNE 2021 APPLICABLE DUE TO ENGINE BUILD SPECT AND SERIAL NUMBER AFFECTED
Standard SBs	NO. 2 ENGINE ~ SB NO. 41066 REVISION 5	POWER TURBINE SHAFT AND STATOR ASSEMBLIES - REPLACEMENT OF	-	-	-/COMPLIED WITH	TIC-AW139-19-025 DATED 23 JUNE 2019 APPLICABLE TO ENGINE TYPE
Standard SBs	NO. 2 ENGINE - SB NO. 41109 REVISION 0	IGNITION EXCITER - REPLACEMENT OF	-	-	-/OPEN	TIC-PMA-18-027 COMPLIANCE CAT.7 - WHEN SUPPLY OF SUPERSEDED PARTS IS FULLY USED

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	37
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	NO. 2 ENGINE ~ SB NO. 41065, REVISION 3	POWER TURBINE VANE RING - REPLACEMENT/MODIFICATION OF	-	-	-/NOT APPLICABLE	TIC-AW139-19-047 DATED 17 JULY 2019 NOT APPLICABLE DUE TO ENGINE SERIAL NUMBER.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41116, REVISION 1	TURBOSHAFT ENGINE FUEL MANAGEMENT MODULE VENT PACKING KIT - INTRODUCTION OF	-	-	-/FOR INFO ONLY	REFER TO TIC-AW139-19-076 - APPLICABLE TO ENGINE TYPE COMPLIANCE: CATEGORY 9 - SPARE PARTS INFORMATION
Standard SBs	NO. 2 ENGINE ~ SB NO. 41114 REV. 2	ENGINE INSULATION BLANKET	-	-	-/Category 7	TIC-AW139-19-009 CAT 7 WHEN SUPERSEDED PART IS FULLY USED
Standard SBs	NO. 2 ENGINE ~ SB NO. 41112, REVISION 1	TURBOSHAFT ENGINE - FUEL MANAGEMENT MODULE (FMM) - REPLACEMENT / MODIFICATION	-	-	-/Category 7	TIC-AW139-21-0240 DATED 11 JUNE 2021 APPLICABLE DUE TO BUILD SPEC AND ENGINE SERIAL NUMBER AFFECTED. CONCURRENT REQUIREMENT: NONE.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41118, REV. 3	TURBOSHAFT ENGINE - CENTRIFUGAL IMPELLER - REPLACEMENT OF	-	-	-/NOT APPLICABLE	TIC-AW139-20-205 CAT 7, APPLICABILITY: NOT APPLICABLE ENGINE SN NOT AFFECTED.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41120, REVISION 2	PT6C-67C BS963 AND BS1019 TO PT6C-67C1 BS1447 AND BS1448 - CONVERSION OF	-	-	-/NOT APPLICABLE	TIC-AW139-21-0270 DATED 11 AUGUST 2021 CATEGORY 8. NOT APPLICABLE DUE TO ENGINE SERIAL NUMBER NOT AFFECTED.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41121 REV. 2	PT6C-67C SERVICE BULLETIN - HOUSINGS FOR ACCESSORY GEARBOX AND INLET CASE - IDENTIFICATION OF	-	-	-/Category 5	TIC-AW139-22-0112 DATED 27 APRIL 2022 CATEGORY 5. APPLICABLE DUE TO ENGINE TYPE AFFECTED.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41111	TURBOSHAFT ENGINE - DIAMETRICAL GROWTH DIMENSION, COMPRESSOR TURBINE DISK - CORRECTION OF	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-20-044. NOT APPLICABLE TO ALL SERIAL NUMBER ENGINE TYPE.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41119, REVISION 4	PT6C-67C SERVICE BULLETIN IGNITION EXCITER - REPLACEMENT OF	-	-	-/Category 7	TIC-AW139-21-0249 DATED 30 JUNE 2021 APPLICABLE DUE TO ENGINE BUILD SPEC AND SERIAL NUMBER AFFECTED.
Standard SBs	NO. 2 ENGINE ~ SB NO. 41103, REVISION 1	CHECK VALVE ASSEMBLY - REPLACEMENT OF	-	-	-/COMPLIED WITH	TIC-AW139-20-188 - COMPLIED BY OEM
Standard SBs	NO. 2 ENG - SB NO. 41057, REVISION 6	PT6C-67C SERVICE BULLETIN SHROUD HOUSING, COMPRESSOR TURBINE - REPLACEMENT/MODIFICATION OF	-	-	-/NOT APPLICABLE	TIC-AW139-21-0031 NOT APPLICABLE DUE TO #2 ENGINE SN (PCE-KB2069) NOT AFFECTED
Standard SBs	NO. 2 ENGINE ~ SB NO. 41073, REVISION 1	TURBOSHAFT ENGINE - FUEL MANAGEMENT MODULE - REPLACEMENT/MODIFICATION OF	-	-	-/N/A (POST-MOD)	TIC-AW139-20-039 DATED 11 MARCH 2020 NOT APPLICABLE TO ENGINE SERIAL NUMBER

Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	28/02/2023	Page No:	38
Aircraft Hours:	1644:05	Landings:	2647.00	Engine 1:	1644:05	Engine 2:	1644:05

Types	SB Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard SBs	NO. 2 ENGINE ~ SB NO. 41100, REVISION 8	TURBOSHAFT ENGINE NO. 5 BEARING OUTPUT SHAFT SEAL - REPLACEMENT/MODIFICATION OF	-	-	-/Category 8	TIC-AW139-20-090 DATED 02 JUNE 2020 APPLICABLE DUE TO ENGINE BUILD SPECIFICATION.
Types	SB Number	Subject	Last Done	Next Due	Interval	Limitation Notes
Component SBs	P&WC S.B. No. 41118	TURBOSHAFT ENGINE CENTRIFUGAL IMPELLER - REPLACEMENT OF	-	-	-	
Component SBs	P&WC S.B. No. 41118	TURBOSHAFT ENGINE CENTRIFUGAL IMPELLER - REPLACEMENT OF	-	-	-	