



AIRBUS ALERT SERVICE BULLETINS

31-May-22

AIRBUS EC155B1, S/N 6997, REG N155HH
 TURBOMECA ARRIEL 2C2, L/H ENGINE S/N 26300 & R/H ENGINE S/N 26299

EC155B1 SERVICE BULLETIN, 2022-05-09

AIRFRAME AIRBUS EC155B1, S/N 6997, DATE OF MANUFACTURED 10 JUNE 2015

* Only A (ALERT), E (EMERGENCY), M (MANDATORY), T (ALERT TELEX) listed

ASB	REV	DATE	FAA AD	EASA	SUBJECT	APPLICABILITY	AFTT	DATE	ORGANISATION	NOTE
04A001		10-Jul-01	-	2009-0122 R1	- SIREN LOAD RELEASE UNITS AS21-5-(1 TO 7): ANOMALY ON THE LOCKING KEEPER AND LOAD JAMMED ON THE CARGO HOOK IN THE OPEN POSITION - OTHER (SIREN) LOAD RELEASE UNIT TYPES: LOAD JAMMED ON THE CARGO HOOK IN THE OPEN POSITION	NOT APPLICABLE, EQUIPMENT NOT INSTALLED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A006		26-Feb-04	-	2006-0098	TO PREVENT ANY UNTIMELY OPENING OF THE HOIST HOOK	NOT APPLICABLE, EQUIPMENT NOT INSTALLED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A007		29-Jul-04	-	F-2004-060R1	NEVER EXCEED SPEED (VNE)	NOT APPLICABLE, MOD 0752C18 AND 0753C59 EMBODIED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A007	1	23-Apr-04	-	F-2004-060 R1	NEVER EXCEED SPEED (VNE)	NOT APPLICABLE, MOD 0752C18 AND 0753C59 EMBODIED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A008		17-Feb-09	2009-22-04	2009-0035-E	UNS-1D NAVIGATION SYSTEM: FREEZING OF THE ROUTE DISPLAY IN SECTOR MODE	NOT APPLICABLE, EQUIPMENT NOT INSTALLED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A009	1	30-Mar-09	2012-16-02	2009-0078 R1	LIMITATION CONCERNING THE USE OF VIP 4-SEAT BENCHES	NOT APPLICABLE, AIRCRAFT SN 6997.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A010		6-Aug-09	-	-	CALLBACK OF "CAST" LIFESAVING D'LOK HOOKS FROM BATCHES 208 AND 1108	NOT APPLICABLE, EQUIPMENT NOT INSTALLED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A012	1	28-May-14	-	-	"TRANSMIT" COMMAND USAGE LIMITATION ON THE CONTROL UNIT OF CRASH POSITION INDICATOR (CPI) EMERGENCY BEACON TYPE 15-503-134	NOT APPLICABLE, EQUIPMENT NOT INSTALLED.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	N/A
04A013	1	26-Aug-14	2021-02-01	2019-0046 2019-0088R1	ENERGY-ABSORBING SEATS LABEL "DO NOT STOW ANYTHING UNDER THE SEAT"	COMPLIED WITH AT THE TIME OF MANUFACTURE.	0.0	10-Jun-15	AIRBUS HELICOPTER MANUFACTURER	ONE TIME
04A014	7	22-Sep-21	2021-05-05	2021-0171	TAIL GEARBOX (TGB)	NOT APPLICABLE, TGB INSTALLED P/N : 365A33-6005-09, S/N M1225, POST MOD 0765B63.	244.5	31-May-22	MARK D. MCGREGOR A&P 2523065	N/A
04A015	1	20-Oct-17	-	-	REDUCTION IN SERVICE LIFE LIMIT OF ROTOR MAST BEARING SPACER	MAIN ROTOR BEARING SPACER P/N: 365A31-4527-01, S/N: M301 INSTALLED & AIRCRAFT POST MOD 0762B88. SLL REDUCED TO 3300FH OR NEXT REMOVAL OF THE ROTOR MAST.	244.5	31-May-22	MARK D. MCGREGOR A&P 2523065	NEW SLL - 3300 FH NEXT DUE AFTT: 3300 H OR NEXT ROTOR MAST REMOVAL
04A016	4	24-Oct-19	-	2021-0170	TAIL GEAR BOX (TGB) P/NOS.365A33-6005-09 AND 365A33-6005-10	TGB P/N: 365A33-6005-09, S/N: M1225 INSTALLED. CONTROL ROD DOUBLE BEARING WASHING CARRIED OUT I.A.W ASB 04A016 § 3.B.3 UNDER 316-WO-2201-KTSB-6997. TGB CHIP DETECTOR INSPECTION TO BE CARRIED OUT I.A.W ASB 04A016 § 3.B.2 EVERY 10FH. TGB DOUBLE BEARING TO BE REPLACED I.A.W ASB 04A016 § 1.E.2.a.2 AT AFTT 500H.	244.5	31-May-22	MARK D. MCGREGOR A&P 2523065	§ 3.B.2 EVERY 10 FH NEXT DUE AFTT: 254.5H § 1.E.2.a.2 EVERY 500 FH NEXT DUE AFTT: 500H