

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	1
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
ADs						
Types	AD Number	Subject	Last Done	Next Due	Interval	Limitation Notes
Repetitive ADs	EASA AD 2015-0226 REV 7 PARA 7	2600HL//36M HOIST CLUCTH REPLACEMENT - ATA 25 EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	421:00	3021:00	2600	INCLUDED INTO TASK INSPECTION 36M//2600 HOIST LIFT. REFER TO TIC- AW139-20-116. APPLICABLE TO 9M-PMA, 9M-PMB,9M-PMD, 9M-PME, 9M-BOC, 9M- BOD. LAST DONE @2731:09 FH ON 18/06/2020 REF: WP-BOC-20-1008
Repetitive ADs	EASA AD 2015-0226 REV 7 PARA 7	2600HL//36M HOIST CLUCTH REPLACEMENT - ATA 25 EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	18/06/2020	15/10/2023	36	INCLUDED INTO TASK INSPECTION 36M//2600 HOIST LIFT. REFER TO TIC- AW139-20-116. APPLICABLE TO 9M-BOC. LAST DONE @2731:09 FH ON 18/06/2020 REF: WP-BOC-20-1008
Repetitive ADs	EASA AD 2021-0044 REV 1 PARA (2) (ASB139-661 REV. B)	ATA 24 OVERHEAD PANEL INSPECTION PART II (300FH // 12M INSPECTION)	07/02/2023	07/02/2024	12	LAST DONE @ 9M-BOC-7384 AJL 04446 01-Aug-21 3271:38 9M-BOC-11184 AJL 05563 11-AUG-22 3353:51 9M-BOC-13679 AJL 04838 07-FEB-23 3651:35
Repetitive ADs	EASA AD 2021-0044 REV 1 PARA (2) (ASB139-661 REV. B)	ATA 24 OVERHEAD PANEL INSPECTION PART II (300FH // 12M INSPECTION)	3651:35	3951:35	300	LAST DONE @ 9M-BOC-7384 AJL 04446 1-Aug-21 3271:38 9M-BOC-11184 AJL 05557 29-JUN-22 3353:51 9M-BOC-13679 AJL 04838 07-FEB-23 3651:35
Repetitive ADs	AD NO. 2014-0048, NEW ISSUE PART I (REPETITIVE)	ATA 53 FUSELAGE - SUBFLOOR FRAME STA 2105 INSPECTION / MODIFICATION (REPETITIVE)	-	00/00/0000	6	THIS REPETITIVE AD HAS BEEN TERMINATED SINCE THE ACCOMPLISHMENT OF AD NO. 2014-0048, NEW ISSUE PART II.
Repetitive ADs	AD NO. 2014-0048, NEW ISSUE PART I (REPETITIVE)	ATA 53 FUSELAGE - SUBFLOOR FRAME STA 2105 INSPECTION / MODIFICATION (REPETITIVE)	0:00	0:00	300	THIS REPETITIVE AD HAS BEEN TERMINATED SINCE THE ACCOMPLISHMENT OF AD NO. 2014-0048, NEW ISSUE PART II.

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	2
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive ADs	EASA AD 2020-0271 PARA 2 (ASB139-654 PART II)	ATA 62 MAIN ROTOR SWASHPLATE BOOT INSPECTION (50FH INSPECTION)	3840:46	3890:46	50	LAST DONE : 9M-BOC-14964 AJL 5241 19-FEB-23 3795:23 9M-BOC-15367 AJL 4873 03-AUG-23 3840:47
Repetitive ADs	EASA AD No.: 2019-0235 PARA (1) AND (4) - ELT TEST	ATA 25 EQUIPMENT / FURNISHINGS EMERGENCY LOCATOR TRANSMITTER INSPECTION / MODIFICATION / REPLACEMENT / TEST	03/09/2020	00/00/0000	30	LAST DONE @2770:44 FH ON 10/08/2020 IN WP-BOC-20-1411 LAST DONE @2792:56 FH ON 3/9/20 REF: WP-BOC-20-1595 PARA 5 COMPLIED, AD TERMINATED
Repetitive ADs	2018-0112R1 PART VI (BT139-450)	ATA 62 -MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION	3814:45	3914:45	100	SB139-450 REV. D DATED 28-MAY-19 TC0161/BOC PART VI REPETITIVE EVERY 100 FH LAST DONE : 9M-BOC-13586 AJL 04831 30-JAN-23 3635:35 9M-BOC-14511 AJL 05212 09-MAR-23 3727:34 9M-BOC-14927 AJL 04852 08-JUN-23 3814:45
Repetitive ADs	2018-0112R1 PART III, IV (BT139-450)	ATA 62 -MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION	-	-	0	SB139-450 REV. D DATED 28-MAY-19 PART III, IV BEFORE THE FIRST FLIGHT OF EACH DAY PRE-FLIGHT
Repetitive ADs	CF-2012-24 (P&WC SB No. A41060R5 DTD 20.1.15)	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #1)	3814:45	4414:45	600	SBA41060 REV. 5 DATED 20-JAN-15 LAST COMPLIED: 9M-BOC-7623 AJL 4474 8-Nov-21 3314:37 9M-BOC-15351 AJL 4852 08-JUN-23 3814:45

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	3
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive ADs	CF-2012-24 (P&WC SB No. A41060R5 DTD 20.1.15)	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #1)	3014:00	3914:00	900	SBA41060 REV. 5 DATED 20-JAN-15 LAST COMPLIED: 9M-BOC-7623 AJL 4474 08-NOV-21 3314:37 9M-BOC-15351 AJL 4852 08-JUN-23 3814:45
Repetitive ADs	CF-2012-24 (P&WC SB No. A41060R5 DTD 20.1.15)	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #2)	3814:45	4414:45	600	SBA41060 REV. 5 DATED 20-JAN-15 LAST COMPLIED: 9M-BOC-7623 AJL 4474 08-NOV-21 3314:37 9M-BOC-15351 AJL 4852 08-JUN-23 3814:45
Repetitive ADs	CF-2012-24 (P&WC SB No. A41060R5 DTD 20.1.15)	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #2)	2990:00	3890:00	900	SBA41060 REV. 5 DATED 20-JAN-15 LAST COMPLIED: 9M-BOC-7623 AJL 4474 08-NOV-21 3314:37 9M-BOC-15351 AJL 4852 08-JUN-23 3814:45
Repetitive ADs	EASA AD 2022-0205 (SB 139-724 REV B)	TAIL ROTOR - DAMPER BRACKET - INSPECTION (50FH/6M INSPECTION)	-	-	6	- REFER TIC-AW139-22-0224 NOT APPLICABLE DUE TO COMPONENT PART NUMBER NOT AFFECTED
Repetitive ADs	EASA AD 2022-0205 (SB 139-724 REV B)	TAIL ROTOR - DAMPER BRACKET - INSPECTION (50FH/6M INSPECTION)	-	-	50	- REFER TIC-AW139-22-0224 NOT APPLICABLE DUE TO COMPONENT PART NUMBER NOT AFFECTED
Repetitive ADs	EASA AD 2015-0226R7 CORRECTION 20 DECEMBER 2021 (SB139-	ATA 25 - EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	-	-	400	NOT APPLICABLE DUE HOIST NOT INSTALLED REFER TO WP# 9M-BOC-10123 18-APR-22

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	4
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive ADs	EASA AD 2015-0226R7 CORRECTION 20 DECEMBER 2021 (SB139-	ATA 25 - EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	-	-	6	APPLICABLE TO 9M-BOC (31289) DUE TO COMPONENT P/N. REFER TO TIC-Aw139-20-116 9M-BOC-6379 LAST DONE @ 9M-BOC-7772 AJL 4472 03-Nov-21 3311:47 NOT APPLICABLE DUE HOIST NOT INSTALLED REFER TO WP# 9M-BOC-10123 18-APR-22
Repetitive ADs	2015-0226 REV 7 PARA 3 (SB139-443 REV.A PARA III)	400HL/6M HOIST LOAD TEST - EQUIPMENT / FURNISHINGS - H	694:00	1094:00	400	AD INTEGRATED INTO 400 HOIST LIFT // 6M INSP LAST DONE : 3324:02 18-APR-22 9M-BOC-10123 (N/A DUE TO HOIST NOT INSTALLED) 3469:08 17-OCT-22 9M-BOC-11998 3783:53 13-APR-23 9M-BOC-14574
Repetitive ADs	2015-0226 REV 7 PARA 3 (SB139-443 REV.A PARA III)	400HL/6M HOIST LOAD TEST - EQUIPMENT / FURNISHINGS - H	13/04/2023	12/10/2023	6	AD INTEGRATED INTO 400 HOIST LIFT // 6M INSP LAST DONE : 3324:02 18-APR-22 9M-BOC-10123 (N/A DUE TO HOIST NOT INSTALLED) 3469:08 17-OCT-22 9M-BOC-11998 3783:53 13-APR-23 9M-BOC-14574
Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	5
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2022-0152 PARA 1 (EASB139-725 REV./ PART1	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT (BFF AND EVERY 10FH)	3535.85	-	-/COMPLIED WITH	<p>TIC-AW139-22-0157</p> <p>BEFORE NEXT FLIGHT AFTER THE EFFECTIVE DATE OF THIS AD, AND, THEREAFTER, AT INTERVALS NOT TO EXCEED 10 FH, INSPECT THE AFFECTED PART IN ACCORDANCE WITH THE INSTRUCTIONS OF SECTION 3 PART I OF THE ASB.</p> <p>FIRST COMPLIANCE (BEFORE FIRST FLIGHT) = 9M-BOC-12166 AJL 5566 13-AUG-22 3353:51</p> <p>LAST COMPLIANCE (EVERY 10 FH) = 9M-BOC-13269 AJL 04738 15-NOV-22 3535:52</p> <p>COMPLIED WITH DUE TO REPLACEMENT OF DUPLEX BEARING I.A.W. SB 139-725 PART IV</p> <p>REF: 9M-BOC-12206 (19-NOV-22)</p>

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	6
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2022-0152-E PARA (2)(SBEA 139-725 REV/PART 2)	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT(WITHIN 10FH AND EVERY 50FH)	3513.70	-	-/COMPLIED WITH	TIC-AW139-22-0157 WITHIN 10 FH AFTER THE EFFECTIVE DATE OF THIS AD, AND, THEREAFTER, AT INTERVALS NOT TO EXCEED 50 FH, INSPECT THE AFFECTED PART IN ACCORDANCE WITH THE INSTRUCTIONS OF SECTION 3 PART II OF THE ASB. FIRST COMPLIANCE (WITHIN 10 FH) = 9M-BOC-12198 AJL 5569 16-AUG-22 3356:41 LAST COMPLIANCE (EVERY 50 FH) = 9M-BOC-13268 AJL 4729 02-NOV-22 3513:43 COMPLIED WITH DUE TO REPLACEMENT OF DUPLEX BEARING I.A.W. SB 139-725 PART IV REF: 9M-BOC-12206 (19-NOV-22)
Standard ADs	EASA AD No.: 2022-0154 (SBA 139-724 REV.A)	ATA 64 - TAIL ROTOR DAMPER BRACKET INSPECTION	-	-	-/SUPERSEDED	NOT APPLICABLE DUE TO COMPONENT TAIL ROTOR DAMPER BRACKET ASSEMBLY P/N 3G6420A06131 NOT EQUIPPED ON AIRCRAFT. REFER TIC-AW139-22-0160 SUPERSEDED BY EASA AD 2022-0205
Standard ADs	EASA AD No.: 2022-0154 (SBA 139-724 REV.A)	ATA 64 - TAIL ROTOR DAMPER BRACKET INSPECTION	-	-	-/SUPERSEDED	NOT APPLICABLE DUE TO COMPONENT TAIL ROTOR DAMPER BRACKET ASSEMBLY P/N 3G6420A06131 NOT EQUIPPED ON AIRCRAFT. REFER TIC-AW139-22-0160 SUPERSEDED BY EASA AD 2022-0205

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	7
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO. 2022-0182-E, NEW ISSUE (SBEA 139-725 REV.A)	TAIL ROTOR - DUPLEX BEARINGS - INSPECTION/REPLACEMENT // ROTOR FLIGHT CONTROL - TAIL ROTOR ACTUATOR - INSPECTION/REPLACEMENT (PARA 10)	-	-	-/NOT APPLICABLE	
Standard ADs	EASA EAD NO. 2022-0209-E, NEW ISSUE (PARA 1)	HARNES INSTALLATION - FORWARD ROOF AREA - INSPECTION	-	-	-/Required	
Standard ADs	EASA AD NO 2017-0102, REV 1	HIGH PRESSURE/LOW PRESSURE FUEL PUMP METERING UNIT- INSPECTION/REPLACEMENT	-	-	-/Required	
Standard ADs	EASA AD NO. 2023-0088, NEW ISSUE	ATA 11 - PLACARDS AND MARKINGS - STRETCHER UNIT / PLACARDS - INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-23-0117 NOT APPLICABLE DUE TO AIRCRAFT NOT MODIFIED WITH EASA STC 10017231 REV. 1 AND REV. 2 OR STC EASA.R.S.01403 (INSTALLATION OF 3-STRECTHER KIT P/N 139084-501)
Standard ADs	AD NO. 2023-0101, NEW ISSUE (ASB 139-734)	ATA 25 - EQUIPMENT/FURNISHINGS LIFE RAFT INFLATION SYSTEM REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TIC-AW139-23-0150 NOT APPLICABLE DUE TO AIRCRAFT NOT FITTED WITH LIFE RAFT.
Standard ADs	AD No.: 2023-0071-E PARA (3) (EASB 139-754 PART III)	ATA 62 MAIN ROTOR (MR) PITCH LINK UPPER ROD END ASSY INSPECTION	3783.68	-	-/COMPLIED WITH	LAST DONE : 9M-BOC-15193 AJL 05238 13-APR-23 3783:41
Standard ADs	AD No.: 2023-0071-E PARA (2) (EASB 139-754 PART I)	ATA 62 MAIN ROTOR (MR) PITCH LINK UPPER ROD END ASSY INSPECTION	-	-	-/NOT APPLICABLE	APPLICABLE FOR ITEM KEPT IN STOCK
Standard ADs	EAD NO. 2023-0071-E PARA (1) (EASB 139-754 PART I)	ATA 62 - MAIN ROTOR - PITCH LINK UPPER ROD END ASSEMBLY - INSPECTION	3776.43	-	-/COMPLIED WITH	LAST DONE : 9M-BOC-15127 AJL 05230 01-APR-23 3776:26

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	8
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2022-0209-E (SB 139-731 REV./ PART 2)	ATA 91 HARNESS INSTALLATION FORWARD ROOF AREA INSPECTION			-	-/COMPLIED WITH Inspections: (1) Within 10 flight hours (FH) after the effective date of this AD accomplish a borescope inspection of the cable installation inside the forward cabin roof ceiling, in accordance with the instructions of section 3 PART I of the ASB. (2) Within 25 FH after the effective date of this AD accomplish a visual inspection for damage of the cables and the diode in the forward cabin roof ceiling in accordance with the instructions of section 3 PART II of the ASB. LAST COMPLIED: 9M-BOC-13075 AJL 4715 17-OCT-22 3469:08
Standard ADs	EASA AD 2022-0209-E (SB 139-731 REV./ PART 1)	ATA 91 HARNESS INSTALLATION FORWARD ROOF AREA INSPECTION			-	-/COMPLIED WITH Inspections: (1) Within 10 flight hours (FH) after the effective date of this AD accomplish a borescope inspection of the cable installation inside the forward cabin roof ceiling, in accordance with the instructions of section 3 PART I of the ASB. (2) Within 25 FH after the effective date of this AD accomplish a visual inspection for damage of the cables and the diode in the forward cabin roof ceiling in accordance with the instructions of section 3 PART II of the ASB. LAST COMPLIED: 9M-BOC-13074 AJL 4715 17-OCT-22 3469:08
Standard ADs	EASA AD NO. 2020-0191 REV. 1 (ASB NO. 139-633 REV./)	ATA 25 - EQUIPMENT/FURNISHINGS FORWARD FACING CENTRAL SEAT(S)-REMOVAL			-	-/NOT APPLICABLE TIC-AW139-22-0151 NOT APPLICABLE DUE TO AIRCRAFT S/N NOT AFFECTED

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	9
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2015-0226 REV 7 PARA 5, 8 & 12	ATA 25- EQUIPMENT/FURNISHINGS- HOIST- TEST REPLACEMENT	-	-	-/FOR INFO ONLY	REFER TO TIC-AW139-20-116. APPLICABLE TO 9M-PMA, 9M-PMB,9M-PMD, 9M-PME, 9M-BOC, 9M-BOD. NOT APPLICABLE TO 9M-YPG & 9M-YTL DUE TO COMPONENT NOT FITTED ON AIRCRAFT.
Standard ADs	EASA AD 2021-0259 (ASB 139-686) [CORRECTION]	ATA 53 - FUSELAGE - TAIL GEARBOX FITTING INSPECTION/REPLACEMENT, ONCE REACH 3000FH, COMPLIANCE WITHIN 25FH)	3324.03	-	-/COMPLIED WITH	TIC-AW139-21-0404 LAST DONE: 9M-BOC-8898 AJL 04481 18-APR-21 3324:02
Standard ADs	EASA AD 2015-0226 REV 7 PARA 4	ATA 25-EQUIPMENT / FURNISHINGS - HOIST - TEST / REPLACEMENT	-	-	-/OPEN	TASK HAS BEEN INTERGRATED IN AIRCRAFT MAINTENANCE PROGRAM (400 HOIST LIFT / 6 MONTH).
Standard ADs	EASA AD 2015-0226, REV 7 PARA 11	ATA 25-EQUIPMENT/FURNISHINGS-HOIST-TEST/REPLACEMENT	-	-	-/OPEN	REFER TO TIC-AW139-20-116. APPLICABLE TO 9M-PMA, 9M-PMB,9M-PMD, 9M-PME, 9M-BOC, 9M-BOD. NOT APPLICABLE TO 9M-YPG & 9M-YTL DUE TO COMPONENT NOT FITTED ON AIRCRAFT. COMPLY IF A PARTIAL PEEL OUT OCCURS, BEFORE NEXT FLIGHT, REMOVE OR DEACTIVATE THE HOIST OR, BEFORE NEXT HOIST OPERATION, REPLACE THE HOIST WITH A SERVICEABLE HOIST, AS DEFINED IN TABLE 2 OF THIS AD.
Standard ADs	EASA AD NO. 2015-0226, REV 5 (PARA I, II, VI, IX & X)	ATA 25-EQUIPMENT / FURNISHINGS- HOIST-TEST/REPLACEMENT	-	-	-/COMPLIED WITH	APPLICABLE TO 9M-PMA (31807), 9M-PMB- (31726), 9M-PMD (31809), 9M-PME (31855), 9M-BOC (31289) & 9M-BOD (312191) DUE TO COMPONENT P/N. NOT APPLICABLE TO 9M-YPG (41356) & 9M-YTL (41358) DUE TO COMPONENT NOT FITTED ON AIRCRAFT.REFER TO TIC-AW139-20-116. COMPLIED WITH DURING OVERHAUL
Standard ADs	EASA AD 2021-0044 REV 1 PARA (1) (ASB139-661 REV B)	ATA 24 OVERHEAD PANEL INSPECTION	-	-	-/Complied With	
Standard ADs	**EASA AD 2021-0259 PARA 1 (ASB 139-686 PART I)	ATA 53 - TAIL GEAR BOX FITTING INSPECTION (TGB FITTING LESS THAN 3000FH)	-	-	-/NOT APPLICABLE	

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	10
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2021-0186 REV. 1 [CORRECTION]	ATA 25 - EQUIPMENT/FURNISHINGS - EXTERNAL HOIST ASSEMBLY - RATED LOAD CHECK	-	-	-/NOT APPLICABLE	APPLICABILITY: NOT APPLICABLE DUE TO AFFECTED COMPONENT NOT FITTED ON AIRCRAFT. AIRCRAFT FITTED DIFFERENT MODEL TYPE HOIST (GOODRICH). PLEASE REFER TO TIC-AW139-21-0271
Standard ADs	EASA AD 2021-0121, NEW ISSUE (ASB 139-609)	ATA 63 MAIN ROTOR DRIVE MAIN GEARBOX BEARING LOCK NUT REPLACEMENT	0.00	28000.00	-/TO BE COMPLIED	TIC-AW139-21-0228 APPLICABLE DUE TO AFFECTED MGB PN 3G6320A00135 FITTED ON AIRCRAFT. COMPLIANCE: WITHIN 2000 LANDING UPON REACHING 26000 LANDINGS OR AT NEXT OVERHAUL, WHICH OCCURS FIRST.
Standard ADs	EASA AD 2021-0121, NEW ISSUE (ASB 139-609)	ATA 63 MAIN ROTOR DRIVE MAIN GEARBOX BEARING LOCK NUT REPLACEMENT	0.00	5000.00	-/TO BE COMPLIED	TIC-AW139-21-0228 APPLICABLE DUE TO AFFECTED MGB PN 3G6320A00135 FITTED ON AIRCRAFT. COMPLIANCE: WITHIN 2000 LANDING UPON REACHING 26000 LANDINGS OR AT NEXT OVERHAUL, WHICH OCCURS FIRST.
Standard ADs	EASA AD 2021-0095	ATA 11 - PLACARDS AND MARKINGS - STRETCHER UNIT/PLACARD - INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0209 COMPLIANCE: NOT APPLICABLE DUE TO COMPONENT 3-STRETCHER KIT P/N 139084-5001 NOT EQUIPPED ON AIRCRAFT
Standard ADs	EASA AD 2021-0054 (ASB 139-648 AND ASB 139-662)	ATA 25 - EQUIPMENT / FURNISHINGS - LIFE RAFT RESERVOIR AND ACTUATOR CABLE - REPLACEMENT / INSPECTION.	-	-	-/NOT APPLICABLE	TIC-AW139-21-0032 NOT APPLICABLE DUE TO COMPONENT EMERGENCY FLOATATION KIT P/N 4G9560F00111 OR P/N 4G9560F00211 NOT FITTED ON AIRCRAFT THE APPLICABLE SB: NOT APPLICABLE TO ASB 139-648 AND ASB 139-662
Standard ADs	EASA AD 2020-0271 PARA (1) (SBA 139-654 REV./ PART I)	ATA 62 MAIN ROTOR SWASHPLATE BOOT INSPECTION	-	-	-/COMPLIED WITH	
Standard ADs	EASA AD 2020-0011, REVISION 1	ATA 63 - MAIN GEAR BOX - BEARING LOCK NUT - REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2021-0121

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	11
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2020-0011, NEW ISSUE	ATA 63 - MAIN GEAR BOX - BEARING LOCK NUT - REPLACEMENT	-	-	-/NOT APPLICABLE	<p>REFER TIC-AW139-20-006 DATE ISSUE 30 JANUARY 2020.</p> <p>NOT APPLICABLE TO 9M-BOC S/N 31289 DUE TO COMPONENT MGB LOCK NUT P/N 3G6320A09152 ALREADY FITTED ON AIRCRAFT.</p> <p>COMPLIANCE: WITHIN 2000 LANDINGS AFTER ACCUMULATING 26000 LANDINGS, OR DURING THE NEXT MGB OVERHAUL, WHICHEVER OCCURS FIRST AFTER THE EFFECTIVE DATE OF THIS AD.</p> <p>THIS TIC IS IN CONJUNCTION WITH TIC-AW139-19-126(SBA NO 139-609).</p>
Standard ADs	EASA AD 2020-0185, NEW ISSUE	ATA 25- EQUIPMENT/ FURNISHINGS- LIFE RAFT RESERVOIR AND ACTUATOR CABLE- REPLACEMENT/ INSPECTION	-	-	-/SUPERSEDED	<p>NOT APPLICABLE TO 9M-PMA (SN 31807), 9M-PMB (31726), 9M-PMC (SN 31731), 9M-PME (31855), 9M-YPG (SN 41356), 9M-YTL (SN 41358), 9M-BOC (SN 31289) & 9M-BOD (SN 31291) DUE TO AFFECTED FLOATATION SYSTEM (P/N 4G9560F00111 OR P/N 4G9560F00211 NOT INSTALLED ON RESPECTIVE AIRCRAFT CHART-A EQUIPMENT LIST FOR INDIVIDUAL AIRCRAFT REFERRED AS REFERENCE. REFER TO TIC-AW139-20-127</p> <p>SUPERSEDED BY EASA AD 2021-0054</p>
Standard ADs	EASA AD 2020-0131 (SBA 139-637)	ATA 25 HOIST CABLE CUTTER FRAME INSTALLATION			-/COMPLIED WITH	<p>TIC-AW139-20-004</p> <p>LAST DONE 2853:49 FH ON 06/11/2020 REF: WP-BOC-20-1116</p>

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	12
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO. 2020-0013 (SB 139-614)	ATA 26 - FIRE PROTECTION - HAND-HELD FIRE EXTINGUISHERS - REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-007 DATE ISSUE 30 JANUARY 2020. NOT APPLICABLE DUE TO COMPONENT PART NUMBER NOT AFFECTED. COMPLIANCE: REPLACEMENT: DURING NEXT SCHEDULED ANNUAL INSPECTION OF AFFECTED PART OR WITHIN 4 MONTHS AFTER THE EFFECTIVE DATE OF THIS AD, WHICHEVER OCCUR LATER.
Standard ADs	EASA AD 2019-0311, NEW ISSUE (SBA NO. 139-610, NEW ISSU	ATA 25, 95 EQUIPMENT / FURNISHINGS, EMERGENCY FLOTATION SYSTEM INFLATION HOSES INSPECTION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0073
Standard ADs	EASA AD NO 2019-0174 PARA 1 (BT 139-567 REV A)	ATA 63 - MAIN ROTOR DRIVE - MAIN GEARBOX BEARING LOCK NUT - REPLACEMENT	0.00	6045.00	-/OPEN	SB139-567 Rev. A dated 5-Jul-19 Compliance of AD2019-0174 will be carried out at next overhaul
Standard ADs	2019-0149	ATA 71 POWERPLANT ENGINE MOUNTING RODS REPLACEMENT	-	-	-/NOT APPLICABLE	SB139-593 DATED 11-JUN-19 NOT APPLICABLE DUE TO ENGINE MOUNTING ROD ASSY. P/N & S/N CLOSED PE NO. PE139- 0083/BOC
Standard ADs	AD NO. 2019-0149, NEW ISSUE	POWERPLANT - ENGINE MOUNTING RODS - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0072
Standard ADs	2019-0073	ATA 64 -TAIL ROTOR - FULL ICE PROTECTION SYSTEM TAIL ROTOR BLADES - INSPECTION	-	-	-/NOT APPLICABLE	SB139-580 DATED 19-MAR-19 NOT APPLICABLE DUE TO EQUIPMENT NOT INSTALLED CLOSED PE NO. PE139- 0065/BOC
Standard ADs	AD NO. 2019-0073, NEW ISSUE	TAIL ROTOR - FULL ICE PROTECTION SYSTEM TAIL ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0071
Standard ADs	2019-0036	ATA 63 -MAIN ROTOR DRIVE - MAIN GEARBOX BEARING LOCK-NUT - REPLACEMENT	-	-	-/SUPERSEDED	SB139-567 DATED 14-FEB-19 SUPERSEDED WITH AD2019- 0174 DATED 18-JUL-19
Standard ADs	2019-0022	ATA 64 - TAIL ROTOR - DUPLEX BEARINGS REPLACEMENT	2432.70	-	-/COMPLIED WITH	SB139-571 DATED 1-FEB-19 CLOSED TC NO. 0052/BOC
Standard ADs	AD NO. 2019-0022, NEW ISSUE	TAIL ROTOR - DUPLEX BEARINGS - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0070

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	13
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2018-0292 (ASB 139-569 REV B)	ATA 64 - TAIL ROTOR - TAIL ROTOR SLIDER ASSEMBLY - INSPECTION	2446.30	-	-/COMPLIED WITH	TIC-AW139-22-0155 PART I: - BEFORE EXCEEDING TWENTY-FOUR-HUNDRED-AND-FIFTY (2450) FH IF THE SLIDER ASSY HAS NOT LOGGED MORE THAN TWENTY-FOUR-HUNDRED (2400) FH AT THE ISSUE DATE OF THIS SERVICE BULLETIN. - EVERY ONE (1) YEAR AFTER FIRST ACCOMPLISHMENT OF PART I, ONLY IF DURING THE INSPECTION SIGNS OF REFINISHING ARE FOUND. PART II: IMMEDIATELY AFTER COMPLIANCE WITH PART I, IF EVIDENCE OF CORROSION IS FOUND DURING THE INSPECTION. COMPLIED BY AIROD: 07-MAR-19 REF: TASK CARD NO. 0068/BOC
Standard ADs	2018-0292	ATA 64 -TAIL ROTOR - TAIL ROTOR SLIDER ASSEMBLY - INSPECTION	07/03/2019	-	-/COMPLIED WITH	SB139-57 DATED 1-FEB-19 CLOSED TC NO. 0052/BOC
Standard ADs	AD NO. 2018-0292, NEW ISSUE	TAIL ROTOR - TAIL ROTOR SLIDER ASSEMBLY - INSPECTION	-	-	-/COMPLIED WITH	TIC-AW139-21-0069 REF: TC0068/BOC, 07.03.2019

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	14
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	AD NO. 2018-0208, NEW ISSUE	EMERGENCY FLOTATION SYSTEM - AFT FLOAT ASSEMBLY INFLATION	-	-	-/COMPLIED WITH	TIC-AW139-21-0068 COMPLIED WITH, DUE AIRCRAFT ALREADY FITTED WITH SERVICEABLE PART AS DEFINED IN THE AD. 3G9560V1432 S/N 145: REFER ARC #865.200407 3G9560V1532 S/N 415: REFER ARC #864.200407 JBPM FLOATING EFS: 3G9560V1532 S/N 143: REFER ARC #803.191106 3G9560V1432 S/N 412: REFER W/O NO. ML581
Standard ADs	2018-0208	ATA 95 -EMERGENCY FLOTATION SYSTEM - AFT FLOAT ASSEMBLY INFLATION SYSTEM - REMOVAL /	15/11/2018	-	-/COMPLIED WITH	CLOSED REF. ARC # 588.181115 SB139-533 DATED 30-AUG-18
Standard ADs	2018-0132	ATA 5 -TIME LIMITS / MAINTENANCE CHECKS - AIRWORTHINESS LIMITATION SECTION - AMENDMENT /	15/11/2018	-	-/COMPLIED WITH	CLOSED IETP ISSUE 33 DATED 12-APR- 19
Standard ADs	AD NO. 2018-0130, NEW ISSUE	MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0066
Standard ADs	2018-0130	ATA 62 -MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION	-	-	-/NOT APPLICABLE	SB139-520 DATED 26- APR-18 NOT APPLICABLE DUE TO MR BLADE S/N NOT AFFECTED CLOSED PE NO. PE139- 0008/BOC
Standard ADs	2018-0112R1 PART I, II, V,VII,VIII	ATA 62 -MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION	-	-	-/COMPLIED WITH	COMPLIED ON PI -11/5/16 PII -11/5/16 PV 11/5/16 PVII- 17/5/16 PVIII-12/5/16 CLOSED DR NO. 1109, 1110, 1112,1680 1115, 1113/BOC
Standard ADs	2018-0112	-	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2018- 0112

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	15
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	AD NO. 2018-0002, NEW ISSUE	INFORMATION SYSTEMS - "PRIMUS EPIC" SYSTEM SOFTWARE - SOFTWARE UPDATE	-	-	-/NOT APPLICABLE	TIC-AW139-21-0064
Standard ADs	2018-0002	ATA 46 -INFORMATION SYSTEMS - PRIMUS EPIC" SYSTEM SOFTWARE - SOFTWARE UPDATE"	-	-	-/NOT APPLICABLE	SB139-500 DATED 31-OCT-17 NOT APPLICABLE DUE TO PRIMUS EPIC SOFTWARE RELEASE 5 INSTALLED
Standard ADs	EASA AD 2017-0124 REV. 1	ATA 05 - TIME LIMITS / MAINTENANCE CHECK - AIRWORTHINESS LIMITATION SECTION - AMENDMENT / IMPLEMENTATION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2018- 0132
Standard ADs	AD NO. 2017-0175-E, NEW ISSUE	MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0063
Standard ADs	2017-0175-E	ATA 62 -MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	SB139-508 DATED 12-SEP-17 NOT APPLICABLE DUE TO MR BLADE S/N NOT AFFECTED DR NO. 1537/BOC DTD 14-SEP-17
Standard ADs	EASA AD 2017-0083 (SB 139-472 REV. /)	ATA 62 - MAIN ROTOR - MAIN ROTOR SLIP RING - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO AIRCRAFT NOT FITTED WITH FIPS KIT. REFER TIC-AW139-21-0062
Standard ADs	2017-0028-E	ATA 62 - MAIN ROTOR - ROTATING SCISSORS - INSPECTION / REPLACEMENT	28/04/2017	-	-/COMPLIED WITH	SB139-392 REV. A DATED 14-FEB-17 COMPLIED ON 28-APR-17 1918.50 FH DR NO. 1407/BOC
Standard ADs	2011-0205R1	-	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017- 0124R1 COMPLIED WITH (DR NO: 050/BOC) @461.10 HRS
Standard ADs	2017-0011	ATA 65 -TAIL ROTOR - TAIL ROTOR DRIVE SHAFT - INSPECTION / MODIFICATION	-	-	-/NOT APPLICABLE	SB139-465 REV. A DATED 25-JAN-17 NOT APPLICABLE DUE TO HC S/N NOT AFFECTED
Standard ADs	AD NO. 2017-0011, NEW ISSUE	TAIL ROTOR DRIVE SHAFT - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0060
Standard ADs	2016-0255R1	ATA 63 -MAIN ROTOR DRIVE - MAIN GEARBOX INPUT MODULE - REPLACEMENT	-	-	-/NOT APPLICABLE	SB139-303 DATED 20-SEP-16 NOT APPLICABLE DUE TO COMP. S/N NOT AFFECTED
Standard ADs	AD NO. 2016-0255, REVISION 1	MAIN ROTOR DRIVE - MAIN GEARBOX INPUT MODULE - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0059
Standard ADs	AD NO. 2016-0246, NEW ISSUE	TAIL ROTOR DRIVE - TAIL GEARBOX CENTRAL HOUSING - DIMENSIONAL CHECK / REPLACEMENT	0.00	7500.00	-/TO BE COMPLIED	TIC-AW139-21-0058
Standard ADs	2016-0246	ATA 65 -TAIL ROTOR DRIVE - TAIL GEARBOX CENTRAL HOUSING - DIMENSIONAL CHECK / REPLACEMENT	0.00	7500.00	-/OPEN	SB139-274 DATED 14-SEP-16 PART I - FIRST RETURN TO SERVICE STATION FOR TGB OVERHAUL OR REPAIR DUE AT 7500:00 FH

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	16
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	2016-0140	-	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017- 0160
Standard ADs	AD NO. 2016-0077, NEW ISSUE	LANDING GEAR - MAIN LANDING GEAR SHOCK ABSORBER SCREWS - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0057
Standard ADs	AD NO. 2015-0172, NEW ISSUE	LANDING GEAR - EMERGENCY FLOTATION SYSTEM CONTROL PANEL - REPLACEMENT	-	-	-/COMPLIED WITH	TIC-AW139-21-0056 REFER DR 1240/BOC
Standard ADs	AD NO. 2015-0155, NEW ISSUE	ICE AND RAIN PROTECTION - FULL ICE PROTECTION SYSTEM TAIL ROTOR SLIP RING - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0055
Standard ADs	AD NO. 2014-0172, NEW ISSUE	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM / CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT / AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND REPETITIVE CHECK / AC GENERATOR CONTROL UNIT REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0054
Standard ADs	AD NO. 2014-0048, NEW ISSUE PART II	ATA 53 FUSELAGE - SUBFLOOR FRAME STA 2105 INSPECTION / MODIFICATION PART II	2282.90	-	-/COMPLIED WITH	AD HAS BEEN COMPLIED. PLEASE REFER TO DR 1710/BOC (01/08/18)
Standard ADs	AD NO. 2014-0048, NEW ISSUE PART I	ATA 53 FUSELAGE - SUBFLOOR FRAME STA 2105 INSPECTION / MODIFICATION	13/03/2014	-	-/COMPLIED WITH	AD HAS BEEN COMPLIED. PLEASE REFER TO DR 634/BOC (10/03/14) FOR TASK COMPLETION
Standard ADs	AD NO. 2014-0048, NEW ISSUE PART I	ATA 53 FUSELAGE - SUBFLOOR FRAME STA 2105 INSPECTION / MODIFICATION	1119.10	-	-/COMPLIED WITH	AD HAS BEEN COMPLIED. PLEASE REFER TO DR 634/BOC (10/03/14) FOR TASK COMPLETION
Standard ADs	AD NO. 2012-0076, REVISION 2 (PART II))	TAIL ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	NOT APPLICABLE DUE TO FITTED WITH SERVICEABLE T/R BLADE WITH PN: 3G6410A00133 PLEASE REFER TO TIC-AW139-21-0052
Standard ADs	AD NO. 2012-0076, REVISION 2 (PART I)	TAIL ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/COMPLIED WITH	AD HAS BEEN CARRIED OUT WITH REFERENCE TO DR 644/BOC (04/11/13) PLEASE REFER TO TIC-AW139-21-0052
Standard ADs	AD NO. 2013-0177, NEW ISSUE	HYDRAULIC POWER - FLEXIBLE HYDRAULIC HOSES - REPLACEMENT	1062.10	-	-/COMPLIED WITH	REFER DR 543/BOC. TIC-AW139-21-0051
Standard ADs	AD NO. 2010-0237-CN, NEW ISSUE	CANCELLED: EQUIPMENT / FURNISHINGS - SPECTROLAB NIGHTSUN XP SEARCHLIGHT - INSPECTION / REMOVAL / REPLACEMENT	-	-	-/FOR INFO ONLY	TIC-AW139-21-0050
Standard ADs	AD NO. 2012-0262, NEW ISSUE	LANDING GEAR - NOSE LANDING GEAR ARM PIN INSTALLATION -	760.30	-	-/COMPLIED WITH	REFER DR 290/BOC. TIC-AW139-21-0049
Standard ADs	AD NO. 2012-0213-E, NEW ISSUE	FLIGHT CONTROL - COLLECTIVE AND CYCLIC CONTROL SYSTEM - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0048

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	17
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	2012-0030	TAIL ROTOR- TAIL ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	COMPLIED WITH PT 2 ONLY (DR NO : 105/BOC) @ 599.60 HRS SUPERSEDED BY EASA AD 2012-0076
Standard ADs	AD NO. 2011-0226-E, NEW ISSUE	FLIGHT CONTROL - COLLECTIVE CONTROL SYSTEM - INSPECTION / INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0047
Standard ADs	2011-0226-E	FLIGHT CONTROL - COLLECTIVE CONTROL SYSTEM - INSPECTION / INSTALLATION	03/12/2011	-	-/COMPLIED WITH	COMPLIED WITH (DR NO: 052/BOC) @ 461.10 HRS
Standard ADs	AD NO. 2011-0207, NEW ISSUE	HYDRAULIC POWER - HYDRAULIC SYSTEMS - OPERATIONAL CHECKS / REPLACEMENT	495.80	-	-/COMPLIED WITH	TIC-AW139-21-0046 REFER DR 059/BOC.
Standard ADs	2011-0207	HYDRAULIC POWER - HYDRAULIC SYSTEMS - OPERATIONAL CHECKS / REPLACEMENT	03/11/2011	-	-/COMPLIED WITH	COMPLIED WITH (DR NO: 042/BOC) @ 449.00 HRS
Standard ADs	2011-0156-E	TAIL ROTOR - TAIL ROTOR BLADES - INSPECTION / REPLACEMENT (REDUCED LIFE LIMITATION)	-	-	-/SUPERSEDED	COMPLIED WITH PT1 ONLY (DR NO: 008/BOC) @365.50 HRS SUPERSEDED BY EASA AD 2012-0030
Standard ADs	AD NO. 2011-0140, NEW ISSUE	PRIMUS EPIC HARNESSSES SOLDER SPLICES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0045
Standard ADs	AD NO. 2011-0019, NEW ISSUE PART 4	TAI BOOM - INSPECTION / MODIFICATION	-	-	-/COMPLIED WITH	TIC-AW139-21-0044
Standard ADs	AD NO. 2011-0019, NEW ISSUE PART 1, 2, 3	TAIL BOOM - INSPECTION / MODIFICATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0044
Standard ADs	AD NO. 2010-0189, NEW ISSUE	NAVIGATION - MODULAR AVIONIC UNIT - INSPECTION / REPLACEMENT / MODIFICATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0043
Standard ADs	2009-0183-CN	CANCELLATION NOTICE: EQUIPMENT/FURNISHING - D -LOCK HOOK OF THE RESCUE HOIST	-	-	-/NOT APPLICABLE	COMPLIANCE: NOT APPLICABLE. CANCELLATION NOTICE.
Standard ADs	AD NO. 2009-0042, NEW ISSUE	ELECTRICAL POWER - GENERATOR CONTROL UNIT (GCU) - REPLACEMENT	-	-	-/COMPLIED WITH	TIC-AW139-21-0041
Standard ADs	AD NO. 2008-0148, NEW ISSUE	FUSELAGE - WIRE STRIKE PROTECTION SYSTEM (WSPS) TOP CABLE CUTTER - REWORK / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0040
Standard ADs	EASA AD 2008-0108	ATA 56 - WINDOWS - COCKPIT DOOR WINDOWS - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0305 NOT APPLICABLE BY AIRCRAFT S/N
Standard ADs	EASA AD NO 2006-0360-E	ATA 78 - EXHAUST - TAILPIPE ASSEMBLY - INSPECTION/REPAIR/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0039 NOT APPLICABLE DUE TO HELICOPTER NOT FITTED WITH KIT TAILPIPE ASSEMBLIES PN 3G7800L00131 AND 3G7800L00231

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	18
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	AD 2022-0182-E PARA (3), (SBEA 139-725 REV.A PART III)	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT (DUPLEX BEARING > 2400FH)	-	-	-/NOT APPLICABLE	TIC-AW139-22-0157 NOT APPLICABLE DUE TO COMPONENT TAIL ROTOR DUPLEX BEARING P/N 3G6430V00153 HAS NOT LOGGED 2390 FH OR MORE.
Standard ADs	AD 2022-0182-E PARA (7), (SBEA 139-725 REV.A PART IV)	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT	3356.68	-	-/COMPLIED WITH	TIC-AW139-22-0157 APPLICABLE TO ALL DUPLEX BEARINGS P/N 3G6430V00151, P/N 3G6430V00152 OR P/N 3G6430V00153 THAT HAVE LESS THAN 2400 FH AND THAT HAVE BEEN REMOVED AND REINSTALLED ON SLIDING CONTROL ASSEMBLY P/N 3G6430A02531 LAST COMPLIED: 9M-BOC-12206 AJL 04740 19-NOV-22 3542:37
Standard ADs	EASA AD NO 2009-0251-E	FIRE PROTECTION - PORTABLE FIRE EXTINGUISHER - IDENTIFICATION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0306 NOT APPLICABLE DUE TO FIRE EXTINGUISHERS INSTALLED ON HELICOPTER ARE NOT AFFECTED BY THIS AD.
Standard ADs	EASA AD NO 2009-0262R1	FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHER - IDENTIFICATION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0307 NOT APPLICABLE. AFFECTED PN NOT FITTED IN AC.
Standard ADs	AD NO. 2022-0287, NEW ISSUE	SEAT BELT RESTRAINT SYSTEM - INSPECTION	-	-	-/NOT APPLICABLE	TIC-GEN-22-0024
Standard ADs	AD NO. 2022-04-09, NEW ISSUE	OXYGEN CYLINDER AND VALVE ASSEMBLIES AND OXYGEN VALVE ASSEMBLIES	-	-	-/NOT APPLICABLE	TIC-GEN-22-0057
Standard ADs	AD NO. 2022-01-03, NEW ISSUE	UMLAUT ENGINEERING GMBH (PREVIOUSLY P3 ENGINEERING GMBH) HAFEX (HALON-FREE) HAND-HELD FIRE EXTINGUISHERS	-	-	-/NOT APPLICABLE	TIC-GEN-22-0039
Standard ADs	AD NO. 2022-03-15, NEW ISSUE	FUEL QUANTITY INDICATOR	-	-	-/NOT APPLICABLE	TIC-GEN-22-0045
Standard ADs	AD NO. 2022-0024, NEW ISSUE	FLIGHT MANAGEMENT COMPUTER 2 / NAVIGATION MODULES - OPE	-	-	-/NOT APPLICABLE	NOT APPLICABLE. GAM CAMO FLEET NOT EQUIPPED WITH FMC2 NAVM P/N: C13084CA03 REFER TIC-GEN-22-0042

ADS AIRWORTHINESS DIRECTIVES (AD'S) STATUS LIST

Aircraft Registration:	9M-BOC	Serial No:	31289	Date:	21/08/2023	Page No:	19
Aircraft Hours:	3868:25	Landings:	7178.00	Engine 1:	3868:25	Engine 2:	3868:25

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2007-0156	COMMUNICATION - COMM UNITS & TRANSPONDERS - MODIFICATION/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0303. NOT APPLICABLE DUE TO MODE S TRANSPONDER INSTALLED ON AIRCRAFT IS NOT AFFECTED BY THIS AD.
Standard ADs	AD NO. G-2021-003, NEW ISSUE	LIFE JACKET - INSPECTION	-	-	-/NOT APPLICABLE	TIC-GEN-21-0137
Standard ADs	EAD NO. G-2021-0010-E, NEW ISSUE	FUEL - CYLINDER QUICK SHUT-OFF VALVE MOUNTING FLANGE - INSPECTION/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-GEN-21-0220
Standard ADs	AD NO. G-2021-0004, NEW ISSUE	LIFE RAFT - INSPECTION	-	-	-/NOT APPLICABLE	TIC-GEN-21-0150
Standard ADs	EASA AD NO. 2021-0185, REVISION 2	HAFES (HALON-FREE) HAND-HELD FIRE EXTINGUISHERS	-	-	-/NOT APPLICABLE	TIC-GEN-21-0194
Standard ADs	AD NO. 2019-0183-CN, NEW ISSUE	D-LOK HOOK OF THE RESCUE HOIST - INSPECTION / REMOVAL FROM SERVICE / REPLACEMENT	-	-	-/FOR INFO ONLY	TIC-AW139-21-0042
Standard ADs	EASA AD No.: 2019-0235 PARA (5) - ELT MODIFICATION	ELT ARTEX TO REPLACE (G-SWITCH TO UPGRADE)	30/09/2020	-	-/COMPLIED WITH	LAST DONE @2825:52 FH ON 30/09/2020 REF: WP-BOC-20-1484
Standard ADs	EASA SIB 2019-09 R1	1Y INSP ELT & PLB ANNUAL TEST	-	-	-/Required	
Standard ADs	EASA SIB NO. 2021-14, NEW ISSUE	HAND-OPERATED FIRE EXTINGUISHERS - REMOVAL FROM SERVICE	-	-	-/Required	
Standard ADs	AD NO. 2007-0256-CN, NEW ISSUE	ATA 25 - EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION / REPLACEMENT	-	-	-/CANCELLED	TIC-AW139-21-0304 NOT APPLICABLE DUE AD CANCELLED