

No. AS350-05.00.92

1. PLANNING INFORMATION

1.A. EFFECTIVITY

1.A.1. Helicopters/installed equipment or parts

For all AS350 helicopter versions PRE MOD 0720049.

NOTE 1

Refer to the Individual Inspection Log Book (RIC AMS) and/or Aircraft Log Book to identify the current modification status of the helicopter.

NOTE 2

The MOD 0720049 consists in improve of MGB suspension bar fitting assembly and can be comply through the Service Bulletin No. 53.00.65.

1.A.2. Non-installed equipment or parts

Not applicable.

1.B. ASSOCIATED REQUIREMENTS

Not applicable.

1.C. REASON

Revision 0:

Following an inspection during a scheduled maintenance on a T2 version, EC130 helicopter, the absence of a MGB suspension bar attachment bracket screw head was noticed.

The current maintenance program does not specify clearly the check of this attachment screw heads presence. In addition, more than half of the screw heads are difficult to inspect due to various structural elements.

Consequently, Airbus Helicopters has introduced a visual check of all the MGB suspension bar attachment bracket screws.

Compliance with this Alert Service Bulletin is mandatory. (Except paragraph 3.D.)

Revision 1:

The purpose of the revision 1 of this ALERT SERVICE BULLETIN is to exclude of the effectivity the helicopters POST MOD 0720049.

Revision 1 of this ALERT SERVICE BULLETIN has no effect on the compliance with revision 0 of this ALERT SERVICE BULLETIN.