

1. PLANNING INFORMATION

A. EFFECTIVITY

All AB139/AW139 helicopters equipped with main rotor swashplate boot P/N 3G6230V00251.

NOTE

Helicopters from S/N 31926 onwards, from S/N 41576 onwards, from S/N 41805 onwards and the S/Ns listed in table 1 are not affected by Part I of this Service Bulletin, unless the boot P/N 3G6230V00251 has been replaced in service.

NOTE

Refer to Figure 1 and to Figure 2 to identify the boot P/N 3G6230V00251.

HELICOPTERS S/Ns					
31789	31838	31900	31906	31916	31923
31792	31840	31901	31907	31917	31924
31800	31843	31902	31911	31919	41562
31803	31895	31903	31912	31920	41563
31814	31896	31904	31914	31921	41568
31836	31899	31905	31915	31922	41570
41573			41574		

Table 1

B. COMPLIANCE

Part I:

Within twenty-five (25) FH after the issue date of this Service Bulletin or within twenty-five (25) FH after the first installation on the helicopter for MR boot kept in stock.

Part II:

Every fifty (50) FH after compliance with Part I of this Service Bulletin or after the issue date of this Service Bulletin for those helicopters for which the Part I is not applicable.