



Prerequisite inspection and evaluation

Item	Description	Correction	Mec+ Mo	Insp
10	Main rotor: Absorber vibration check with STEADY Control (30) iaw AMM 53-37-00,5-2	Not necessary - Autopilot installation	DIE	S/O
11	Airworthiness review			
12	Physical review: check if carried out (recommended pictures if possible) of items listed on the document "F-HJYP - Physical airworthiness review "	10/07/2017	NVO	S/O

Certification personnel de soutien
(liste référencée ENR RQ 020 dernière version)

The maintenance described above has been performed in accordance with the applicable standards of airworthiness and all tasks and inspection sheet have been signed-off.

Subject to satisfactory test flight:		Yes	No
			X
B1		B2	
Date	Trigramme et signature	Date	Trigramme et signature
2 5 JUL. 2017	 SBY/11 FR.145.626	2 5 JUL. 2017	 LC1/98 FR.145.0626

<u>REGISTRATION</u> F- HJYP	<u>Physical airworthiness review</u>	<u>WORK ORDER #</u> HFA/1
--------------------------------	--------------------------------------	------------------------------

<u>Item</u>	<u>Number</u>	<u>Designation</u>	<u>Comment</u>	<u>Pictures</u>
<u>1</u>	AD 2007-0311	Braid bonding seat	Applied	X
<u>2</u>	AD 2015-0020	Sliding door star support	Applied	X
<u>3</u>	AD F-2006-040	Spherical thrust bearing	sn not concerned	X
<u>4</u>	AD 2011-0182R1	P3 Air pipe	TF not applied, clearance check	X
<u>5</u>	AD 2016-0041	FCU TF77	Applied	X
<u>6</u>	ASB 05A008	Seat belts	Applied	X
<u>7</u>	ASB 24A012	Emergency Switch	Applied with STC Inaer	
<u>8</u>	ASB 52A018	Reinforcement door mechanism	Applied	X
<u>9</u>	SB 76-007	Twist grip locking pin	Not Applied	X
<u>10</u>	SB 31-006	Warning panel	Applied	X
<u>11</u>	SB 31-009	ASU card n°1	Not Applied	X
<u>12</u>	IN 2772-1-67	Spring anchor hole collective pitch lever	Concerned- Repaired during retrofit	X
<u>13</u>	SB 319 73 4081	Adjusted cover	Applied	X
<u>14</u>	SB 319 75 4810	Clearance P3 Air pipe	See item 4	

Checked by: E. NAVARRO

Date: 10-juil-17

Signature

