

Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	1
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
ADs				<u>'</u>		
Types	AD Number	Subject	Last Done	Next Due	Interval	Limitation Notes
Repetitive ADs	EASA AD No.: 2022-0205 (SB 139-724 REV B)	TAIL ROTOR - DAMPER BRACKET - INSPECTION	28/02/2023	28/08/2023	6	
Repetitive ADs	EASA AD No.: 2022-0205 (SB 139-724 REV B)	TAIL ROTOR - DAMPER BRACKET - INSPECTION	1647:10	1697:10	50	
Repetitive ADs	EASA AD 2022-0182-E PARA 1 (SBEA 139-725 REV. A PART I)	TAIL ROTOR - DUPLEX BEARINGS - INSPECTION/REPLACEMENT // ROTOR FLIGHT CONTROL - TAIL ROTOR ACTUATOR - INSPECTION/REPLACEMENT	1650:10	1660:10	10	
Repetitive ADs	EASA AD 2015-0226R7 CORRECTION 20 DECEMBER 2021 (SB139-	ATA 25 - EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	-	-	0	
Repetitive ADs	EASA AD 2021-0044 REV 1 PARA (2) (ASB139-661 REV. B)	ATA 24 OVERHEAD PANEL INSPECTION 300H/12M REPETITIVE PART II COMPLIANCE	09/01/2023	09/01/2024	12	TIC-AW139-22-0120 DATED 13 MAY 2022 LAST DONE REFER FROM 9M-PMA-5801 @ 826:30 FH ON 10/02/2021 (AJL 03717): PART 1 SB, PARA 1 AD 9M-PMA-10005 @ 1347:55 FH ON 26/03/2022 (AJL 00021)
Repetitive ADs	EASA AD 2021-0044 REV 1 PARA (2) (ASB139-661 REV. B)	ATA 24 OVERHEAD PANEL INSPECTION 300H/12M REPETITIVE PART II COMPLIANCE	1581:47	1881:47	300	TIC-AW139-22-0120 DATED 13 MAY 2022 PART II: APPLICABLE DUE TO AIRCRAFT TYPE LAST DONE REFER FROM 9M-PMA-5801 @ 826:30 FH ON 10/02/2021 (AJL 03717): PART 1 SB, PARA 1 AD 9M-PMA-10005 @ 1347:55 FH ON 26/03/2022 (AJL 00021)
Repetitive ADs	EASA AD 2020-0271 PARA (2) (ASB139-654 PART II	50FH - ATA 62 MAIN ROTOR SWASHPLATE BOOT INSPECTION	1647:10	1697:10		TIC-AW139-20-201 DATED 9 DECEMBER 2020 9M-PMA-9764 @ 1306:45 FH 0N 26/02/2022 (AJL 00002) 9M-PMA-10295 @ 1347:55 FH ON 23/03/2022 (AJL 00020) 9M-PMA-10657 @ 1393:45 FH ON 16/05/2022 (AJL 00047) 9M-PMA-11161 @ 1427:10 FH ON 06/06/2022 (AJL 00064) 9M-PMA-12012 @ 1493:45 FH ON 07.09.2022 (AJL 00105)



Aircraft Registration:	9M-PMA	Serial No:	31807	Date:	07/03/2023	Page No:	2
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1	1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive ADs	EASA AD 2015-0226 REV 7 PARA 7	2600HL//36M HOIST CLUCTH REPLACEMENT - ATA 25 EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	0:00	2600:00		TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT. HOIST SERIAL NUMBER: 40470 (BASED AT
						PGU KK) DUE 0N 28 NOVEMBER 2021, REFER 9M-PMA-7630, EMAIL Sep 3, 2021, 10:30 AM. PENDING OEM COMPLETION FOR CLUTCH REPLACEMENT. REFER EMAIL EN. SUMAILI WITH SOLID PARTNER (SN 40470)
Repetitive ADs	EASA AD 2015-0226 REV 7 PARA 7	2600HL//36M HOIST CLUCTH REPLACEMENT - ATA 25 EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	20/01/2022	19/01/2025		TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT. PENDING OEM COMPLETION FOR CLUTCH REPLACEMENT. REFER EMAIL EN. SUMAILI WITH SOLID PARTNER (SN 40470)
Repetitive ADs	2015-0226 REV 7 PARA 3 (SB139-443 REV.A PARA III)	400HL//6M HOIST LOAD TEST - EQUIPMENT / FURNISHINGS - H	0:00	400:00	400	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT.
Repetitive ADs	2015-0226 REV 7 PARA 3 (SB139-443 REV.A PARA III)	400HL//6M HOIST LOAD TEST - EQUIPMENT / FURNISHINGS - H	07/10/2022	07/04/2023	6	TIC-AW139-22-0124 DATED 23 MAY 2022. SN 40542 9M-PMA-8348 (AJL 04062) ON 12/10/2021 @ 1158:00 FH SN 40542 9M-PMA-7927 (AJL 04082) NOT APPLICABLE FOR TASK 400 HOIST LIFT/ 6M DUE TO HAD BEEN CARRIED OUT IN 9M-PMA-8348. SN 40542 9M-PMA-10237 (AJL 00025) ON 12/04/2022 @ 1349:20 FH, THIS DUE LOAD TEST FOR SN 404542 (ORI PMD) INSTALLED ON PMA
Types	AD Number	Subject	Last Done	Next Due	Interval/Status	



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	3
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO. 2022-0182-E, NEW ISSUE (SBEA 139-725 REV.A)	TAIL ROTOR - DUPLEX BEARINGS - INSPECTION/REPLACEMENT // ROTOR FLIGHT CONTROL - TAIL ROTOR ACTUATOR - INSPECTION/REPLACEMENT (PARA 10)	1531.34	1581.34	-/Required	9M-PMA-12690 @ 1493:45 FH ON 07.09.2022 (AJL 00105)
Standard ADs	EASA EAD NO. 2022-0209-E, NEW ISSUE (PARA 1)	HARNESS INSTALLATION - FORWARD ROOF AREA - INSPECTION	-	-	-/Required	
COMPONENT ADS						
Standard ADs	EASA AD NO 2019-0235 PARA 3 (ACR SB1000 REV. D PARA 8)	EMERGENCY LOCATOR TRANSMITTER- INSPECTION/ MODIFICATION/ REPLACEMENT	29/06/2022	-	-/COMPLIED WITH	TIC-AW139-21-0313 DATED 27 AUGUST 2021 CARRIED OUT ELT REPLACEMENT: 9M- PMA-9709 ON 29.06.2022 AT 1452:25 FH (AJL 00078)
Standard ADs	EASA AD 2022-0209-E (SB 139-731 REV./ PART 2)	ATA 91 HARNESS INSTALLATION FORWARD ROOF AREA INSPECTION	1531.33	-	-/COMPLIED WITH	9M-PMA-13065
Standard ADs	EASA AD 2022-0209-E (SB 139-731 REV./ PART 1)	ATA 91 HARNESS INSTALLATION FORWARD ROOF AREA INSPECTION	1531.33	-	-/COMPLIED WITH	9M-PMA-13065
ENGINE #1 AD			•			
Standard ADs	AD CF-2012-24	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #1)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0332 NOT APPLICABLE DUE TO ENGINE IS POST-SB 41056.
ENGINE #2 AD						
Standard ADs	AD CF-2012-24	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #2)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0332 NOT APPLICABLE DUE TO ENGINE IS POST-SB 41056.
AIRFRAME ADs	I .					
Standard ADs	AD 2022-0182-E PARA (3), (SBEA 139- 725 REV.A PART III)	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT (DUPLEX BEARING > 2400FH)	-	-	-/NOT APPLICABLE	SUPERSEEDED BY AD 2022-0182-E
Standard ADs	EASA AD NO 2009-0251-E	FIRE PROTECTION - PORTABLE FIRE EXTINGUISHER - IDENTIFICATION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0306 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO FIRE EXTINGUISHERS INSTALLED ON HELICOPTER ARE NOT AFFECTED BY THIS AD.
Standard ADs	EASA AD NO. 2020-0191 REV. 1 (ASB NO. 139-633 REV./)	ATA 25 - EQUIPMENT/FURNISHINGS FORWARD FACING CENTRAL SEAT(S)-REMOVAL	-	-	-/NOT APPLICABLE	TIC-AW139-22-0151 DATED 25 JULY 2022 NOT APPLICABLE DUE TO AIRCRAFT DOESN'T NOT HAVE FIRST ROW CENTRAL SEAT (s) FACING FORWARD SEAT CONFIGURATION



Aircraft Registration:	9М-РМА	Serial No:	31807	Date: 07/03/2023	Page No:	4
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2015-0226 REV 7 PARA 1, 2 &	ATA 25 - EQUIPMENT/FURNISHING - HOIST - TEST /	-	-	-/COMPLIED WITH	TIC-AW139-22-0124 DATED 23 MAY 2022.
	9	REPLACEMENT				COMPLIED BY OEM. REFER ANNEX 1 -
						AIRWORTHINESS DIRECTIVE
Standard ADs	EASA AD 2015-0226, REV 7 PARA 11	ATA 25-EQUIPMENT/FURNISHINGS-HOIST-TEST/REPLACEMENT	-	-	-/ON CONDITION	TIC-AW139-22-0124 DATED 23 MAY 2022.
						COMPLY IF A PARTIAL PEEL OUT
						OCCURS, BEFORE NEXT FLIGHT, REMOVE
						OR DEACTIVEATE THE HOIST OR,
						BEFORE NEXT HOIST OPERATION,
						REPLACE THE HOIST WITH A SERVICABLE
						HOIST, NOTING THE INSTALLATION
						REQUIREMENT OF PARAGRAPH 8.
Standard ADs	EASA AD 2015-0226 REV 7 PARA 10	ATA 25-EQUIPMENT/FURNISHINGS-HOIST-TEST/REPLACEMENT	-	-	-/COMPLIED WITH	TIC-AW139-22-0124 DATED 23 MAY 2022.
						APPLICABLE. COMPLIED WITH.
Standard ADs	EASA AD 2015-0226 REV 7 PARA 5, 8 &	ATA 25- EQUIPMENT/FURNISHINGS- HOIST- TEST REPLACEMENT	-	-	-/FOR INFO ONLY	TIC-AW139-22-0124 DATED 23 MAY 2022.
	12					FOR INFORMATION ONLY.
Standard ADs	EASA AD 2015-0226 REV 7 PARA 4	ATA 25-EQUIPMENT / FURNISHINGS - HOIST - TEST /	-	-	-/ON CONDITION	TIC-AW139-22-0124 DATED 23 MAY 2022.
		REPLACEMENT				COMPLY IF HOIST LOAD CHECK/TEST
						REQUIRED BY PARAGRAPH 2 & 3 OF THIS
						AD, THE HOIST FAILS THE TEST,
						DEACTIVATE THE HOIST AND, BEFORE
						NEXT HOIST OPERATION, REPLACE THE
						HOIST WITH A SERVICEABLE HOIST, AS
						DEFINED IN TABLE 2 OF THIS AD.
Standard ADs	EASA AD 2021-0044 REV 1 PARA (1)	ATA 24 OVERHEAD PANEL INSPECTION	826.50	-	-/COMPLIED WITH	25FH ONCE OFF EASA AD NO.: 2021-0044
	(ASB139-661 REV B)					PARA (1) (ASB139-661) PART I
						COMPLIANCE - ATA 24 OVERHEAD PANEL
						INSPECTION TO BE CARRIED OUT IN
						ACCORDANCE WITH EASA AD NO.: 2021-
						0044 PARA (1) (ASB139-661) PART I / DATE
						04 FEBRUARY 2021 PART I
						ACCOMPLISHMENT INSTRUCTION
						9M-PMA-5801 @ 826:30 FH ON 10/02/2021
						(AJL 03717)



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	5
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2021-0259 (ASB 139-686) [CORRECTION]	ATA 53 - FUSELAGE - TAIL GEARBOX FITTING INSPECTION/REPLACEMENT, ONCE REACH 3000FH, COMPLIANCE WITHIN 25FH)	0.00	3025.00	-/TO BE COMPLIED	TIC-AW139-21-0404 TO COMPLY WITHIN 25FH ONCE EFFECTED COMPONENT REACH 3000FH SINCE INSTALLATION
Standard ADs	**EASA AD 2021-0259 PARA 1 (ASB 139 -686 PART I)	ATA 53 - TAIL GEAR BOX FITTING INSPECTION (TGB FITTING LESS THAN 3000FH)	-	-	-/NOT APPLICABLE	
Standard ADs	EASA AD 2021-0186 REV. 1 [CORRECTION]	ATA 25 - EQUIPMENT/FURNISHINGS - EXTERNAL HOIST ASSEMBLY - RATED LOAD CHECK	-	-	-/NOT APPLICABLE	TIC-AW139-21-0272 DATED 24 AUGUST 2021 (AD CORRECTION) NOT APPLICABLE DUE TO AFFECTED COMPONENT NOT FITTED ON AIRCRAFT. AIRCRAFT FITTED DIFFERENT MODEL TYPE HOIST. AIRCRAFT FITTED WITH GOODRICH HOIST.
Standard ADs	EASA AD 2021-0121, NEW ISSUE (ASB 139-609)	ATA 63 MAIN ROTOR DRIVE MAIN GEARBOX BEARING LOCK NUT REPLACEMENT	0.00	6000.00	-/TO BE COMPLIED	TIC-AW139-21-0251 APPLICABILITY: APPLICABLE DUE TO AFFECTED MGB PN 3G6320A00135 FITTED ON AIRCRAFT. COMPLIANCE: WITHIN 2000 LANDING UPON REACHING 26000 LANDINGS OR AT NEXT OVERHAUL, WHICH OCCURS FIRST.
Standard ADs	EASA AD 2021-0121, NEW ISSUE (ASB 139-609)	ATA 63 MAIN ROTOR DRIVE MAIN GEARBOX BEARING LOCK NUT REPLACEMENT	0.00	28000.00	-/TO BE COMPLIED	TIC-AW139-21-0251 APPLICABILITY: APPLICABLE DUE TO AFFECTED MGB PN 3G6320A00135 FITTED ON AIRCRAFT. COMPLIANCE: WITHIN 2000 LANDING UPON REACHING 26000 LANDINGS OR AT NEXT OVERHAUL, WHICH OCCURS FIRST.
Standard ADs	EASA AD 2021-0095	ATA 11 - PLACARDS AND MARKINGS - STRETCHER UNIT/PLACARD - INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0209 COMPLIANCE: NOT APPLICABLE DUE TO COMPONENT 3-STRETCHER KIT P/N 139084-5001 NOT EQUIPPED ON AIRCRAFT



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	6
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2021-0054 (ASB 139-648 AND	ATA 25 - EQUIPMENT / FURNISHINGS - LIFE RAFT RESERVOIR	-	-	-/NOT APPLICABLE	TIC-AW139-21-0032
	ASB 139-662)	AND ACTUATOR CABLE - REPLACEMENT / INSPECTION.				NOT APPLICABLE DUE TO COMPONENT
						EMERGENCY FLOATATION KIT P/N
						4G9560F00111 OR P/N 4G9560F00211 NOT
						FITTED ON AIRCRAFT THE APPLICABLE
						SB: NOT APPLICABLE TO ASB 139-648 AND
						ASB 139-662
Standard ADs	EASA AD 2020-0271 PARA (1) (SBA	ATA 62 MAIN ROTOR SWASHPLATE BOOT INSPECTION		-	-/COMPLIED WITH	TIC-AW139-20-201 DATED 09 DECEMBER
	139-654 REV./ PART I)					2020
Standard ADs	EASA AD 2020-0011, REVISION 1	ATA 63 - MAIN GEAR BOX - BEARING LOCK NUT - REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2021-0121
Standard ADs	EASA AD 2020-0011, REVISION 1	ATA 63 - MAIN GEAR BOX - BEARING LOCK NUT - REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2021-0121
Standard ADs	EASA AD 2020-0185, NEW ISSUE	ATA 25- EQUIPMENT/ FURNISHINGS- LIFE RAFT RESERVOIR AND	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2021-0054
		ACTUATOR CABLE- REPLACEMENT/ INSPECTION				
Standard ADs	EASA AD 2020-0131 (SBA 139-637)	ATA 25 HOIST CABLE CUTTER FRAME INSTALLATION	593.00	-	-/COMPLIED WITH	TIC-AW139-20-004
						WP-PMA-20-1112 AT 593:00FH ON
						25/09/2020 (AJL 03112)
Standard ADs	EASA AD NO. 2020-0013 (SB 139-614)	ATA 26 - FIRE PROTECTION - HAND-HELD FIRE EXTINGUISHERS -	-	-	-/NOT APPLICABLE	REFER TIC-AW139-20-007 DATE ISSUE 30
		REPLACEMENT				JANUARY 2020.
						NOT APPLICABLE DUE TO COMPONENT
						PART NUMBER NOT AFFECTED.



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	7
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	
Standard ADs	EASA AD 2019-0311, NEW ISSUE (SBA	ATA 25, 95 EQUIPMENT / FURNISHINGS, EMERGENCY	27/08/2020	-	-/COMPLIED WITH	REFER TO TIC-AW139-19-127.APPLICABLE
	NO. 139-610, NEW ISSU	FLOTATION SYSTEM INFLATION HOSES INSPECTION				TO AIRCRAFT TYPE AND S/N
						CARRIED OUT AS PER WP-PME-20-1526 @
						247:50 FH ON 27/08/2020 (AJL 03207)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 195
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 189
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 183
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 186
						7.652227 6.11 166
						CARRIED OUT AS PER WP-PMD-20-2200 @
						419:55 FH ON 03/12/2020 (AJL 03196)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 174
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 165
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 163
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 140
						CARRIED OUT AS PER WP-PMB-20-1287 @
						1315:30FH ON 12/07/2020 (AJL 02599)
						ORIGINAL FLOAT SET 9M-PMA
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 173
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 169
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 168
						D. 3G9560V02431 R/H AFT FLOAT



Aircraft Registration:	9М-РМА	Serial No:	31807	Date: 07/03/2023	Page No:	8
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
						ASSEMBLY SN: 164



Aircraft Registration:	9М-РМА	Serial No:	31807	Date: 07/03/2023	Page No:	9
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs		ATA 25, 95 EQUIPMENT / FURNISHINGS, EMERGENCY	247.83	-	-/COMPLIED WITH	REFER TO TIC-AW139-19-127. APPLICABLE
	NO. 139-610, NEW ISSU	FLOTATION SYSTEM INFLATION HOSES INSPECTION				TO AIRCRAFT TYPE AND S/N
						CARRIER OUT AS RED WE DATE OF 4500 G
						CARRIED OUT AS PER WP-PME-20-1526 @
						247:50 FH ON 27/08/2020 (AJL 03207)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 195
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 189
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 183
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 186
						CARRIED OUT AS PER WP-PMD-20-2200 @
						419:55 FH ON 03/12/2020 (AJL 03196)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 174
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 165
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 163
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 140
						CARRIED OUT AS PER WP-PMB-20-1287 @
						1315:30FH ON 12/07/2020 (AJL 02599)
						ORIGINAL FLOAT SET 9M-PMA
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 173
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 169
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 168
						D. 3G9560V02431 R/H AFT FLOAT



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	10
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
						ASSEMBLY SN: 164
Standard ADs	EASA AD 2019-0174 (ASB 139-567 REV.A)	ATA 63 - MGB BEARING LOCK-NUT REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2020-0011
Standard ADs	EASA AD 2019-0149 (ASB 139-593 REV./)	ATA 71 - POWER PLAN - ENGINE MOUNTING RODS)	-	-	-/NOT APPLICABLE	TIC-AW139-19-029 - NOT APPLICABLE TO COMPONENT SN
Standard ADs	EASA AD NO 2019-0073 (ASB 139-580)	ATA 64 TAIL ROTOR FULL ICE PROTECTION SYSTEM TAIL ROTOR BLADES INSPECTION / REPLACEMENT		-	-/NOT APPLICABLE	TIC-PMA-19-021 NOT APPLICABLE AIRCRAFT NOT EQUIPPED WITH FULL ICE PROTECTION SYSTEM (FIPS)THIS AD IS RELATED TO ASB 139-580
Standard ADs	EASA AD2019-0036 (SB139-567)	ATA 63 - MAIN ROTOR DRIVE - MAIN GEAR BOX BEARING LOCT NUT - REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2019-0174
Standard ADs	EASA AD2019-0022 (SB139-571 REV./)	ATA 64 - TAIL ROTOR DUPLEX BEARING REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-PMA-19-004 N/A COMPONENT FITTED WITH SN 17196
Standard ADs	EASA AD 2018-0292 (ASB 139-569 REV. B PART I)	ATA-64, T/R SLIDER ASSEMBLY - INSPECTION	0.00	2400.00	-/TO BE COMPLIED	TIC-PMA-18-040
Standard ADs	EASA AD 2018-0208 (SB139-533)	EMERGENCY FLOTATION SYSTEM - AFT FLOAT ASSEMBLY INFLATION SYSTEM - REMOVAL / INSTALLATION	-	-	-/NOT APPLICABLE	
Standard ADs	EASA AD 2018-0132, NEW ISSUE	TIME LIMIT/MAINTENANCE CHECKS - AIRWORTHINESS LIMITATION SECTION - AMENDMENT / IMPLEMENTATION	-	-	-/COMPLIED WITH	COMPLIED WITH. INFO IS REFERRED FROM LEONARDO HELICOPTER ANNEX 6 - AIRWORTHINESS DIRECTIVES STATUS LIST AC 31807
Standard ADs	EASA AD 2018-0130	ATA 62 - MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION	-	-	-/NOT APPLICABLE	INSTALLED MR DAMPERS PN 3G6220V01353 WITH CORRECT TORQUE VALUES IAW SB139-452. INFO IS REFERRED FROM LEONARDO HELICOPTER ANNEX 6 - AIRWORTHINESS DIRECTIVES STATUS LIST AC 31807
Standard ADs	EASA AD 2018-0112R1	ATA 62 - MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION / REPLACEMENT	-	-	-/COMPLIED WITH	PART I: APPLICABLE. COMPLIED WITH. PART II: COMPLIED. AIRCRAFT ALREADY FITTED WITH MR DAMPER P/N 3G6220V01353 INFO IS REFERRED FROM LEONARDO HELICOPTER ANNEX 6 - AIRWORTHINESS DIRECTIVES STATUS LIST



Aircraft Registration:	9М-РМА	Serial No:	31807	Date: 07/03/2023	Page No:	11
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2018-0002 NEW ISSUE (SB	ATA 46 - INFORMATION SYSTEMS - "PRIMUS EPIC" SYSTEM	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0320. NOT
	139-500)	SOFTWARE - SOFTWARE UPDATE				APPLICABLE DUE TO HELICOPTER NOT
						EQUIPPED WITH PRIMUS EPIC SYSTEM
						SOFTWARE RELEASE 7.4 (PHASE 7 V1) OR
						7.7 (PHASE 7 V3) OR 7.10 (PHASE 7 V4).
						HELICOPTER CURRENTLY EQUIPPED
						WITH SOFTWARE RELEASE 7.12.
Standard ADs	EASA AD 2017-0124R1	TIME LIMITS/ MAINTENANCE CHECKS - AIRWORTHINESS LIMITATIONS	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2018-0132
Standard ADs	EASA AD 2017-0175-E (SB 139-508	MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0319 DATED 27 AUGUST
	REV. /)	REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS FITTED
						WITH NOT AFFECTED SERIAL NUMBER
						MRB WHICH ARE S/N 4225, 4242, 4137,
						4144, 4138.
Standard ADs	EASA AD 2017-0160	ATA 62 MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2018-0112
Standard ADs	EASA AD NO 2017-0083 NEW ISSUE	ATA 62 - MAIN ROTOR - MAIN ROTOR SLIP RING - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0318 DATED 27 AUGUST
	(SB 139-472)	REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS NOT
						INSTALLED WITH FULL ICE PROTECTION
						SYSTEMS.
Standard ADs	EASA AD 2017-0028-E	ATA 62 - MAIN ROTOR - ROTATING SCISSORS - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0315 DATED 27 AUGUST
		REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS NOT
						FITTED WITH AFFECTED P/N
						3G6230V00654, BUT FITTED WITH P/N
						3G6230V00655.
Standard ADs	EASA AD 2011-0205R1	AT 55 STABILIZER TAIL FIN ASSEMBLY INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0124R1
Standard ADs	EASA AD 2017-0011 (BT 139-465 REV A	ATA 65 TAIL ROTOR - TAIL ROTOR DRIVE SHAFT - INSPECTION /	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0317. NOT
)	MODIFICATION				APPLICABLE TO AIRCRAFT SERIAL
						NUMBER



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	12
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2016-0255R1	ATA 63 - MAIN ROTOR DRIVE - MAIN GEARBOX INPUT MODULE - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0316 DATED 27 AUGUST 2021 NOT APPLICABLE. THIS IS BECAUSE AIRCRAFT IS FITTED WITH MGB INPUT MODULE P/N 3K6320A00136 HAVING NOT
Standard ADs	EASA AD 2016-0246	ATA 65 - TAIL ROTOR DRIVE - TAIL GEARBOX CENTRAL HOUSING - DIMENSIONAL CHECK / REPLACEMENT	-	-	-/NOT APPLICABLE	AFFECTED S/N KHI-D39 AND S/N KHI-D42 TIC-AW139-21-0314 DATED 27 AUGUST 2021 NOT APPLICABLE. AIRCRAFT IS NOT FITTED WITH AFFECTED CENTRAL HOUSING PART NUMBER (P/N 3T6522A05144 OR P/N 3T6522A05146).
Standard ADs	EASA AD 2016-0140	MAI ROTOR - MAIN ROTOR DAMPER - INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0160
Standard ADs	EASA AD 2016-0087	MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0160
Standard ADs	EASA AD NO 2016-0077	LANDING GEAR - MAIN LANDING GEAR SHOCK ABSORBER SCREWS - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0302 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO KIT INCREASED GROSS WEIGHT 6800 KG P/N 4G0000F00111 NOT INSTALLED.
Standard ADs	EASA AD NO 2016-0077 (BT139-397)	LANDING GEAR - MAIN LANDING GEAR SHOCK ABSORBER SCREWS - REPLACEMENT	-	-	-/NOT APPLICABLE	NOT APPLICABLE. KIT INCREASED GROSS WEIGHT KG NOT INSTALLED.
Standard ADs	EASA AD NO 2015-0172 (BT 139-374)	ATA 32 - LANDING GEAR- EMERGENCY FLOTATION SYSTEM CONTROL PANEL - REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0301. NOT APPLICABLE, AC IS FITTED WITH PN: 3G9560V00559
Standard ADs	EASA AD 2015-0160	EQUIPMENT / FURNISHINGS - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2015-0226
Standard ADs	EASA AD NO 2015-0155	ATA 30 - ICE AND RAIN PROTECTION - FULL ICE PROTECTION SYSTEM TAIL ROTOR SLIP RING-INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0300 DATED 27 AUGUST 2021. NOT APPLICABLE DUE TO AIRCRAFT IS NOT EQUIPPED WITH FIPS.
Standard ADs	EASA AD 2006-0357R2	FUSELAGE - FRAME 5700 MIDDLE SECTION - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0124R1
Standard ADs	EASA AD 2015-0069	EQUIPMENT / FURNISHINGS - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2015-0160
Standard ADs	EASA AD 2014-0254	EQUIPMENT / FURNISHING - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2015-0069
Standard ADs	EASA AD 2014-0215-E	MAIN ROTOR - ROTATING SCISSORS - INSPECTION / MODIFICATION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0028-E
Standard ADs	EASA AD 2014-0201	EQUIPMENT / FURNISHING - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0254



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	13
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2014-0172	ATA 30 - ICE AND RAIN PROTECTION -FULL ICING PROTECTION SYSTEM / CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT / AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND REPETITIVE CHECK / AC GENERATOR CONTROL UNIT REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0299 APPLICABILITY: NOT APPLICABLE DUE TO A/C NOT EQUIPPED WITH FIPS (FULL ICING PROTECTION SYSTEM).
Standard ADs	EASA AD 2014-0073-E	MAIN ROTOR - ROTATING CONTROLS - LOWER HALF SCISSOR SPHERICAL BEARING - INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA EAD 2014-0215-E
Standard ADs	EASA AD 2014-0048 (BT 139-311 REV B)	ATA 53 - FUSELAGE - SUBFLOOR FRAME STA 2105 - INSPECTION / MODIFICATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0298. NOT APPLICABLE TO AIRCRAFT S/N.
Standard ADs	EASA AD 2012-0076R2	ATA 64 - TAIL ROTOR-TAIL ROTOR BLADES-INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0293 NOT APPLICABLE DUE TO AIRCRAFT ALREADY FITTED WITH SERVICABLE T/R BLADE P/N 3G6410A00133.
Standard ADs	EASA AD 2014-0028	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM / CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT / AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND REPETITIVE CHECK / AC GENERATOR CONTROL UNIT REPLACEMENT	-		-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0172
Standard ADs	EASA AD 2013-0298	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM / CABLE INSPECTION TAIL ROTOR DISTRIBUTOR REPLACEMENT / AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND REPETITIVE CHECK / AC GENERATOR CONTROL UNIT REPLACEMENT	-		-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0028
Standard ADs	EASA AD 2013-0275R1	EQUIPMENT / FURNISHING - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0201
Standard ADs	EASA AD NO 2013-0177	ATA 29 - HYDRAULIC POWER - FLEXIBLE HYDRAULIC HOSES - REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0297 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO MODIFICATION ALREADY INCORPORATED IN THE HELICOPTER
Standard ADs	EASA AD 2013-0174	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM / CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0298
Standard ADs	EASA AD 2010-0237-CN	CANCELLED: EQUIPMENT / FURNISHINGS - SPECTROLAB NIGHTSUN XP SEARCHLIGHT - INSPECTION / REMOVAL / REPLACEMENT	-	-	-/CANCELLED	TIC-AW139-21-0296 AD CANCELLED.
Standard ADs	EASA AD 2013-0124	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM / CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0174
Standard ADs	EASA AD 2013-0090	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM / CABLES - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0124



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	14
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2013-0077R1	EQUIPMENT / FURNISHING - HOIST - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0275
		REPLACEMENT				
Standard ADs	EASA AD 2013-0065-E	EQUIPMENT / FURNISHING - HOIST - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0077-E
		REPLACEMENT				
Standard ADs	EASA AD NO 2012-0262	ATA 32 - LANDING GEAR - NOSE LANDING GEAR ARM PIN	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0295. NOT
		INSTALLATION - INSPECTION				APPLICABLE DUE TO AIRCRAFT SERIAL
						NUMBER.
Standard ADs	EASA AD NO 2012-0213-E	ATA 27 - FLIGHT CONTROL -COLLECTIVE AND CYCLIC CONTROL	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0294. NOT
		SYSTEM -INSPECTION / RESTORATION				APPLICABLE.
						REASON: DUE TO AIRCRAFT S/N NOT
						AFFECTED.
Standard ADs	EASA AD 2012-0030	TAIL ROTOR TAIL ROTOR BLADES INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2012-0076
Standard ADs	EASA AD NO 2011-0226-E	ATA 27 - FLIGHT CONTROL - COLLECTIVE CONTROL SYSTEM-	-	-	-/NOT APPLICABLE	TIC-AW139-21-0292 DATED 27 AUGUST
		INSPECTION/INSTALLATION				2021.
						NOT APPLICABLE DUE TO AIRCRAFT S/N
						NOT AFFECTED.
Standard ADs	EASA AD NO 2011-0207	ATA 29 - HYDRAULIC POWER - HYDRAULIC SYSTEM -	-	-	-/COMPLIED WITH	TIC-AW139-21-0291. APPLICABLE TO
		OPERATIONAL CHECKS/ REPLACEMENT				AIRCRAFT S/N.
						COMPLIED WITH. OPERATIONAL CHECK
						PERFORMED DURING PRODUCTION.
						REFER ANNEX 1 - AIRWORTHINESS
						DIRECTIVES.
Standard ADs	EASA AD 2006-0358R1	STABILIZERS - FIN ASSEMBLY - INSPECTION/REPLACEMENT	-	-		SUPERSEDED BY EASA AD 2011-0205
Standard ADs	EASA AD 2011-0156-E	TAIL ROTOR - TAIL ROTOR BLADES - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2012-0030
		REPLACEMENT [REDUCED LIFE LIMITATION]				
Standard ADs	EASA AD NO 2011-0140, NEW ISSUE	ATA 23 - COMMUNICATIONS - PRIMUS EPIC SYSTEM HARNESSES	-	-	-/NOT APPLICABLE	TIC-AW139-21-0290
		SOLDER SPLICES - INSPECTION / REPLACEMENT				NOT APPLICABLE DUE TO AIRCRAFT S/N
						NOT AFFECTED.
Standard ADs	EASA AD 2011-0081	TAIL ROTOR - TAIL ROTOR BLADES - INSPECTION	-	-		SUPERSEDED BY EASA AD 2011-0156-E
Standard ADs	EASA AD NO 2011-0019	ATA 53 - FUSELAGE - TAIL BOOM - INSPECTION / MODIFICATION	-	-		TIC-AW139-21-0289
						NOT APPLICABLE DUE TO AIRCRAFT
						FITTED WITH TAIL ASSY P/N
						3G5350A00136.



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	15
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2010-0189	NAVIGATION - MODULAR AVIONIC UNIT - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0288
		REPLACEMENT / MODIFICATION				NOT APPLICABLE TO AIRCRAFT SERIAL
						NUMBER BECAUSE THIS AD ONLY
						APPLICABLE TO AIRCRAFT FROM S/N
						31005 TO S/N 31157 (EXCEPT S/N 31007,
						S/N 31094 AND S/N 31149) AND FROM S/N
						41001 TO S/N 41023.
Standard ADs	EASA AD 2010-0183R1	EQUIPMENT / FURNISHINGS - SPECTROLAB NIGHTSUN XP	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2010-0237
		SEARCH				
Standard ADs	2009-0183-CN	CANCELLATION NOTICE: EQUIPMENT/FURNISHING - D -LOCK	-	-	-/NOT APPLICABLE	TIC-AW139-21-0287
		HOOK OF THE RESCUE HOIST				COMPLIANCE: NOT APPLICABLE.
						CANCELLATION NOTICE.
Standard ADs	EASA AD 2009-0234-ER1	FUSELAGE - TAIL BOOM - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2011-0019
Standard ADs	EASA AD 2009-0198-E	FUSELAGE - TAIL BOOM - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0234-E
Standard ADs	EASA AD 2009-0179-E	EQUIPMENT/FURNISHING - D-LOCK HOOK OF THE RESCUE HIOST	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0183-E
		- INSPECTION/REMOVAL FROM SERVICE/REPLACEMENT				
Standard ADs	EASA AD 2009-0148-E	EQUIPMENT/FURNISHING - D-LOCK HOOK OF THE RESCUE HIOST	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0179-E
		- INSPECTION/REMOVAL FROM SERVICE/REPLACEMENT				
Standard ADs	EASA AD 2009-0124	EQUIPMENT/FURNISHING - LIFESAVING SYSTEMS' D-LOCK HOOK	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0148-E
		OF THE RESCUE HIOST - INSPECTION/REPLACEMENT				
Standard ADs	EASA AD NO 2009-0042	ATA 24 - ELECTRICAL POWER - GENERATOR CONTROL UNIT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0286
		(GCU) - REPLACEMENT				NOT APPLICABLE DUE TO DIFFERENT
						PART NUMBER
Standard ADs	EASA AD 2008-0157	FUSELAGE - TAIL BOOM ASSEMBLY - INSPECTION / REPAIR /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0198-E
		REPLACEMENT				
Standard ADs	EASA AD NO 2008-0148	ATA 53 - FUSELAGE - WIRE STRIKE PROTECTION SYSTEM (WSPS)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0285
		TOP CABLE CUTTER - REWORK / REPLACEMENT				NOT APPLICABLE DUE TO A/C NOT
						EQUIPPED WITH WIRE STRIKE
						PROTECTION SYSTEM.
Standard ADs	EASA AD 2008-0108	ATA 56 - WINDOWS - COCKPIT DOOR WINDOWS - REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TO TIC-AW139-21-0305. NOT
						APPLICABLE TO SERIAL NUMBER.
Standard ADs	EASA AD 2008-0011	WINDOWS - COCKPIT DOORS WINDOWS AND SEALING -	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2008-0108
		INSPECTION/REPAIR/REPLACEMENT/MODIFICATION				
Standard ADs	EASA AD 2007-0142	WINDOWS - COCKPIT DOORS WINDOWS SEALING -	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2008-0011
		INSPECTION/REPAIR/REPLACEMENT				
L						



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	16
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2006-0360-E	ATA 78 - EXHAUST - TAILPIPE ASSEMBLY -	-	-	-/NOT APPLICABLE	TIC-AW139-21-0284
		INSPECTION/REPAIR/REPLACEMENT				NOT APPLICABLE DUE TO TAILPIPE
						ASSEMBLIES AFFECTED BY THIS AD ARE
						NOT INSTALLED ON AIRCRAFT.
Standard ADs	EASA AD 2014-0125	ATA 25 - EQUIPMENT/FURNISHINGS - CRASH POSITION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0311 DATED 27 AUGUST
		INDICATOR SYSTEM - REPLACEMENT ; AIRCRAFT FLIGHT				2021.
		MANUAL - AMENDMENT				NOT APPLICABLE DUE TO KIT ELT
						DEPLOYABLE NOT INSTALLED IN
						AIRCRAFT.
Standard ADs	EASA AD NO 2010-0062R1	FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHER -	-	-	-/NOT APPLICABLE	TIC-AW139-21-0308 DATED 27 AUGUST
		IDENTIFICATION / REPLACEMENT				2021
						NOT APPLICABLE DUE TO AIRCRAFT
						EQUIPPED WITH DIFFERENT
						MANUFACTURER.
Standard ADs	EASA AD NO 2009-0262R1	FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHER -	-	-	-/NOT APPLICABLE	TIC-AW139-21-0307
		IDENTIFICATION / REPLACEMENT				NOT APPLICABLE. AFFECTED PN NOT
						FITTED IN AC.
Standard ADs	EASA AD NO 2007-0256	EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM	-	-	-/NOT APPLICABLE	TIC-AW139-21-0304 DATED 27 AUGUST
		PLASTIC ROTARY BUCKLE HANDLE - INSPECTION/REPLACEMENT				2021
						NOT APPLICABLE DUE TO DIFFERENT
						EQUIPMENT INSTALLED.
Standard ADs	EASA AD NO 2007-0156	COMMUNICATION - COMM UNITS & TRANSPONDERS -	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0303.NOT
		MODIFICATION/REPLACEMENT				APPLICABLE DUE TO MODE S
						TRANSPONDER INSTALLED ON AIRCRAFT
						IS NOT AFFECTED BY THIS AD.
Standard ADs	EASA AD 2015-0226 REV 7 PARA 6	ATA 25- EQUIPMENT/FURNISHING-HOIST-TEST/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0124 DATED 23 MAY 2022.
						NOT COMPLIED DUE TO HOIST
						INSTALLED WITH NEW OVERCLUTCH
						ASSEMBLY.
Standard ADs	EASA SIB NO. 2021-14, NEW ISSUE	HAND-OPERATED FIRE EXTINGUISHERS - REMOVAL FROM	-	-	-/FOR INFO ONLY	TIC-GEN-21-0154 DATED 02 JULY 2021
		SERVICE				NOT APPLICABLE TO ALL CAMO FLEET.
Standard ADs	EASA SIB 2019-09 R1	1Y INSP ELT & PLB ANNUAL TEST	10/09/2021	09/09/2022	-/FOR INFO ONLY	TIC-GEN-21-0017
						WP-PMA-20-2382 @ 744:10 FH ON
						09/12/2020 (AJL 03374)
Standard ADs	AD NO. 2007-0256-CN, NEW ISSUE	ATA 25 - EQUIPMENT AND FURNISHING - SEAT RESTRAINT	-	-	-/CANCELLED	REFER TIC-AW139-21-0304. NOT
		SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION /				APPLICABLE DUE AD CANCELLED
		REPLACEMENT				



Aircraft Registration:	9М-РМА	Serial No:	31807	Date: 07/03/2023	Page No:	17
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	AD NO. 2022-0287, NEW ISSUE	SEAT BELT RESTRAINT SYSTEM - INSPECTION	-	-	-/FOR INFO ONLY	TIC-GEN-22-0024 DATED 27 JANUARY 2022
						NOT APPLICABLE. GAM CAMO FLEET DO
						NOT MANAGE MBB-BK117 C-2, D-2 AND D-
						3 HELICOPTERS.
Standard ADs	AD NO. 2022-04-09, NEW ISSUE	OXYGEN CYLINDER AND VALVE ASSEMBLIES AND OXYGEN	-	-	-/FOR INFO ONLY	TIC-GEN-22-0057 DATED 01 MARCH 2022
		VALVE ASSEMBLIES				NOT APPLICABLE TO ALL GAM CAMO
						FLEET DUE TO AIRCRAFT TYPE NOT
						AFFECTED.
Standard ADs	AD NO. 2022-01-03, NEW ISSUE	UMLAUT ENGINEERING GMBH (PREVIOUSLY P3 ENGINEERING	-	-	-/FOR INFO ONLY	TIC-GEN-22-0039 03 FEBRUARY 2022
		GMBH) HAFEX (HALON-FREE) HAND-HELD FIRE EXTINGUISHERS				NOT APPLICABLE. GAM CAMO LEONARDO
						AND AIRBUS HELICOPTERS FLEET ARE
						ONLY AFFECTED BY EASA AD AND IN
						THIS CASE IT IS THE EASA AD 2020-0013.
Standard ADs	AD NO. 2022-03-15,NEW ISSUE	FUEL QUANTITY INDICATOR	-	-	-/FOR INFO ONLY	TIC-GEN-22-0045 DATED 15 FEBRUARY
						2022
						NOT APPLICABLE TO ANY GAM CAMO
						FLEET DUE TO AIRCRAFT TYPE NOT
						AFFECTED.
Standard ADs	AD NO. 2022-0024, NEW ISSUE	FLIGHT MANAGEMENT COMPUTER 2 / NAVIGATION MODULES -	-	-	-/FOR INFO ONLY	TIC-GEN-22-0042 07 FEBRUARY 2022.
		OPE				NOT APPLICABLE. GAM CAMO FLEET NOT
						EQUIPPED WITH FLIGHT MANAGEMENT
						COMPUTER 2 NAVIGATION MODULES
						PART NUMBER: C13084CA03
Standard ADs	AD No. G-2021-003, NEW ISSUE	LIFE JACKET - INSPECTION	-	-	-/NOT APPLICABLE	TIC-GEN-21-0137 DATED 09 JUNE 2021
						EMERGENCY BREATHING SYSTEM (EBS)
						P/N 12677009, AS FITTED TO THE
						SURVITEC HALO PASSENGER
						LIFEJACKET P/NS 00031010 AND 00031031.
						NOT APPLICABLE TO GAM CAMO FLEET.
Standard ADs	EAD No. G-2021-0010-E, NEW ISSUE	FUEL - CYLINDER QUICK SHUT-OFF VALVE MOUNTING FLANGE -	-	-	-/NOT APPLICABLE	TIC-GEN-21-0220 DATED 04 OCTOBER
		INSPECTION/REPLACEMENT				2021
						CAMEROON BALLON FUEL CYLINDERS
						WITH P/N: CB2901, CB2902, CB2903. NOT
						APPLICABLE TO GAM CAMO FLEET



Aircraft Registration:	9M-PMA	Serial No:	31807	Date: 07/03/2023	Page No:	18
Aircraft Hours:	1647:10	Landings:	2649.00	Engine 1: 1647:10	Engine 2:	1647:10

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	AD NO. G-2021-0004, NEW ISSUE	LIFE RAFT - INSPECTION	-	-	-/NOT APPLICABLE	TIC-GEN-21-0150 DATED 29 JUNE 2021
						SURVITEC LIFE RAFT WITH PACKED
						ASSEMBLY P/N 00051054 (PORT) AND
						00051055 (STARBOARD).
						NOT APPLICABLE TO GAM CAMO FLEETS.
Standard ADs	EASA AD NO. 2021-0185, REVISION 2	HAFES (HALON-FREE) HAND-HELD FIRE EXTINGUISHERS	-	-	-/NOT APPLICABLE	TIC-GEN-21-0194 DATED 16 AUGUST 2021
						HAFEX (HALON-FREE) HAND-HELD FIRE
						EXTINGUISHERS, HAVING PART NUMBER
						(P/N) P3APP003010A, P/N P3APP003010B
						OR P/N P3APP003010C, ALL SERIAL
						NUMBERS (S/N).
						NOT APPLICABLE TO GAM CAMO FLEET
Standard ADs	EASA AD 2017-0225	ATA 25 - EQUIPMENT/FURNISHINGS - SEAT RESTRAINT SYSTEM -	-	-	-/NOT APPLICABLE	
		AFM AMENDMENT/MODIFICATION				
Standard ADs	2014-0095R1	EQUIPMENT/FURNISHING - CRASH POSITION INDICATOR -	-	-	-/KIT NOT	KIT ELT DEPLOYABLE NOT INSTALLED
		MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT			INSTALLED	
Standard ADs	2013-0020R4	EQUIPMENT & FURNISHING S - SAFETY BELTS / TORSO	-	-	-/NOT APPLICABLE	NEW PART INSTALLED
		RESTARINT SYSTEMS - INSPECTION / REPLACEMENT				
Standard ADs	2006-0360-E	EXHAUST - TAILPIPE ASSEMBLY - INSPECTION / REPAIR /	-	-	-/NOT APPLICABLE	INSTALLED DIFFERENT P/N (REF.
		REPLACEMENT				HELICOPTER LOGBOOK)
Standard ADs	2014-0019	EQUIPMENT/FURNISHING - CRASH POSITION INDICATOR -	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0095
		MODIFICATION				
Standard ADs	2006-0265-CN	CANCELLED: NAVIGATION SYSTEMS - MODE C ANS S	-	-	-/NOT APPLICABLE	CANCELLATION NOTICE
		TRANSPONDERS - CHECK				
Standard ADs	2006-0242-E	EXHAUST - TAILPIPE ASSY LH P/N 3G7800L00131 AND TAILPIPE	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2006-0360-E
		ASSY RH P/N				
Standard ADs	AD 2022-0182-E PARA (7), (SBEA 139-	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND	0.00	1669.83	-/TO BE COMPLIED	
	725 REV.A PART IV)	REPLACEMENT				