

maintenance.repair.overhaul

Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	1
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
ADs				·		
Types	AD Number	Subject	Last Done	Next Due	Interval	Limitation Notes
Repetitive ADs	EASA AD 2015-0226 REV 7 PARA 7	2600HL//36M HOIST CLUCTH REPLACEMENT - ATA 25 EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	0:00	0:00	2600	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT. EVERY 39 MONTHS // 2600 HOIST LIFT, OR AT THE NEXT SCHEDULED HOIST OVERHAUL
Repetitive ADs	EASA AD 2015-0226 REV 7 PARA 7	2600HL//36M HOIST CLUCTH REPLACEMENT - ATA 25 EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	-	00/00/0000	36	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT. EVERY 39 MONTHS // 2600 HOIST LIFT, OR AT THE NEXT SCHEDULED HOIST OVERHAUL
Repetitive ADs	EASA AD No.: 2022-0205 (SB 139-724 REV B)	TAIL ROTOR - DAMPER BRACKET - INSPECTION	20/12/2022	20/06/2023	6	
Repetitive ADs	EASA AD No.: 2022-0205 (SB 139-724 REV B)	TAIL ROTOR - DAMPER BRACKET - INSPECTION	1522:14	1572:14	50	
Repetitive ADs	EASA AD 2022-0182-E PARA 1 (SBEA 139-725 REV. A PART I)	TAIL ROTOR - DUPLEX BEARINGS - INSPECTION/REPLACEMENT // ROTOR FLIGHT CONTROL - TAIL ROTOR ACTUATOR - INSPECTION/REPLACEMENT	1540:15	1550:15	10	
Repetitive ADs	EASA AD 2015-0226R7 CORRECTION 20 DECEMBER 2021 (SB139-	ATA 25 - EQUIPMENT / FURNISHINGS HOIST TEST / REPLACEMENT	-	-	0	
Repetitive ADs	EASA AD 2021-0044 REV 1 PARA (2) (ASB139-661 REV. B)	ATA 24 OVERHEAD PANEL INSPECTION 300H/12M REPETITIVE PART II COMPLIANCE	01/09/2022	01/09/2023	12	TIC-AW139-22-0120 DATED 13 MAY 2022 9M-PMD-9380-003 AT 1117:15FH ON 06/02/2022 (AJL 01019)
Repetitive ADs	EASA AD 2021-0044 REV 1 PARA (2) (ASB139-661 REV. B)	ATA 24 OVERHEAD PANEL INSPECTION 300H/12M REPETITIVE PART II COMPLIANCE	1408:46	1708:46	300	TIC-AW139-22-0120 DATED 13 MAY 2022 9M-PMD-9380-003 AT 1117:15FH ON 06/02/2022 (AJL 01019)
Repetitive ADs	EASA AD 2020-0271 PARA (2) (ASB139 -654 PART II	50FH - ATA 62 MAIN ROTOR SWASHPLATE BOOT INSPECTION	1522:14	1572:14	50	TIC-AW139-20-201 DATED 09 DECEMBER 2020 9M-PMD-11550 (AJL 01124) @ 1344:50FH ON 02/07/2022 9M-PMD-11796 (AJL 01148) @ 1385:35FH ON 02/08/2022 9M-PMD-12488 @ 1430:50 FH ON 12.09.2022 (AJL 01175)



naınter			

Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	2
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Repetitive ADs	2015-0226 REV 7 PARA 3 (SB139-443 REV.A PARA III)	400HL//6M HOIST LOAD TEST - EQUIPMENT / FURNISHINGS - H	0:00	400:00	400	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST PART NUMBER 44316- 12-104 FITTED ON AIRCRAFT. HOIST SERIAL NUMBER 40543 BASED PGU SUBANG CARRIED OUT IN 9M-PMF-10177 AT 394:50FH ON 15/03/2022
						HOIST ORI 9M-PMD SERIAL NUMBER 40542 BASED ON PGU KK
Repetitive ADs	2015-0226 REV 7 PARA 3 (SB139-443 REV.A PARA III)	400HL//6M HOIST LOAD TEST - EQUIPMENT / FURNISHINGS - H	19/09/2022	19/03/2023		TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST PART NUMBER 44316- 12-104 FITTED ON AIRCRAFT. HOIST SERIAL NUMBER 40543 BASED PGU SUBANG CARRIED OUT IN 9M-PMF-10177 AT 394:50FH ON 15/03/2022 HOIST ORI 9M-PMD SERIAL NUMBER 40542 BASED ON PGU KK
Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	AD 2022-0182-E PARA (7), (SBEA 139- 725 REV.A PART IV)	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT	0.00	1590.67	-/TO BE COMPLIED	
Standard ADs	AD 2022-0182-E PARA (3), (SBEA 139- 725 REV.A PART III)	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND REPLACEMENT (DUPLEX BEARING > 2400FH)	-	-	-/NOT APPLICABLE	SUPERSEEDED BY AD 2022-0182-E
Standard ADs	EASA AD NO. 2022-0182-E, NEW ISSUE (SBEA 139-725 REV.A)	TAIL ROTOR - DUPLEX BEARINGS - INSPECTION/REPLACEMENT // ROTOR FLIGHT CONTROL - TAIL ROTOR ACTUATOR - INSPECTION/REPLACEMENT (PARA 10)	-	-	-/Required	
Standard ADs	EASA EAD NO. 2022-0209-E, NEW ISSUE (PARA 1)	HARNESS INSTALLATION - FORWARD ROOF AREA - INSPECTION	-	-	-/Required	



mainter	hance.I	repair.	over	haul	

Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	3
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD No.: 2022-0154 (SBA 139-724	ATA 64 - TAIL ROTOR DAMPER BRACKET INSPECTION	1430.86	1480.86	-/Required	TIC-AW139-22-0160 DATED 02 AUGUST
	REV.A)					2022
						APPLICABLE DUE TO COMPONENT TAIL
						ROTOR DAMPER BRACKET ASSEMBLY
						P/N 3G6420A06131 WITH THE AFFECTED
						S/N EQUIPPED ON AIRCRAFT.
						9M-PMD-12343 @ 1430:50 FH ON
						12.09.2022 (AJL 01175)
Standard ADs	EASA AD No.: 2022-0154 (SBA 139-724	ATA 64 - TAIL ROTOR DAMPER BRACKET INSPECTION	12/09/2022	12/03/2023	-/Required	TIC-AW139-22-0160 DATED 02 AUGUST
	REV.A)					2022
						APPLICABLE DUE TO COMPONENT TAIL
						ROTOR DAMPER BRACKET ASSEMBLY
						P/N 3G6420A06131 WITH THE AFFECTED
						S/N EQUIPPED ON AIRCRAFT.
						9M-PMD-12343 @ 1430:50 FH ON
						12.09.2022 (AJL 01175)
Standard ADs	EASA AD 2022-0152-E PARA (2)(SBEA	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND	-	-	-/SUPERSEDED	TIC-AW139-22-0157 DATED 27 JULY 2022
	139-725 REV/PART 2)	REPLACEMENT(WITHIN 10FH AND EVERY 50FH)				9M-PMD-12173 @ 1392:10 FH ON
						03.08.2022 (AJL 01149) - 1ST COMPLIANCE
						9M-PMD-12488 @ 1430:50 FH ON
						12.09.2022 (AJL 01175)
Standard ADs	EASA AD 2022-0152 PARA 1 (EASB139-	ATA 64-TAIL ROTOR DUPLEX BEARING INSPECTION AND	-	-	-/SUPERSEDED	TIC-AW139-22-0157 27 JULY 2022
	725 REV / PART1	REPLACEMENT (BFF AND EVERY 10FH)				9M-PMD-12172 @ 1383:35 FH ON
						28.07.2022 (AJL 01145) - 1ST COMPLIANCE
Standard ADs	EASA SIB 2019-09 R1	1Y INSP ELT & PLB ANNUAL TEST	22/08/2022	-	-/COMPLIED WITH	TIC-GEN-19-056
						WP-PMD-20-2417 @ 423:10FH ON
						11/12/2020
						9M-PMD-7624 @ 1012:45 FH ON 10/12/2021
						(AJL 05720)
COMPONENT ADs	, ;	1	I	1		



maintenance.repair.overhaul	
-----------------------------	--

Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	4
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2019-0235 PARA 3 (ACR SB1000 REV. D PARA 8)	EMERGENCY LOCATOR TRANSMITTER- INSPECTION/ MODIFICATION/ REPLACEMENT	10/12/2021	09/12/2022	-/NOT APPLICABLE	APPLICABLE TO AW139 S/N 31809. ELT FITTED WITH MODEL C406-2HM P/N 453-
						5001 S/N 210-09229. REFER TO TIC-GEN-19
						-090
						WP-PMD-19-832 @ 50:25FH ON 24/01/2020 WP-PMD-20-2417 @ 423:10FH ON 11/12/2020 (AJL 03199) 9M-PMD-7624 @ 1012:45 FH ON 10/12/2021 (AJL 05720)
Standard ADs	EASA AD 2022-0209-E (SB 139-731 REV./ PART 1)	ATA 91 HARNESS INSTALLATION FORWARD ROOF AREA	1456.33	-	-/COMPLIED WITH	9M-PMD-13067
Standard ADs	EASA AD 2022-0209-E (SB 139-731 REV./ PART 2)	ATA 91 HARNESS INSTALLATION FORWARD ROOF AREA	1456.33	-	-/COMPLIED WITH	9M-PMD-13067
Standard ADs	EASA AD 2017-0175-E (SB 139-508 REV. /)	MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0319 DATED 27 AUGUST 2021 NOT APPLICABLE. AIRCRAFT IS FITTED WITH NOT AFFECTED SERIAL NUMBER MRB WHICH ARE S/N 4236, 4235, 4156,
Standard ADs	EASA AD 2018-0132, NEW ISSUE	TIME LIMIT/MAINTENANCE CHECKS - AIRWORTHINESS LIMITATION SECTION - AMENDMENT / IMPLEMENTATION	-	-		4170, 4142. TIC-AW139-21-0323. COMPLIED WITH. LATEST REVISION OF RMPAOF/CAMO/AMP/AW139 HAD INCORPORATED THE DOCUMENT 39-A- AMPI-00-P CHAPTER 4 LATEST ISSUE (ALS).
Standard ADs	EASA AD 2018-0208 (SB139-533)	EMERGENCY FLOTATION SYSTEM - AFT FLOAT ASSEMBLY INFLATION SYSTEM - REMOVAL / INSTALLATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0324 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO DIFFERENT PART NUMBER INSTALLED.
Standard ADs	EASA AD2019-0022 (SB139-571 REV./)	ATA 64 - TAIL ROTOR DUPLEX BEARING REPLACEMENT	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0326 DATED 27 AUGUST 2021. NOT APPLICABLE DUE TO TAIL ROTOR (TR) DUPLEX BEARINGS S/N NOT AFFECTED. AIRCRAFT FITTED WITH TRDB P/N 3G6430V00153, S/N 17198.



naintenance.re	pair.overhaul
----------------	---------------

Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	5
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2019-0073 (ASB 139-580)	ATA 64 TAIL ROTOR FULL ICE PROTECTION SYSTEM TAIL ROTOR BLADES INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0327 DATED 27 AUGUST 2021. NOT APPLICABLE DUE TO FIPS KIT NOT INSTALLED.
Standard ADs	EASA AD 2019-0149 (ASB 139-593 REV./)	ATA 71 - POWER PLAN - ENGINE MOUNTING RODS)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0328 DATED 27 AUGUST 2021 NOT APPLICABLE. AIRCRAFT NOT FITTED WITH AFFECTED SERIAL NUMBER. AIRCRAFT FITTED WITH PART NUMBER: 3G7120V00132, SERIAL NUMBER: 02887, 02888, 02889, 02890.
Standard ADs	EASA AD2019-0036 (SB139-567)	ATA 63 - MAIN ROTOR DRIVE - MAIN GEAR BOX BEARING LOCT NUT - REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2019-0174
Standard ADs	AD NO. 2022-0287, NEW ISSUE	SEAT BELT RESTRAINT SYSTEM - INSPECTION	-	-		TIC-GEN-22-0024 DATED 27 JANUARY 2022 NOT APPLICABLE. GAM CAMO FLEET DO NOT MANAGE MBB-BK117 C-2, D-2 AND D- 3 HELICOPTERS.
Standard ADs	AD NO. 2022-04-09, NEW ISSUE	OXYGEN CYLINDER AND VALVE ASSEMBLIES AND OXYGEN VALVE ASSEMBLIES	-	-		TIC-GEN-22-0057 DATED 01 MARCH 2022 NOT APPLICABLE TO ALL GAM CAMO FLEET DUE TO AIRCRAFT TYPE NOT AFFECTED.
Standard ADs	AD NO. 2022-01-03, NEW ISSUE	UMLAUT ENGINEERING GMBH (PREVIOUSLY P3 ENGINEERING GMBH) HAFEX (HALON-FREE) HAND-HELD FIRE EXTINGUISHERS	-	-	-/FOR INFO ONLY	TIC-GEN-22-0039 DATED 03 FEBRUARY 2022 NOT APPLICABLE. GAM CAMO LEONARDO AND AIRBUS HELICOPTERS FLEET ARE ONLY AFFECTED BY EASA AD AND IN THIS CASE IT IS THE EASA AD 2020-0013.
Standard ADs	AD NO. 2022-03-15,NEW ISSUE	FUEL QUANTITY INDICATOR	-	-		TIC-GEN-22-0045 DATED 15 FEBRUARY 2022. NOT APPLICABLE TO ANY GAM CAMO FLEET DUE TO AIRCRAFT TYPE NOT AFFECTED.
Standard ADs	AD NO. 2022-0024, NEW ISSUE	FLIGHT MANAGEMENT COMPUTER 2 / NAVIGATION MODULES - OPE	-	-	-/NOT APPLICABLE	TIC-GEN-22-0042 07 FEBRUARY 2022. NOT APPLICABLE. GAM CAMO FLEET NOT EQUIPPED WITH FLIGHT MANAGEMENT COMPUTER 2 NAVIGATION MODULES PART NUMBER: C13084CA03



naintenance.repair.overhaul

Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	6
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	
Standard ADs	AD N0. G-2021-003, NEW ISSUE	LIFE JACKET - INSPECTION	-	-		TIC-GEN-21-0137 DATED 09 JUNE 2021.
						EMERGENCY BREATHING SYSTEM (EBS)
						PART NUMBER 12677009, AS FITTED TO
						THE SURVITEC HALO PASSENGER
						LIFEJACKET P/NS 00031010 AND 00031031.
						NOT APPLICABLE TO GAM CAMO FLEET.
Standard ADs	AD NO. G-2021-0004, NEW ISSUE	LIFE RAFT - INSPECTION	-	-	-/NOT APPLICABLE	TIC-GEN-21-0150 DATED 29 JUNE 2021
						SURVITEC LIFE RAFT WITH PACKED
						ASSEMBLY PART NUMBER 00051054
						(PORT) AND 00051055 (STARBOARD).
						NOT APPLICABLE TO GAM CAMO FLEETS.
Standard ADs	EAD N0. G-2021-0010-E, NEW ISSUE	FUEL - CYLINDER QUICK SHUT-OFF VALVE MOUNTING FLANGE -	-	-	-/NOT APPLICABLE	TIC-GEN-21-0220 DATED 04 OCTOBER
		INSPECTION/REPLACEMENT				2021
						CAMEROON BALLON FUEL CYLINDERS
						WITH PART NUMBER: CB2901, CB2902,
						CB2903
						NOTE: NOT APPLICABLE TO GAM CAMO
						FLEET
Standard ADs	EASA AD NO. 2021-0185, REVISION 2	HAFES (HALON-FREE) HAND-HELD FIRE EXTINGUISHERS	-	-	-/NOT APPLICABLE	TIC-GEN-21-0194 DATED 16 AUGUST 2021
						HAFEX (HALON-FREE) HAND-HELD FIRE
						EXTINGUISHERS, HAVING PART NUMBER
						(P/N) P3APP003010A, P/N P3APP003010B
						OR P/N P3APP003010C, ALL SERIAL
						NUMBERS (S/N).
						NOT APPLICABLE TO GAM CAMO FLEET
ENGINE #1 AD	T					
Standard ADs	AD CF-2012-24	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #1)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0332
						NOT APPLICABLE DUE TO ENGINE IS
						POST-SB 41056.
ENGINE #2 AD						
Standard ADs	AD CF-2012-24	SECOND STAGE POWER TURBINE DISK DAMAGE (ENG #2)	-	-	-/NOT APPLICABLE	TIC-AW139-21-0332
						NOT APPLICABLE DUE TO ENGINE IS
						POST-SB 41056.
AIRFRAME ADs	FASA AD 2016 0140		1			
Standard ADs	EASA AD 2016-0140	MAI ROTOR - MAIN ROTOR DAMPER - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0160
		REPLACEMENT				



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	7
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2016-0246	ATA 65 - TAIL ROTOR DRIVE - TAIL GEARBOX CENTRAL HOUSING	-	-	-/NOT APPLICABLE	TIC-AW139-21-0314 DATED 27 AUGUST
		- DIMENSIONAL CHECK / REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS NOT
						FITTED WITH AFFECTED CENTRAL
						HOUSING PART NUMBER (P/N
						3T6522A05144 OR P/N 3T6522A05146).
Standard ADs	EASA AD 2016-0255R1	ATA 63 - MAIN ROTOR DRIVE - MAIN GEARBOX INPUT MODULE -	-	-	-/NOT APPLICABLE	TIC-AW139-21-0316 DATED 27 AUGUST
		REPLACEMENT				2021
						NOT APPLICABLE. THIS IS BECAUSE
						AIRCRAFT IS FITTED WITH MGB INPUT
						MODULE P/N 3K6320A00136 HAVING NOT
						AFFECTED S/N KHI-L48 AND S/N KHI-L54
Standard ADs	EASA AD 2017-0028-E	ATA 62 - MAIN ROTOR - ROTATING SCISSORS - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0315 DATED 27 AUGUST
		REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS NOT
						FITTED WITH AFFECTED P/N
						3G6230V00654, BUT FITTED WITH P/N
						3G6230V00655.
Standard ADs	EASA AD 2018-0112R1	ATA 62 - MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION /	-	-	-/COMPLIED WITH	TIC-AW139-21-0321 DATED 27 AUGUST
		REPLACEMENT				20212.
						PART A: APPLICABLE DUE TO AIRCRAFT
						FITTED WITH AFFECTED MAIN ROTOR
						DAMPERS.
						PART B: NOT APPLICABLE TO MAIN
						ROTOR DAMPERS FITTED ON AIRCRAFT.
Standard ADs	EASA AD 2018-0130	ATA 62 - MAIN ROTOR - MAIN ROTOR BLADES - INSPECTION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0322 DATED 27 AUGUST
						2021
						NOT APPLICABLE DUE TO MAIN ROTOR
						BLADES ARE NOT AFFECTED BY THIS AD.
Standard ADs	EASA AD 2017-0011 (BT 139-465 REV A	ATA 65 TAIL ROTOR - TAIL ROTOR DRIVE SHAFT - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0317 DATED 17 AUGUSTR
)	MODIFICATION				2021
						NOT APPLICABLE PER HELICOPTER
						SERIAL NUMBER



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	8	
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35	

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2021-0121, NEW ISSUE (ASB	ATA 63 MAIN ROTOR DRIVE MAIN GEARBOX BEARING LOCK	0.00	28000.00	-/TO BE COMPLIED	TIC-AW139-21-0228 DATED 05 MAY 2021
	139-609)	NUT REPLACEMENT				APPLICABILITY: APPLICABLE DUE TO
						AFFECTED MGB PN 3G6320A00134 FITTED
						ON AIRCRAFT. COMPLIANCE WITHIN 2000
						LANDING UPON REACHING 26000
				LANDINGS OR AT NEXT OVERHAUL,		
						WHICH OCCURS FIRST.
Standard ADs	EASA AD 2020-0011, REVISION 1	ATA 63 - MAIN GEAR BOX - BEARING LOCK NUT - REPLACEMENT	0.00	28000.00	-/SUPERSEDED	SUPERSEEDED BY EASA AD 2021-0121
Standard ADs	EASA AD 2015-0226 REV 7 PARA 1, 2 &	ATA 25 - EQUIPMENT/FURNISHING - HOIST - TEST /	-	-	-/COMPLIED WITH	TIC-AW139-22-0124 DATED 23 MAY 2022.
	9	REPLACEMENT				APPLICABLE TO DUE TO COMPONENT
						GOOGRICH HOIST PART NUMBER 44316-
						12-104 FITTED ON AIRCRAFT. COMPLIED
						BY OEM. REFER ANNEX 1 -
						AIRWORTHINESS DIRECTIVE
Standard ADs	EASA AD 2020-0131 (SBA 139-637)	ATA 25 HOIST CABLE CUTTER FRAME INSTALLATION		-	-/COMPLIED WITH	TIC-AW139-20-094 DATED 06 JUNE 2020
						WP-PMD-20-1114 AT 289:25FH ON
						09/09/2020 (AJL 02888)
Standard ADs	EASA AD NO. 2020-0013 (SB 139-614)	ATA 26 - FIRE PROTECTION - HAND-HELD FIRE EXTINGUISHERS -	-	-	-/COMPLIED WITH	TIC-AW139-20-007 DATE ISSUE 30
		REPLACEMENT				JANUARY 2020.
						WP-PMD-20-014 AT 50:25 FH ON 17/02/2020
						WORK ORDER GAM/WO/20/014 FOR
						COMPLIANCE REFER TO LH SB 139-614,
						SPARE 03X AFFECTED FIREX ORDERED
						UNDER MMIR.



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	9	
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35	

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2019-0311, NEW ISSUE (SBA	ATA 25, 95 EQUIPMENT / FURNISHINGS, EMERGENCY	03/12/2020	-	-/COMPLIED WITH	REFER TO TIC-AW139-19-127.APPLICABLE
	NO. 139-610, NEW ISSU	FLOTATION SYSTEM INFLATION HOSES INSPECTION				TO AIRCRAFT TYPE AND S/N
						CARRIED OUT AS PER WP-PME-20-1526 @
						247:50 FH ON 27/08/2020 (AJL 03207)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 195
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 189
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 183
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 186
						CARRIED OUT AS PER WP-PMD-20-2200 @
						419:55 FH ON 03/12/2020 (AJL 03196)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 174
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 165
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 163
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 140



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	10	
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35	

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs		ATA 25, 95 EQUIPMENT / FURNISHINGS, EMERGENCY	419.92	-	-/COMPLIED WITH	REFER TO TIC-AW139-19-127.APPLICABLE
	NO. 139-610, NEW ISSU	FLOTATION SYSTEM INFLATION HOSES INSPECTION				TO AIRCRAFT TYPE AND S/N
						CARRIED OUT AS PER WP-PME-20-1526 @
						247:50 FH ON 27/08/2020 (AJL 03207)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 195
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 189
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 183
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 186
						CARRIED OUT AS PER WP-PMD-20-2200 @
						419:55 FH ON 03/12/2020 (AJL 03196)
						A. 3G9560V02131 L/H FWD FLOAT
						ASSEMBLY SN: 174
						B. 3G9560V02231 R/H FWD FLOAT
						ASSEMBLY SN: 165
						C. 3G9560V02331 L/H AFT FLOAT
						ASSEMBLY SN: 163
						D. 3G9560V02431 R/H AFT FLOAT
						ASSEMBLY SN: 140
Standard ADs		ATA-64, T/R SLIDER ASSEMBLY - INSPECTION	0.00	2450.00	-/TO BE COMPLIED	REFER TO TIC-AW139-21-0325 DATED 27
	B PART I)					AUGUST 2021.
						APPLICABLE DUE TO AIRCRAFT FITTED
						WITH TAIL ROTOR SLIDER ASSEMBLY P/N
						3G6430A00131.
Standard ADs	EASA AD 2019-0174 (ASB 139-567	ATA 63 - MGB BEARING LOCK-NUT REPLACEMENT	0.00	30000.00	-/SUPERSEDED	SUPERSEDED BY EASA AD 2020-0011
	REV.A)					
Standard ADs	EASA AD 2007-0142	WINDOWS - COCKPIT DOORS WINDOWS SEALING -	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2008-0011
		INSPECTION/REPAIR/REPLACEMENT				
Standard ADs	EASA AD 2008-0011	WINDOWS - COCKPIT DOORS WINDOWS AND SEALING -	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2008-0108
		INSPECTION/REPAIR/REPLACEMENT/MODIFICATION				



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	11
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2008-0157	FUSELAGE - TAIL BOOM ASSEMBLY - INSPECTION / REPAIR /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0198-E
		REPLACEMENT				
Standard ADs	EASA AD 2009-0124	EQUIPMENT/FURNISHING - LIFESAVING SYSTEMS' D-LOCK HOOK	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0148-E
		OF THE RESCUE HIOST - INSPECTION/REPLACEMENT				
Standard ADs	EASA AD 2009-0148-E	EQUIPMENT/FURNISHING - D-LOCK HOOK OF THE RESCUE HIOST	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0179-E
		- INSPECTION/REMOVAL FROM SERVICE/REPLACEMENT				
Standard ADs	EASA AD 2009-0179-E	EQUIPMENT/FURNISHING - D-LOCK HOOK OF THE RESCUE HIOST	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0183-E
		- INSPECTION/REMOVAL FROM SERVICE/REPLACEMENT				
Standard ADs	EASA AD 2009-0198-E	FUSELAGE - TAIL BOOM - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2009-0234-E
Standard ADs	EASA AD 2009-0234-ER1	FUSELAGE - TAIL BOOM - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2011-0019
Standard ADs	EASA AD 2017-0124R1	TIME LIMITS/ MAINTENANCE CHECKS - AIRWORTHINESS	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2018-0132
		LIMITATIONS				
Standard ADs	EASA AD 2011-0205R1	AT 55 STABILIZER TAIL FIN ASSEMBLY INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0124R1
		REPLACEMENT				
Standard ADs EASA AD 2014-0215-E MAIN ROTOR - ROTATING SCISSORS - INSPECTION /		-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0028-E	
		MODIFICATION				
Standard ADs	EASA AD 2016-0087	MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2016-0140
		REPLACEMENT				
Standard ADs	EASA AD NO 2016-0077	LANDING GEAR - MAIN LANDING GEAR SHOCK ABSORBER	-	-	-/NOT INSTALLED	TIC-AW139-21-0302 DATED 27 AUGUST
		SCREWS - REPLACEMENT				2021
						NOT APPLICABLE DUE TO KIT INCREASED
						GROSS WEIGHT 6800 KG PART NUMBER
						4G0000F00111 NOT INSTALLED.
Standard ADs	EASA AD 2015-0160	EQUIPMENT / FURNISHINGS - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2015-0226
Standard ADs	EASA AD 2015-0069	EQUIPMENT / FURNISHINGS - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2015-0160
Standard ADs	EASA AD 2014-0254	EQUIPMENT / FURNISHING - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2015-0069
Standard ADs	EASA AD 2014-0201	EQUIPMENT / FURNISHING - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0254
Standard ADs	EASA AD 2014-0073-E	MAIN ROTOR - ROTATING CONTROLS - LOWER HALF SCISSOR	-	-	-/SUPERSEDED	SUPERSEDED BY EASA EAD 2014-0215-E
		SPHERICAL BEARING - INSPECTION / REPLACEMENT				
Standard ADs	EASA AD 2014-0028	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0172
		CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT /				
		AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND				
		REPETITIVE CHECK / AC GENERATOR CONTROL UNIT				
		REPLACEMENT				



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	12
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	
Standard ADs	EASA AD 2013-0298	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0028
		CABLE INSPECTION TAIL ROTOR DISTRIBUTOR REPLACEMENT /				
		AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND				
		REPETITIVE CHECK / AC GENERATOR CONTROL UNIT				
		REPLACEMENT				
Standard ADs	EASA AD 2013-0275R1	EQUIPMENT / FURNISHING - HOIST - TEST / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2014-0201
Standard ADs	EASA AD 2013-0174	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0298
		CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT				
Standard ADs	EASA AD 2013-0124	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0174
		CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT				
Standard ADs	EASA AD 2013-0090	ICE AND RAIN PROTECTION - FULL ICING PROTECTION SYSTEM /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0124
		CABLES - INSPECTION				
Standard ADs	EASA AD 2013-0077R1	EQUIPMENT / FURNISHING - HOIST - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0275
		REPLACEMENT				
Standard ADs	EASA AD 2013-0065-E	EQUIPMENT / FURNISHING - HOIST - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2013-0077-E
		REPLACEMENT				
Standard ADs	EASA AD 2012-0030	TAIL ROTOR TAIL ROTOR BLADES INSPECTION / REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2012-0076
Standard ADs	CF-2012-24 (SB A41060)	SECOND STAGE POWER TURBINE DISK DAMAGE #1	-	-	-/N/A (POST-MOD)	
Standard ADs	EASA AD NO 2011-0207	ATA 29 - HYDRAULIC POWER - HYDRAULIC SYSTEM -		-	-/COMPLIED WITH	TIC-AW139-21-0291 DATED 27 AUGUST
		OPERATIONAL CHECKS/ REPLACEMENT				2021
						APPLICABLE TO AIRCRAFT SERIAL
						NUMBER.COMPLIED WITH. OPERATIONAL
						CHECK PERFORMED DURING
						PRODUCTION. REFER ANNEX 1 -
						AIRWORTHINESS DIRECTIVES.
Standard ADs	EASA AD 2011-0156-E	TAIL ROTOR - TAIL ROTOR BLADES - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2012-0030
		REPLACEMENT [REDUCED LIFE LIMITATION]				
Standard ADs	EASA AD 2011-0081	TAIL ROTOR - TAIL ROTOR BLADES - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2011-0156-E
Standard ADs	EASA AD 2010-0237-CN	CANCELLED: EQUIPMENT / FURNISHINGS - SPECTROLAB	-	-	-/CANCELLED	TIC-AW139-21-0296
		NIGHTSUN XP SEARCHLIGHT - INSPECTION / REMOVAL /				AD CANCELLED.
		REPLACEMENT				
Standard ADs	EASA AD 2010-0183R1	EQUIPMENT / FURNISHINGS - SPECTROLAB NIGHTSUN XP	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2010-0237
		SEARCH				
Standard ADs	EASA AD 2006-0358R1	STABILIZERS - FIN ASSEMBLY - INSPECTION/REPLACEMENT	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2011-0205
Standard ADs	EASA AD 2017-0160	ATA 62 MAIN ROTOR - MAIN ROTOR DAMPER - INSPECTION /	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD NO 2018-0112
		REPLACEMENT				



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	13	
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35	

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2021-0044 REV 1 PARA (1) (ASB139-661 REV B)	ATA 24 OVERHEAD PANEL INSPECTION	518.92	-	-/COMPLIED WITH	TIC-AW139-22-0120 DATED 13 MAY 2022 9M-PMD-5803 ON 08/02/2021 AT 518:55 FH (AJL 03490)
Standard ADs	EASA AD 2020-0271 PARA (1) (SBA 139-654 REV./ PART I)	ATA 62 MAIN ROTOR SWASHPLATE BOOT INSPECTION	429.42	-	-/COMPLIED WITH	TIC-AW139-20-201 DATED 09 DECEMBER 2020 WP-PMD-20-2577 AT 425:25 FH ON 15/12/2020 (AJL 03453)
Standard ADs	EASA AD 2015-0226 REV 7 PARA 4	ATA 25-EQUIPMENT / FURNISHINGS - HOIST - TEST / REPLACEMENT	-	-	-/ON CONDITION	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST PART NUMBER 44316- 12-104 FITTED ON AIRCRAFT. COMPLY IF HOIST LOAD CHECK/TEST REQUIRED BY PARAGRAPH 2 AND 3 OF THIS AD, THE HOIST FAILS THE TEST, DEACTIVE THE HOIST AND, BEFORE NEXT HOIST OPERATION, REPLACE THE HOIST WITH A SERVICABLE HOIST, AS DEFINED IN TABLE 2 OF THIS AD.
Standard ADs	EASA AD 2015-0226 REV 7 PARA 5, 8 & 12	ATA 25- EQUIPMENT/FURNISHINGS- HOIST- TEST REPLACEMENT	-	-	-/FOR INFO ONLY	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT. INFORMATION ONLY
Standard ADs	EASA AD 2015-0226 REV 7 PARA 10	ATA 25-EQUIPMENT/FURNISHINGS-HOIST-TEST/REPLACEMENT	-	-	-/COMPLIED WITH	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST P/N 44316-12-104 FITTED ON AIRCRAFT.
Standard ADs	EASA AD 2015-0226, REV 7 PARA 11	ATA 25-EQUIPMENT/FURNISHINGS-HOIST-TEST/REPLACEMENT	-	-	-/ON CONDITION	TIC-AW139-22-0124 DATED 23 MAY 2022. APPLICABLE TO DUE TO COMPONENT GOOGRICH HOIST PART NUMBER 44316- 12-104 FITTED ON AIRCRAFT. COMPLY IF A PARTIAL PEEL OUT OCCURS, BEFORE NEXT FLIGHT, REMOVE OR DEACTIVEATE THE HOIST OR, BEFORE NEXT HOIST OPERATION, REPLACE THE HOIST WITH A SERVICABLE HOIST, NOTING THE INSTALLATION REQUIREMENT OF PARAGRAPH 8.



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	14
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD 2020-0011, REVISION 1	ATA 63 - MAIN GEAR BOX - BEARING LOCK NUT - REPLACEMENT	0.00	6000.00	-/SUPERSEDED	SUPERSEEDED BY EASA AD 2021-0121
Standard ADs	EASA AD NO 2006-0360-E	ATA 78 - EXHAUST - TAILPIPE ASSEMBLY - INSPECTION/REPAIR/REPLACEMENT	-	-		TIC-AW139-21-0284 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO TAILPIPE ASSEMBLIES AFFECTED BY THIS AD ARE
Standard ADs	EASA AD 2008-0108	ATA 56 - WINDOWS - COCKPIT DOOR WINDOWS - REPLACEMENT		-		NOT INSTALLED ON AIRCRAFT. REFER TO TIC-AW139-21-0305 DATED 27 AUGUST 2021. NOT APPLICABLE TO SERIAL NUMBER.
Standard ADs	EASA AD NO 2009-0042	ATA 24 - ELECTRICAL POWER - GENERATOR CONTROL UNIT (GCU) - REPLACEMENT	-	-		TIC-AW139-21-0286 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO DIFFERENT PART NUMBER
Standard ADs	EASA AD NO 2015-0172 (BT 139-374)	ATA 32 - LANDING GEAR- EMERGENCY FLOTATION SYSTEM CONTROL PANEL - REPLACEMENT	-	-		TIC-AW139-21-0301 DATED 27 AUGUST 2021 NOT APPLICABLE, AIRCRAFT IS FITTED WITH PN: 3G9560V00559
Standard ADs	EASA AD NO 2015-0155	ATA 30 - ICE AND RAIN PROTECTION - FULL ICE PROTECTION SYSTEM TAIL ROTOR SLIP RING-INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0300 DATED 27 AUGUST 2021. NOT APPLICABLE DUE TO AIRCRAFT IS NOT EQUIPPED WITH FIPS.
Standard ADs	EASA AD NO 2014-0172	ATA 30 - ICE AND RAIN PROTECTION -FULL ICING PROTECTION SYSTEM / CABLE INSPECTION - TAIL ROTOR DISTRIBUTOR REPLACEMENT / AUTO TRANSFORMER RECTIFIER UNIT REPLACEMENT AND REPETITIVE CHECK / AC GENERATOR CONTROL UNIT REPLACEMENT	-	-		TIC-AW139-21-0299 NOT APPLICABLE DUE TO AIRCRAFT NOT EQUIPPED WITH FIPS (FULL ICING PROTECTION SYSTEM).
Standard ADs	EASA AD 2014-0048 (BT 139-311 REV B)	ATA 53 - FUSELAGE - SUBFLOOR FRAME STA 2105 - INSPECTION / MODIFICATION	-	-		TIC-AW139-21-0298. NOT APPLICABLE TO AIRCRAFT SERIAL NUMBER
Standard ADs	EASA AD NO 2013-0177	ATA 29 - HYDRAULIC POWER - FLEXIBLE HYDRAULIC HOSES - REPLACEMENT	-	-		TIC-AW139-21-0297 DATED 27 AUGUST 2021 NOT APPLICABLE: MODIFICATION ALREADY INCORPORATED IN THE HELICOPTER.
Standard ADs	EASA AD NO 2012-0262	ATA 32 - LANDING GEAR - NOSE LANDING GEAR ARM PIN INSTALLATION - INSPECTION	-	-		TIC-AW139-21-0295 DATED 27 AUGUST 2021 NOT APPLICABLE TO AIRCRAFT SERIAL NUMBER.



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	15	
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35	

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2012-0213-E	ATA 27 - FLIGHT CONTROL -COLLECTIVE AND CYCLIC CONTROL SYSTEM -INSPECTION / RESTORATION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0294 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard ADs	EASA AD 2012-0076R2	ATA 64 - TAIL ROTOR-TAIL ROTOR BLADES-INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0293 NOT APPLICABLE DUE TO AIRCRAFT ALREADY FITTED WITH SERVICABLE TAIL ROTOR BLADE PART NUMBER 3G6410A00133.
						NOT APPLICABLE: INSTALLED IMPROVED TAIL ROTOR BLADES WITH P/N NOT AFFECTED (REF. HELICOPTER LOGBOOK)
						THIS AD REVISES EASA AD 2012-0076R1 DATED 13 JULY 2012. THE ORIGINAL ISSUE OF THAT AD SUPERSEDED EASA AD 2012-0030 DATED 17 FEBRUARY 2012.
						INFO IS REFERRED FROM LEONARDO HELICOPTER ANNEX 1 - AIRWORTHINESS DIRECTIVES STATUS LIST DATED 30/07/2019
Standard ADs	EASA AD NO 2011-0226-E	ATA 27 - FLIGHT CONTROL - COLLECTIVE CONTROL SYSTEM	-	-	-/NOT APPLICABLE	TIC-AW139-21-0292 DATED 27 AUGUST 2021. NOT APPLICABLE PER HELICOPTER SERIAL NUMBER NOT AFFECTED
Standard ADs	EASA AD NO 2011-0140, NEW ISSUE	ATA 23 - COMMUNICATIONS - PRIMUS EPIC SYSTEM HARNESSES SOLDER SPLICES - INSPECTION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0290 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO AIRCRAFT SERIAL NUMBER NOT AFFECTED.
Standard ADs	EASA AD NO 2011-0019	ATA 53 - FUSELAGE - TAIL BOOM - INSPECTION / MODIFICATION	-	-	-/NOT APPLICABLE	REFER TIC-AW139-21-0289 DATED 27 AUGUST 2021. NOT APPLICABLE DUE TO AIRCRAFT FITTED WITH TAIL ASSY PART NUMBER 3G5350A00136.
Standard ADs	EASA AD 2006-0357R2	FUSELAGE - FRAME 5700 MIDDLE SECTION - INSPECTION	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2017-0124R1



ĺ	Aircraft Registration:	9M-PMD	Serial No:	31809	Date:	25/01/2023	Page No:	16
	Aircraft Hours:	1548:35	Landings:	2719.00	Engine ⁻	1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2017-0083 NEW ISSUE	ATA 62 - MAIN ROTOR - MAIN ROTOR SLIP RING - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0318 DATED 27 AUGUST
	(SB 139-472)	REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS NOT
						INSTALLED WITH FULL ICE PROTECTION
						SYSTEMS.
Standard ADs	EASA AD NO 2017-0175-E (SB 139-508)	ATA 62 - MAIN ROTOR - MAIN ROTOR BLADES -INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0319 DATED 27 AUGUST
		REPLACEMENT				2021
						NOT APPLICABLE. AIRCRAFT IS FITTED
						WITH NOT AFFECTED SERIAL NUMBER
						MRB WHICH ARE S/N 4236, 4235, 4156,
						4170, 4142.
Standard ADs	EASA AD 2018-0002 NEW ISSUE (SB	ATA 46 - INFORMATION SYSTEMS - "PRIMUS EPIC" SYSTEM	-	-	-/NOT APPLICABLE	TIC-AW139-21-0320.
	139-500)	SOFTWARE - SOFTWARE UPDATE				NOT APPLICABLE DUE TO HELICOPTER
						NOT EQUIPPED WITH PRIMUS EPIC
						SYSTEM SOFTWARE RELEASE 7.4 (PHASE
						7 V1) OR 7.7 (PHASE 7 V3) OR 7.10 (PHASE
						7 V4). HELICOPTER CURRENTLY
						EQUIPPED WITH SOFTWARE RELEASE
						7.12.
Standard ADs	EASA AD 2020-0185, NEW ISSUE	ATA 25- EQUIPMENT/ FURNISHINGS- LIFE RAFT RESERVOIR AND	-	-	-/SUPERSEDED	SUPERSEDED BY EASA AD 2021-0054
		ACTUATOR CABLE- REPLACEMENT/ INSPECTION				
Standard ADs	EASA AD NO. 2020-0191 REV. 1 (ASB	ATA 25 - EQUIPMENT/FURNISHINGS FORWARD FACING CENTRAL	-	-	-/NOT APPLICABLE	TIC-AW139-20-132 DATED 07 SEPTEMBER
	NO. 139-633 REV./)	SEAT(S)-REMOVAL				2020
						NOT APPLICABLE DUE TO FORWARD
						FACING SEAT NOT FITTED ON 1ST ROW.
Standard ADs	EASA AD 2021-0095	ATA 11 - PLACARDS AND MARKINGS - STRETCHER	-	-	-/NOT APPLICABLE	TIC-AW139-21-0209 DATED 01 APRIL 2021
		UNIT/PLACARD - INSTALLATION				COMPLIANCE: NOT APPLICABLE DUE TO
						COMPONENT 3-STRETCHER KIT P/N
						139084-5001 NOT EQUIPPED ON
						AIRCRAFT
Standard ADs	EASA AD 2021-0054 (ASB 139-648 AND	ATA 25 - EQUIPMENT / FURNISHINGS - LIFE RAFT RESERVOIR	-	-	-/NOT APPLICABLE	TIC-AW139-21-0032
	ASB 139-662)	AND ACTUATOR CABLE - REPLACEMENT / INSPECTION.				NOT APPLICABLE DUE TO COMPONENT
						EMERGENCY FLOATATION KIT P/N
						4G9560F00111 OR P/N 4G9560F00211 NOT
						FITTED ON AIRCRAFT THE APPLICABLE
						SB: NOT APPLICABLE TO ASB 139-648 AND
						ASB 139-662



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	17
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	· ·	ATA 53 - TAIL GEAR BOX FITTING INSPECTION (TGB FITTING	-	-	-/CANCELLED	TIC-AW139-21-0396 SUPERSEEDED.
	-686 PART I)	LESS THAN 3000FH)				REFER TIC-AW139-21-0404 FOR AD 2021-
						0259 DATED 17 NOVEMBER 2021
						CORRECTION DATED 22 NOVEMBER 2021
Standard ADs	2009-0183-CN	CANCELLATION NOTICE: EQUIPMENT/FURNISHING - D -LOCK	-	-	-/NOT APPLICABLE	TIC-AW139-21-0287 DATED 27 AUGUST
		HOOK OF THE RESCUE HOIST				2021
						NOT APPLICABLE. CANCELLATION
						NOTICE.
Standard ADs	EASA AD 2010-0189	NAVIGATION - MODULAR AVIONIC UNIT - INSPECTION /	-	-	-/NOT APPLICABLE	TIC-AW139-21-0288 DATED 27 AUGUST
		REPLACEMENT / MODIFICATION				2021
						NOT APPLICABLE TO AIRCRAFT SERIAL
						APPLICABLE TO AIRCRAFT FROM S/N
						31005 TO S/N 31157 (EXCEPT S/N 31007,
						S/N 31094 AND S/N 31149) AND FROM S/N 41001 TO S/N 41023.
Standard ADs	EASA AD 2021-0121, NEW ISSUE (ASB	ATA 63 MAIN ROTOR DRIVE MAIN GEARBOX BEARING LOCK	0.00	6000.00		TIC-AW139-21-0228 DATED 05 MAY 2021
Standard ADS	139-609)	NUT REPLACEMENT	0.00	6000.00	-/TO BE COMPLIED	APPLICABILITY: APPLICABLE DUE TO
	139-609)	NUT REPLACEMENT				AFFECTED MGB PN 3G6320A00134 FITTED
						ON AIRCRAFT. COMPLIANCE WITHIN 2000
						LANDING UPON REACHING 26000
						LANDING OF ON REACTING 20000
						WHICH OCCURS FIRST.
Standard ADs	EASA AD 2021-0186 REV. 1	ATA 25 - EQUIPMENT/FURNISHINGS - EXTERNAL HOIST		-	-/NOT APPLICABLE	TIC-AW139-21-0272 DATED 24 AUGUST
olandara / 120	[CORRECTION]	ASSEMBLY - RATED LOAD CHECK				2021
						NOT APPLICABLE DUE TO AFFECTED
						COMPONENT NOT FITTED ON AIRCRAFT.
						AIRCRAFT FITTED DIFFERENT MODEL
						TYPE HOIST. AIRCRAFT FITTED WITH
						GOODRICH HOIST.
Standard ADs	EASA AD 2021-0259 (ASB 139-686)	ATA 53 - FUSELAGE - TAIL GEARBOX FITTING	0.00	3025.00	-/TO BE COMPLIED	TIC-AW139-21-0404
	[CORRECTION]	INSPECTION/REPLACEMENT, ONCE REACH 3000FH,				TO COMPLY WITHIN 25FH ONCE
		COMPLIANCE WITHIN 25FH)				EFFECTED COMPONENT REACH 3000FH
						SINCE INSTALLATION



Airc	craft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	18
Airc	craft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2008-0148	ATA 53 - FUSELAGE - WIRE STRIKE PROTECTION SYSTEM (WSPS) TOP CABLE CUTTER - REWORK / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0285 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO AIRCRAFT NOT EQUIPPED WITH WIRE STRIKE PROTECTION SYSTEM.
Standard ADs	EASA AD 2015-0226 REV 7 PARA 6	ATA 25- EQUIPMENT/FURNISHING-HOIST-TEST/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-22-0124 DATED 23 MAY 2022. NOT COMPLIED DUE TO HOIST INSTALLED WITH NEW OVERCLUTCH ASSEMBLY.
Standard ADs	EASA SIB NO. 2021-14, NEW ISSUE	HAND-OPERATED FIRE EXTINGUISHERS - REMOVAL FROM SERVICE	-	-	-/FOR INFO ONLY	TIC-GEN-21-0154 DATED 02 JULY 2021 COMPLIANCE TIME: NOT APPLICABLE. ACTION REQUIRED: FOR INFORMATION ONLY.
Standard ADs	AD NO. 2007-0256-CN, NEW ISSUE	ATA 25 - EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION / REPLACEMENT	-	-	-/CANCELLED	REFER TIC-AW139-21-0304. NOT APPLICABLE DUE AD CANCELLED
Standard ADs	EASA AD NO 2007-0156	COMMUNICATION - COMM UNITS & TRANSPONDERS - MODIFICATION/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0303 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO MODE S TRANSPONDER INSTALLED ON AIRCRAFT IS NOT AFFECTED BY THIS AD.
Standard ADs	EASA AD NO 2007-0256	EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION/REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0304 DATED 27 AUGUST 2021 NOT APPLICABLE DUE TO DIFFERENT EQUIPMENT INSTALLED.
Standard ADs	EASA AD NO 2009-0251-E	FIRE PROTECTION - PORTABLE FIRE EXTINGUISHER - IDENTIFICATION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0306 DATED 27 AUGUST 2021. NOT APPLICABLE DUE TO FIRE EXTINGUISHERS INSTALLED ON HELICOPTER ARE NOT AFFECTED BY THIS AD.
Standard ADs	EASA AD NO 2009-0262R1	FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHER - IDENTIFICATION / REPLACEMENT	-	-	-/NOT APPLICABLE	TIC-AW139-21-0307 DATED 27 AUGUST 2021. NOT APPLICABLE. AFFECTED PN NOT FITTED IN AIRCRAFT.



Aircraft Registration:	9M-PMD	Serial No:	31809	Date: 25/01/2023	Page No:	19	
Aircraft Hours:	1548:35	Landings:	2719.00	Engine 1: 1548:35	Engine 2:	1548:35	

Types	AD Number	Subject	Last Done	Next Due	Interval/Status	Limitation Notes
Standard ADs	EASA AD NO 2010-0062R1	FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHER -	-	-	-/NOT APPLICABLE	TIC-AW139-21-0308 DATED 27 AUGUST
		IDENTIFICATION / REPLACEMENT				2021
						NOT APPLICABLE DUE TO AIRCRAFT
						EQUIPPED WITH DIFFERENT
						MANUFACTURER.
Standard ADs	EASA AD 2014-0125	ATA 25 - EQUIPMENT/FURNISHINGS - CRASH POSITION	-	-	-/NOT APPLICABLE	TIC-AW139-21-0311 DATED 27 AUGUST
		INDICATOR SYSTEM - REPLACEMENT ; AIRCRAFT FLIGHT				2021.
		MANUAL - AMENDMENT				NOT APPLICABLE DUE TO KIT ELT
						DEPLOYABLE NOT INSTALLED IN
						AIRCRAFT.