

Leonardo S.p.A. Via Giovanni Agusta, 520 21017 Cascina Costa di Samarate (VA) Italy Tel.: +39 0331 229111 - Fax: +39 0331 229605/222595

AgustaWestland Products

SERVICE BULLETIN

ALERT

№ 139-661

DATE:	February 4, 2021			
REV. :	A - February 18, 2021			

TITLE

ATA 24 – OVERHEAD PANEL INSPECTION

REVISION LOG

Helicopters already compliant with Part I of the first issue of this Service Bulletin do not need to comply with the Part I of the revision A of this Service Bulletin.

Revision A of this Service Bulletin has been issued to:

- Introduce alternative tape P/Ns;
- Update fastener measurement procedure.



1. PLANNING INFORMATION

A. EFFECTIVITY

Part I:

All AB/AW139 helicopters from S/N 31005 thru S/N 31927, from S/N 41001 thru S/N 41576 and from S/N 41801 thru S/N 41806, except the S/Ns listed in table 1.

HELICOPTERS S/Ns				
31789	31899		31916	
31792	31900	0	31917	
31800	31901		31919	
31803	31902		31921	
31814	31903		31924	
31836	31907		41562	
41563		e 1	41574	

Table 1

Part II:

All AB/AW139 helicopters.

B. COMPLIANCE

Part I:

Within and not later than twenty-five (25) FH from the first issue date of this Service Bulletin.

Part II:

Every three hundred (300) FH or one (1) year whichever occurs first after the compliance with Part I of this Service Bulletin or after the first issue date of this Service Bulletin for those helicopters for which the Part I is not applicable.

C. CONCURRENT REQUIREMENTS



D. REASON

This Service Bulletin is issued in order to prescribe an inspection of the overhead panel cable harnesses, anchor nuts, screws and supports, to locate potential chafing conditions.

E. DESCRIPTION

Part I of this Service Bulletin is developed to prescribe a one-off inspection inside the overhead panel, in order to check:

- the absence of chafing between the anchor nuts/screws and the cable harnesses;
- the correct lengths of the screws fixing the Circuit Breaker Panel and the lining panels prescribing, in case of findings, their replacement with new ones;
- the condition of the supports fixing the cable harnesses;
- the presence of a clearance of at least 10.0 mm between an anchor nut and the cable harnesses. In case the clearance is not respected, cable harnesses must be properly re-routed.

Moreover, this SB prescribes the application of a white protective tape on the anchor nuts in order to avoid chafing with the cable harnesses.

Part II of this Service Bulletin is developed to prescribe a recurrent inspection inside the overhead panel in order to check the tape condition and the absence of chafing.

F. APPROVAL

The technical content of this Service Bulletin is approved under the authority of DOA nr. EASA.21.J.005. For helicopters registered under other Aviation Authorities, before applying the Service Bulletin, applicable Aviation Authority approval must be checked within Leonardo Helicopters customer portal.

EASA states mandatory compliance with inspections, modifications or technical directives and related time of compliance by means of relevant Airworthiness Directives. If an aircraft listed in the effectivity embodies a modification or repair not LH certified and affecting the content of this Service Bulletin, it is responsibility of the Owner/Operator to obtain a formal approval by Aviation Authority having jurisdiction on the aircraft, for any adaptation necessary before incorporation of the present Service Bulletin.

G. MANPOWER

To comply with this Service Bulletin, the following MMH are deemed necessary:

<u>Part I</u>: approximately six (6) MMH if terminal boards bonding and/or cable harness rerouting are also required, otherwise approximately three (3) MMH;

Part II: approximately two (2) MMH;



MMH are based on hands-on time and can change with helicopter configuration, personnel and facilities available.

H. WEIGHT AND BALANCE

N.A.

I. REFERENCES

1) PUBLICATIONS

Following Data Modules refer to AMP:

DATA MODULE		DESCRIPTION	<u>PART</u>
DM01	39-A-00-20-00-00A-120A-A	Helicopter on ground for a safe maintenance.	I, II
DM02	39-A-24-91-01-00A-520A-A	Circuit breaker panel - Remove procedure	1,11
DM03	39-A-24-91-01-00A-720A-A	Circuit breaker panel - Install procedure	1,11
DM04	39-A-20-10-19-00A-920A-A	Plastic loom support - Replacement	Ι

2) ACRONYMS & ABBREVIATIONS

AMP	Aircraft Maintenance Publication
AR	As Required
ATA	Air Transport Association
DM	Data Module
DOA	Design Organization Approval
EASA	European Aviation Safety Agency
FH	Flying Hours
LH	Leonardo Helicopter
MMH	Maintenance Man Hours
N.A.	Not Applicable

- N.A.
- P/N Part Number

3) ANNEX

N.A.

J. PUBLICATIONS AFFECTED



K. SOFTWARE ACCOMPLISHMENT SUMMARY



2. MATERIAL INFORMATION

A. REQUIRED MATERIALS

1) PARTS

N.A.

2) CONSUMABLES

The following consumable materials, or equivalent, are necessary to accomplish this Service Bulletin:

#	SPEC./LH CODE NUMBER	DESCRIPTION	Q.TY	NOTE	PART
1	AMS3255 Class II Type II AW005ME04T05305	White tape (30 mm)	AR	(1)(2)(3) (7)(8)	I, II
2	MMM-A-132 Type 2, Class II Code No. 900000581	Adhesive EA9309.3NA (C021)	AR	(1)	Ι
3	Commercial	Lint-free cloth (C011)	AR	(1)	Ι
4	TT-N-95 Type II	Aliphatic naphtha (C059)	AR	(1)	I
5	AN525-10R9	Screw	AR	(1)(4)(5)	Ι
6	MS51958-63B	Screw	AR	(1)(4)(6)	Ι
7	Commercial	Abrasive pad (C015)	AR	(1)	I

3) LOGISTIC MATRIX

N.A.

NOTES

- (1) Item to procured as local supply.
- (2) The different tape P/Ns listed below can be accepted as an alternative to the tape AW005ME04T05305:
 - GSC-21-99605-027;
 - GSC-21-98805-027;
 - 3M 8547 Polyurethane Protective Tape;
 - 3M 8663 Polyurethane Protective Tape;
 - 3M 8663HS Polyurethane Protective Tape;
 - 3M 8663DL Polyurethane Protective Tape;
 - 3M 8560 Polyurethane Protective Tape;
 - Sky flex GSC-21-98330-012 GUA 4110-1.

Provided that the tapes are ordered white or in an equivalent very light color.

- (3) The tapes P/N GSC-21-99604-027 and P/N AW005ME04T05505 can be considered as an alternative to the other tapes listed above provided that they are cut in the longitudinal direction to become 30 mm wide.
- (4) Item to be ordered only if necessary in accordance with the required screw length.



- (5) Instead of the screw P/N AN525-10R9, under the conditions described in the Accomplishment Instruction, it is possible to install the screw P/N AN525-10R10 or P/N AN525-10R8.
- (6) Instead of the screw MS51958-63B, under the conditions described in the Accomplishment Instruction, it is possible to install the screw P/N MS51958-62B, P/N MS51958-64B, P/N MS51958-65B.
- (7) Tapes 3M 8547, 3M 8663, 3M 8663HS Polyurethane Protective Tape have to be ordered 30 mm wide or, if ordered wider, longitudinally cut to reach a width of 30 mm.
- (8) If tapes P/N AW005ME04T05305 or P/N AW005ME04T05505 are ordered, order quantity 3 m.

B. SPECIAL TOOLS

N.A.

C. INDUSTRY SUPPORT INFORMATION

LEONA

3. ACCOMPLISHMENT INSTRUCTIONS

GENERAL NOTES

- a) Place an identification tag on all components that are re-usable, including the attaching hardware that has been removed to gain access to the modification area and adequately protect them until their later reuse.
- b) Shape the cables in order to prevent interference with the structure and the other existing installations, using where necessary suitable lacing cords and plastic cable tiedown.
- c) Let adhesive cure at room temperature for at least 24 hours.
- d) All lengths are in mm.

<u>PART I</u>

- 1. In accordance with AMP DM 39-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. With reference to Figure 1 thru Figure 6, gain access to the affected area and perform the inspection of the overhead panel cable harnesses, anchor nuts, screws and supports as described in the following procedure:
 - 2.1 In accordance with the applicable steps of AMP DM 39-A-24-91-01-00A-520A-A and with reference to Figure 1 Detail A, open the circuit breaker panel assy without removing it.
 - 2.2 With reference to Figure 1 detail A and View B, remove the screws and the washer and check the screw length at the indicated locations from n°1 thru n°10 according to the following procedure:
 - 2.2.1 With the help of a caliper, measure the ceiling circuit breaker panel thickness near each screw location.

NOTE

Performing the following step 2.2.2, the screws have to be installed keeping the circuit breaker panel open.

2.2.2 Reinstall the screw and the washer removed in the step 2.2 in their location keeping the circuit breaker panel open.

HEONAF

- 2.2.3 Visually check that the number of thread pitches remained visible out of the anchor nut is between 2 and 4 after having subtracted the panel thickness value previously measured (refer to Figure 5).
- 2.2.4 If, when subtracted the panel thickness, less than 2 or more than 4 screw thread pitches remain visible, change the screw according to the following procedure:

The fastener length is based on the total screw length excluding the screw head.

2.2.4.1 With reference to Figure 4, Table 2, measure the screw fastener length and verify the actual screw P/N installed.

<u>NOTE</u>

With reference to steps 2.2.4.2 thru 2.2.4.5 move up in the Table 2 row to find one grip less and move down in the Table 2 row to find one grip more.

- 2.2.4.2 With reference to Figure 4, Table 2, if less than 2 screw thread pitches more than the panel thickness previously measured remain visible, install one grip more than the identified screw.
- 2.2.4.3 With reference to Table 2, if more than 4 screw thread pitches more than the panel thickness previously measured remain visible, install one grip less than the identified screw.
- 2.2.4.4 Repeat steps 2.2.4.2 and 2.2.4.3 until the correct screw P/N is identified from Table 2 and the screw thread pitches visible from the anchor nut are 2, 3 or 4 more than the panel thickness previously measured.
- 2.2.4.5 If no screws from Table 2 satisfy the requirement of step 2.2.4.4 contact the Product Support Engineering (engineering.support.lhd@leonardocompany.com).

NOTE

Some liner configurations do not require the presence of screws at the locations from n°11 thru n°16.

- 2.3 With reference to Figure 1 detail A and View B, check the screws length at the indicated locations from n°11 thru n°16, if applicable, according to the following procedure:
 - 2.3.1 Visually check that the number of thread pitches remained visible out of the anchor nut is between 2 and 4 (refer to Figure 6).

S.B. N°139-661 ALERT DATE: February 4, 2021 REVISION: A - February 18, 2021



2.3.2 If less than 2 or more than 4 screw thread pitches remain visible, change the screw according to the following procedure:

NOTE

The fastener length is based on the total screw length excluding the screw head.

2.3.2.1 Remove the screw and the washer and with reference to Table 3, measure the screw fastener length and verify the actual screw P/N installed.

NOTE

With reference to steps 2.3.2.2 thru 2.3.2.5 move up in the Table 3 row to find one grip less and move down in the Table 3 row to find one grip more.

- 2.3.2.2 With reference to Table 3, if less than 2 screw thread pitches remain visible, install one grip more than the identified screw.
- 2.3.2.3 With reference to Table 3, if more than 4 screw thread pitches remain visible, install one grip less than the identified screw.
- 2.3.2.4 Repeat the visual check and the steps 2.3.2.2 and 2.3.2.3 until the correct screw P/N is identified from Table 3 and the screw thread pitches visible from the anchor nut are 2, 3 or 4.
- 2.3.2.5 If no screws from Table 3 satisfy the requirement of step 2.3.2.4 contact the Product Support Engineering (engineering.support.lhd@leonardocompany.com).
- 2.4 With reference to Figure 1 Detail A and View B, check for chafing damage of the cable harness and ensure that clearance exists between the cable harness and the anchor nuts P/N A407A3C2P and/or the screws at the indicated locations from n°1 thru n°16.

<u>NOTE</u>

In case of findings, perform the following step 2.5.

NOTE

Customer must contact Product Support Engineering (<u>engineering.support.lhd@leonardocompany.com</u>) if support is needed to replace the cables or fuses and/or to have the applicable Wiring Diagrams.

2.5 With reference to Figure 1 Detail A and View B, reroute or remove and replace the damaged cables or fuses.



Figure 3 is for reference only.

2.6 With reference to Figure 1 View B and to Figure 3 Detail E, measure at the indicated location n°16, on the LH side, the clearance between the anchor nut P/N A407A3C2P and the cable harnesses including a check of the mutual position.

<u>NOTE</u>

Perform the following step 2.7 if the clearance is NOT at least 10.0 mm and/or if the cable harnesses is installed BELOW the anchor nut.

- 2.7 In accordance with the applicable steps of AMP DM 39-A-20-10-19-00A-920A-A and with reference to Figure 1 View B, move the existing support P/N A630A51 or P/N AW001CL001-N6, as applicable, and re-route the cable harnesses in order to respect the clearance of at least 10.0 mm and guarantee the installation ABOVE the anchor nut.
- 2.8 With reference to Figure 1 Detail A and View B, check that all the supports P/N A630A51 and P/N AW001CL001-N6, as applicable, on the LH and RH side are soundly bonded to the panel with no evidences of detachment or delamination.

NOTE

Perform the following step 2.9 in case of discrepancies found from the check of step 2.8.

- 2.9 With reference to Figure 1, replace the supports in the interested position according to the following procedure:
 - 2.9.1 Cut and remove the strap from the bundle and move away the bundle from the work area as far as possible. Make sure that you do not cause damage to the wires during this operation.

<u>NOTE</u>

Perform the following step 2.9.2 only if the support is partially removed or detached.

- 2.9.2 With reference to Figure 1 Detail A and View B, carefully remove the bonded plastic support P/N A630A51 and/or P/N AW001CL001-N6 with an applicable plastic spatula. Make sure that you do not cause damage to the structure during this operation.
- 2.9.3 Rub the seat of the plastic support on the structure with the Abrasive pad (C015) to remove the unwanted sealant.



CAUTION

Make a selection of the solvent to use it on the different structure to prevent damage to the related surfaces.

2.9.4 Clean the seat surface with the Lint-free cloth (C011) and with Aliphatic naphtha (C059).

WARNING

BE CAREFUL WHEN YOU USE THE COMPRESSED AIR. DUST AND PARTICLES CAN CAUSE INJURY TO YOUR EYES. ALWAYS USE APPLICABLE PROTECTIVE GOGGLE.

- 2.9.5 Dry the seat surface with the compressed air until you remove all the solvent.
- 2.9.6 With reference to Figure 1 Detail A and View B, install the supports P/N A630A51 and/or P/N AW001CL001-N6, as applicable, according to the following procedure:
 - 2.9.6.1 Prepare the correct quantity of Adhesive EA9309.3NA (C021) for the plastic support and the structure surface.
 - 2.9.6.2 If previously removed, re-install the cable harnesses to the supports P/N A630A51 and/or P/N AW001CL001-N6.
 - 2.9.6.3 Apply a thin layer of adhesive on the structure surface where the plastic support will be installed. Make sure that adhesive is located on an area not wider than the surface of the plastic support.
 - 2.9.6.4 Apply a thin layer of the adhesive on the mating surface of the plastic support.
 - 2.9.6.5 Put the plastic support on the structure and push the plastic support against the structure. Make sure that the bottom of the plastic support is fully against the structure.
 - 2.9.6.6 Let the plastic support in this position for the cure time of the adhesive.
 - 2.9.6.7 Make sure that the adhesive makes a continuous bead around the attached plastic support.
- 2.9.7 Put the bundle in its correct position on the plastic support and safety the bundle with the applicable tiedown strap.



Perform the following step 2.10 only if the chosen tape is wider than 30 mm.

2.10 Cut the tape in a longitudinal way to make it be 30 mm wide.

<u>NOTE</u>

With reference to step 2.11, on LH and RH side apply only one piece of tape (two layers) in a continuous way.

<u>NOTE</u>

With reference to steps 2.11 and 2.12, if the tape Sky flex GSC-21-98330-012 GUA 4110-1 or the 3M 8560 Polyurethane Protective Tape are used as an alternative, apply n°3 layers instead of n°2.

- 2.11 With reference to Figure 1 Detail A and View B, to Figure 2 View C and View D, apply n°2 layers of the white tape P/N AW005ME04T05305 (or equivalent P/N listed in consumable list) on n°10 anchor nuts P/N A407A3C2P (n°5 on the LH side and n°5 on the RH side).
- 2.12 With reference to Figure 1 Detail A and View B, to Figure 2 View C and View D, apply n°2 layers of the white tape P/N AW005ME04T05305 (or equivalent P/N listed in consumable list) on each of the n°6 anchor nuts P/N A407A3C2P (n°3 on the LH side and n°3 on the RH side).
- 2.13 With reference to Figure 1 Detail A and View B, temporarily remove n°10 screws from their respective anchor nuts P/N A407A3C2P at the indicated locations from n°1 thru n°10.
- 2.14 In accordance with the applicable steps of AMP DM 39-A-24-91-01-00A-720A-A and with reference to Figure 1 Detail A, close the circuit breaker panel assy using the hardware removed in the previous step 2.13.
- In case of findings, contact Product Support Engineering (<u>engineering.support.lhd@leonardocompany.com</u>) to report about the results of the inspections requested by step 2.
- 4. Return the helicopter to flight configuration and record for compliance with Part I of this Service Bulletin on the helicopter logbook.
- 5. Send the attached compliance form to the following mail box:

engineering.support.lhd@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".



<u>PART II</u>

- 1. In accordance with AMP DM 39-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. With reference to Figure 1 and Figure 2 gain access to the affected area and perform the inspection inside the overhead panel of the protective tape as described in the following procedure:
 - 2.1 In accordance with the applicable steps of AMP DM 39-A-24-91-01-00A-520A-A and with reference to Figure 1 Detail A, open the circuit breaker panel assy without removing it.

NOTE

With reference to steps 2.2 thru 2.7, if the tape Sky flex GSC-21-98330-012 GUA 4110-1 or the 3M 8560 Polyurethane Protective Tape are used as an alternative $n^{\circ}3$ layers instead of $n^{\circ}2$ are applied.

<u>NOTE</u>

With reference to the following step 2.2, if no findings are pointed out in the tape condition, skip to step 2.6.

2.2 With reference to Figure 1 Detail A and View B, to Figure 2 View C and View D, check for the condition of the n°2 layers of the white tape P/N AW005ME04T05305 (or equivalent P/N listed in consumable list) on n°10 anchor nuts P/N A407A3C2P (n°5 on the LH side and n°5 on the RH side).

NOTE

Perform the following step 2.3 only if the chosen tape to be applied is wider than 30 mm.

2.3 Cut the tape in a longitudinal way to make it be 30 mm wide.

<u>NOTE</u>

Apply only one piece of tape (two layers) in a continuous way.

NOTE

Perform the following step 2.4 only if you need to replace the protective tape on the LH side.

2.4 With reference Figure 2 View C, remove n°2 layers of the white tape from the anchor nuts and apply in the same position n°2 new layers of the white tape P/N AW005ME04T05305 (or equivalent P/N listed in consumable list).



Perform the following step 2.5 only if you need to replace the protective tape on the RH side.

2.5 With reference to Figure 2 View D, repeat step 2.4 for the RH side.

<u>NOTE</u>

With reference to the following step 2.6, if no findings are pointed out in the tape condition, skip to step 2.10.

2.6 With reference to Figure 1 Detail A and View B, to Figure 2 View C and View D, check for the condition of the n°2 layers of the white tape P/N AW005ME04T05305 (or equivalent P/N listed in consumable list) on each of the n°6 anchor nuts P/N A407A3C2P (n°3 on the LH side and n°3 on the RH side).

<u>NOTE</u>

Perform the following step 2.7 only if the chosen tape to be applied is wider than 30 mm.

2.7 Cut the tape in a longitudinal way to make it be 30 mm wide.

<u>NOTE</u>

Perform the following step 2.8 only if you need to replace the protective tape on the LH side.

2.8 With reference to Figure 2 View C, remove n°2 layers of the white tape from the anchor nut and apply in the same position n°2 new layers of the white tape P/N AW005ME04T05305 (or equivalent P/N listed in consumable list). If necessary, repeat for all the three anchor nuts.

<u>NOTE</u>

Perform the following step 2.9 only if you need to replace the protective tape on the RH side.

- 2.9 With reference to Figure 2 View D, repeat step 2.8 for the RH side.
- 2.10 With reference to Figure 1 Detail A and View B, check for chafing damage of the cable harness and ensure that clearance exists between the cable harness and the anchor nuts P/N A407A3C2P and/or the screws at the indicated locations from n°1 thru n°16.



In case of findings, perform the following step 2.11.

<u>NOTE</u>

Customer must contact Product Support Engineering (<u>engineering.support.lhd@leonardocompany.com</u>) if support is needed to replace the cables or fuses and/or to have the applicable Wiring Diagrams.

- 2.11 With reference to Figure 1 Detail A and View B, remove and replace the damaged cables or fuses.
- 2.12 In accordance with the applicable steps of AMP DM 39-A-24-91-01-00A-720A-A and with reference to Figure 1 Detail A, close the circuit breaker panel assy.
- In case of findings, contact Product Support Engineering (<u>engineering.support.lhd@leonardocompany.com</u>) to report about the results of the inspections requested by step 2.
- 4. Return the helicopter to flight configuration and record for compliance with Part II of this Service Bulletin on the helicopter logbook.
- 5. Send the attached compliance form to the following mail box:

engineering.support.lhd@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".



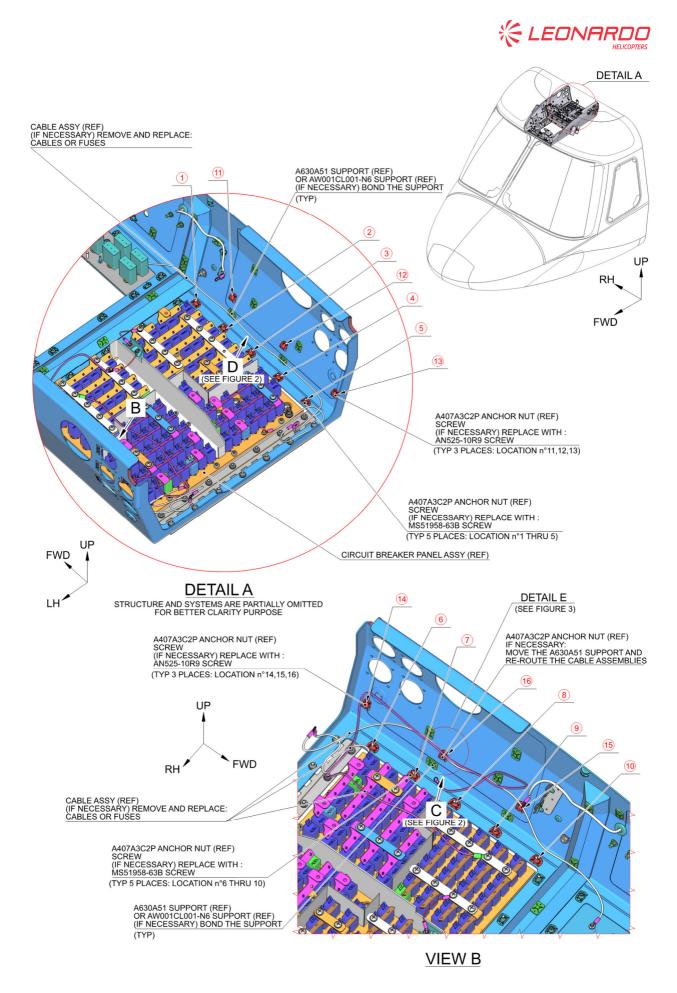



Figure 1





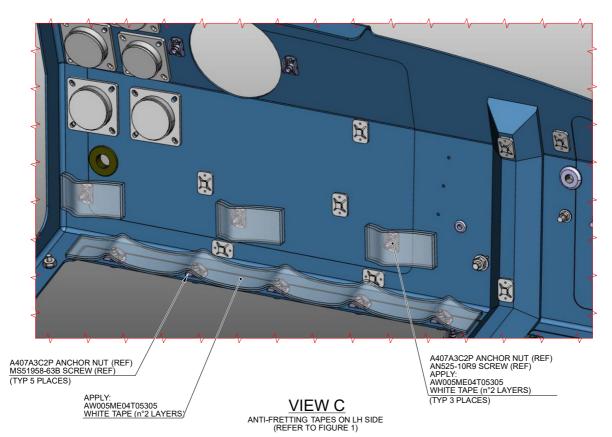

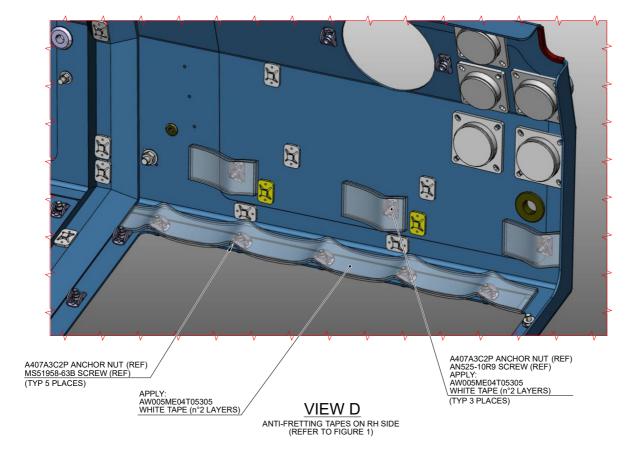

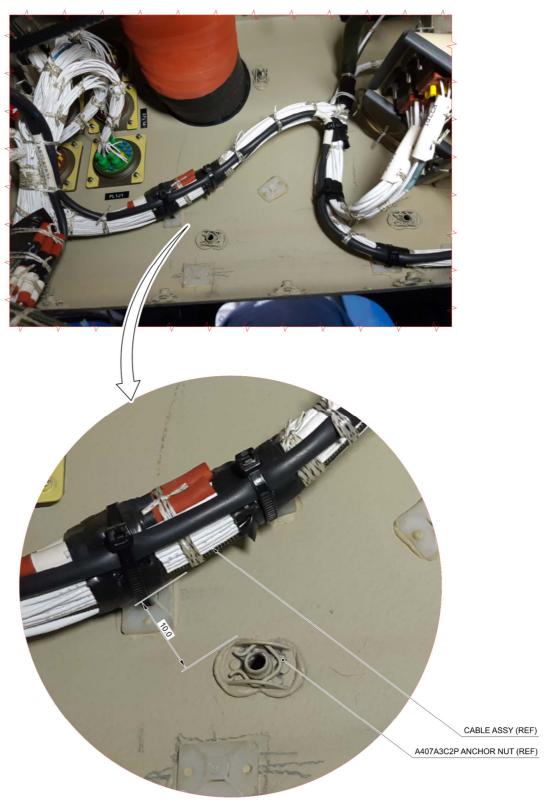

DETAIL E (REFER TO FIGURE 1)

Figure 3




ID	SCREW P/N	MIN TOLERANCE	MAX TOLERANCE
1	MS51958-62B	10.34	11.13
2	MS51958-63B	11.91	12.70
3	MS51958-64B	15.09	15.88
4	MS51958-65B	18.26	19.05


ID	SCREW P/N	MIN TOLERANCE	MAX TOLERANCE
1	AN525-10R8	11.91	13.49
2	AN525-10R9	13.49	15.06
3	AN525-10R10	15.09	16.66

TABLE 3



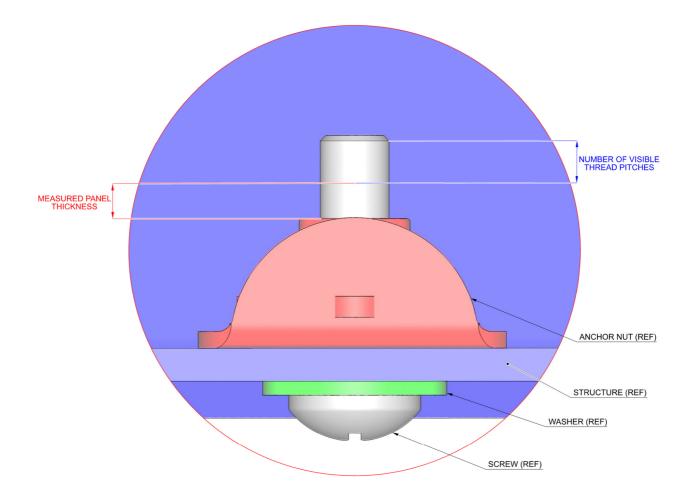



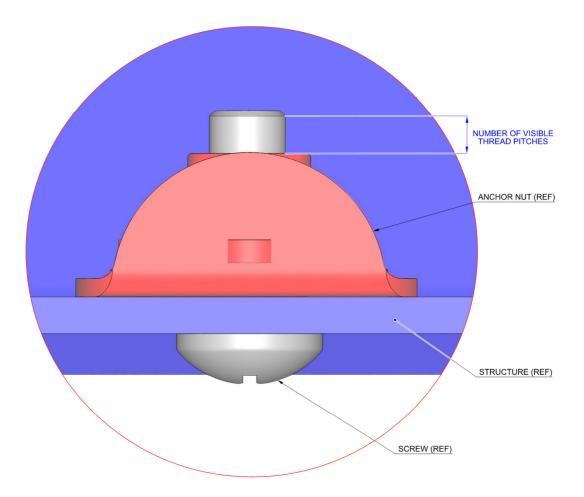





Please send to the following address: LEONARDO S.p.A. CUSTOMER SUPPORT & SERVICES - ITALY		SERVICE BULLETIN COMPLIANCE FORM Date:				
		Number:				
PRODUCT SUPPORT ENGINEE Via Giovanni Agusta, 520	RING & LICENSES DEPT.					
21017 Cascina Costa di Samara Tel.: +39 0331 225036 Fax: +39	ate (VA) - ITALY 0331 225988	Revision:				
Customer Name and Addre	ess:			Telephone:		
				Fax:		
				B.T. Compliance Date:		
Helicopter Model	S/N		Total N	umber	Total Hours	T.S.O.
Remarks:						
Information:						

We request your cooperation in filling this form, in order to keep out statistical data relevant to aircraft configuration up-to-date. The form should be filled in all its parts and sent to the above address or you can communicate the application also via Technical Bulletin Application Communication Section placed in Leonardo AW Customer Portal - MyCommunications Area. We thank you beforehand for the information given.