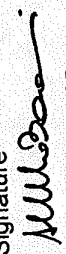


1. Approving Competent Authority/Country ENAC / ITALY		2. AUTHORIZED RELEASE CERTIFICATE EASA FORM 1		3. Form Tracking Number AGU-2021-80382	
4. Organisation name and address: Leonardo S.p.A. HELICOPTERS Stabilimento di Cascina Costa via G. Agusta, 520 - 21017 Cascina Costa di Samarate (VA) ITALY		5. Work Order/Contract/Invoice 4802476971		11. Status/Work	
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
1	MAIN GEARBOX, ASSY	3G6320A00134	1	R304	OVERHAULED
12. Remarks REF. WORK REPORT n° 65805450 TOTAL TIME: 5988;80 T.S.O.: 00.00 LANDINGS: 13848 EMBODIED: B.T. 139-609A (AD 2021-0121) REMOVED FROM: AW139 41234 N-939BG INTERNAL INHIBITION PERFORMED ON 13/12/2021; EXPIRING DATE-SEE TAG ENCLOSED "The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR Part 43 and in respect to that work, the items are approved for return to service under certificate no. U3GY111D" "TCCA Approval No.: 813-13 as per MAG between EASA and TCCA"					
13a. Certifies that items identified above were manufactured in conformity to: <input type="checkbox"/> approved design data and are in condition for safe operation <input type="checkbox"/> non-approved design data specified in block 12					
13b. Authorised Signature		13c. Approval/Authorisation Number		14a. <input checked="" type="checkbox"/> Part-145.A.50 Release to Service <input type="checkbox"/> Other: regulation specified in block 12	
13d. Name		13e. Date (dd mm yy)		14b. Authorised Signature  C.A. n° 35 - C.I.T. N° 35	
14c. Certificate/Approval Ref. No. IT.145.0221		14d. Name Alberto Baroni		14e. Date (dd mm yy) 13 dec 2021	
14. Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready to release to service.					
15. USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s) Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1 that the user/installer ensure that his/her airworthiness authority accept items from the airworthiness authority specified in block 1 Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulation by the user/installer before the aircraft may be flown					

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

PROPRIETARIO/ESERCENTE M34
CUSTOMER

DENOMINAZIONE GEARBOX ASSY MAIN
PART NAME

P/N IN 3G6320A00134 **S/N IN** R304
P/N OUT 3G6320A00134 **S/N OUT** R304

ORE TOTALI 5988;80 **ORE D.U.R.NEW**
TOTAL TIME *T.S.O.*

SBARCATO DA AW139 S/N:41234 MARKS N939BG
REMOVED FROM

CAUSA
REASON
Overhaul

OPERAZIONI DI MANUTENZIONE
MAINTENANCE OPERATIONS
Overhauled

MANUALI di RIFERIMENTO
REF. MANUALS
AW139 I.E.T.P. Issue 39th issued 07 Jun.2021 updated 20 Jul.2021


BOLLETTINI TECNICI/P.A. APPLICATI
TECNICAL BULLETINS AND AIRWORTHINESS / DIRECTIVES COMPLIED WITH
AW139 B.T.609A (P.A.2021-0121)


MODIFICHE
MODIFICATIONS
///

Questo rapporto è costituito da n. 11 fogli
This report consists of n. 11 sheets

LUOGO E DATA
PLACE AND DATA
LEONARDO
HELICOPTERS
Cascina Costa
13 DEC 2021

CERTIFYING STAFF
FIRMA(SIGNATURE)
C.S. A14
035
Alberto Baroni


CONTROLLORE
FIRMA(SIGNATURE)

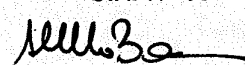A14
001

AUTORIZZAZIONE
AUTHORIZATION
Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35


Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**RIPARAZIONI
REPAIRS**

REF.ASSY GEARBOX ASSY MAIN

P/N IN 3G6320A00134
P/N OUT 3G6320A00134

S/N IN R304
S/N OUT R304

PART NUMBER	N.PEZZI	DENOMINAZIONE	W.O.	PR.
N.PIECES		PART NAME		

ATTEST. ESECUZIONE
ATTEST. EXECUTION

DATA
DATE

FIRMA
SIGNATURE

3G6320A10432	1,000	HOUSING, ASSY ROTOR BRAKE MGB		
SN LMA303				

13 DEC 2021

A14
001

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 059 USURA Replaced 2 bush

Installed Housing same p/n OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

G200 Altro (vedi note) USURA

13 DEC 2021

A14
001

3G6320A10852	1,000	FLANGE, ADAPTER ROTOR BRAKE		
SN DAT360				

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 059 USURA Reworked race seal

Installed Flange same p/n OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

G200 Altro (vedi note) USURA

13 DEC 2021

A14
001

3G6320V04252	2,000	PUMP, LUBRICATION		
SN 594				
683				

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 032 L.O.F. Sent to manufacturer for overhaul

Installed NEW Oil Pumps same p/n

3G6320A01035	1,000	CASE, TOP ASSY		
SN R285				

13 DEC 2021

A14
001

LUOGO E DATA
PLACE AND DATA
LEONARDO
HELICOPTERS
Cascina Costa

13 DEC 2021

CERTIFYING STAFF
FIRMA(SIGNATURE)

C.S. A14
035

Alberto Baroni

Alberto Baroni

CONTROLLORE
FIRMA(SIGNATURE)

A14
001

[Signature]

AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
2

DI
OF
3

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**RIPARAZIONI
REPAIRS**

REF.ASSY GEARBOX ASSY MAIN

P/N IN 3G6320A00134
P/N OUT 3G6320A00134

S/N IN R304
S/N OUT R304

PART NUMBER	N.PEZZI	DENOMINAZIONE	W.O.	PR.
N.PIECES	PART NAME			

ATTEST. ESECUZIONE
ATTEST. EXECUTION

DATA	FIRMA
DATE	SIGNATURE

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 007 CORROSIONE Reworked upper fitting surface (4 pos)

Installed Upper case same p/n OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

A060 Area attacchi aste CORROSIONE PIANI

3G6320A01853 1,000 SHAFT, MAIN ROTOR
SN R359

13 DEC 2021

A14
001

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 059 USURA Reworked semicone, restored treatment

Installed Mast/Spider p/n 3g6320a0713,
Mast same p/n OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

G200 Altro (vedi note) USURA

3G6320A03852 1,000 GEAR, SPIRAL BEVEL 41T
SN DAT595

13 DEC 2021

A14
001

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 059 USURA Reworked race seal

Installed Gear same p/n OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

G200 Altro (vedi note) USURA

3G6320A05652 1,000 GEAR, SPIRAL BEVEL 15T
SN DAT196

13 DEC 2021

A14
001

LEONARDO
HELICOPTERS
Cascina Costa

C.S. A14
035

Alberto Baroni

Alberto Baroni

A14
001

Scopis

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni

13 DEC 2021

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
3

DI
OF
3

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**RIPARAZIONI
REPAIRS**

REF.ASSY GEARBOX ASSY MAIN

P/N IN 3G6320A00134
P/N OUT 3G6320A00134

S/N IN R304
S/N OUT R304

PART NUMBER	N.PEZZI	DENOMINAZIONE	W.O.	PR.
N.PIECES		PART NAME		

ATTEST. ESECUZIONE
ATTEST. EXECUTION

DATA DATE	FIRMA SIGNATURE
--------------	--------------------

TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 059 USURA Reworked race seal

Installed Gear same p/ OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

G200 Altro (vedi note) USURA PISTA

3G6320A03952 1,000 GEAR, SPIRAL BEVEL 17T
SN DAT235

13 DEC 2021



TIPO DIFETTO/AZIONE CORRETTIVA / DEFECT TYPE/CORRECTIVE ACTION

RV-GRU-R 059 USURA Reworked race seal

Installed Gear same p/n OVERHAULED

PROPOSTE DI RECUPERO / REPAIR PROPOSAL

G200 Altro (vedi note) USURA PISTA



Alberto Baroni



Alberto Baroni

Sojot



**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
1

DI
OF
5

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**SOSTITUZIONI
REPLACEMENT**

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N R304

P/N E DENOMINAZIONE P/N AND PART NAME	N.PEZZI N.PIECES	MOTIVO DELLA SOSTITUZIONE REASON OF SOSTITUTION
3G6320A13731 GAUGE ASSY, MGB OIL LEVEL	1,000	010 DANNI DAMAGE
A438A084A ATTACCO SUPPORTO CABLAGGIO	8,000	010 DANNI DAMAGE
3G2910A11451 BRACKET	1,000	010 DANNI DAMAGE
3G2910A11551 BRACKET	1,000	010 DANNI DAMAGE
A387A1299A SQUADRETTA	1,000	010 DANNI DAMAGE
3G6320A18951 ECS PLUG	1,000	010 DANNI DAMAGE
3G6320L00251 SEAL PUMP	4,000	010 DANNI DAMAGE
3G6320V04453 FILTER, ELEMENT	1,000	010 DANNI DAMAGE
3G6320L00151 SEAL PTFE 28X48X7	1,000	010 DANNI DAMAGE
A866A31603W GUARNIZIONE AD ANELLO	1,000	010 DANNI DAMAGE

LUOGO E DATA
PLACE AND DATA


LEONARDO
HELICOPTERS
Cascina Costa

13 DEC 2021

CERTIFYING STAFF
FIRMA(SIGNATURE)


C.S. A14
035

Alberto Baroni




CONTROLLORE
FIRMA(SIGNATURE)

A14
001



AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

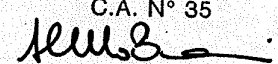

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
2

DI
OF
5

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**SOSTITUZIONI
REPLACEMENT**

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N R304

P/N E DENOMINAZIONE P/N AND PART NAME	N.PEZZI N.PIECES	MOTIVO DELLA SOSTITUZIONE REASON OF SOSTITUTION
A866A55803W GUARNIZIONE AD ANELLO	1,000	010 DANNI DAMAGE
3G6320V01151 SEAL, LIP TAIL ROTOR	1,000	010 DANNI DAMAGE
AW002GR-B001CD GUARNIZIONE A "C" CON MOLLA	4,000	059 USURA WEAR
PROPOSTE DI RECUPERO / REPAIR PROPOSAL		
<i>LCD-USUR G200 USURA</i>		
3G6330A00532 ANTITORQUE BEAM ASSY	1,000	055 SCRITTE ILLEGGIBILI ILLEGIBLE MARKING
3G6320V02732 JET, LUBE ASSY N.15	1,000	010 DANNI DAMAGE
3G6320A12831 PINION, SPIRAL BEVEL 29T ASSY	1,000	067 USURA PER ATTRITO FRETTING S/N:DAT157
PROPOSTE DI RECUPERO / REPAIR PROPOSAL		
<i>LCD-USAT B030 FRETTING</i>		
3K6320V02053 BUSH ASSY, GIMBAL	4,000	059 USURA WEAR
PROPOSTE DI RECUPERO / REPAIR PROPOSAL		
<i>LCD-USUR G200 SOSTITUITE AL TBO</i>		
3K6320A06051 WASHER, CUP LOCK SPINNER NUT	2,000	059 USURA WEAR
PROPOSTE DI RECUPERO / REPAIR PROPOSAL		
<i>LCD-USUR G200 SOSTITUITE AL TBO</i>		
3K6320A01251 FLANGE INPUT	2,000	036 NON A DISEGNO NOT COMPLY WITH DRAWING

LEONARDO
HELICOPTERS
Casclna Costa

13 DEC 2021



Alberto Baroni

Alberto Baroni

PIN OUT:3K6320A01251



30/08

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
3

DI
OF
5

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**SOSTITUZIONI
REPLACEMENT**

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N R304

P/N E DENOMINAZIONE
P/N AND PART NAME

N.PEZZI
N.PIECES

MOTIVO DELLA SOSTITUZIONE
REASON OF SOSTITUTION

3K6320V00952 FACE SEAL ASSY	2,000	S/N:KHI-769;KHI-724 010 DANNI DAMAGE S/N:KHI-REX-407;KHI-REZ-406
3K6320V00154 BRG BALL,DUPLEX SET INPUT PINION	1,000	007 CORROSIONE CORROSION S/N:KHI-SNFA-08252 PROPOSTE DI RECUPERO / REPAIR PROPOSAL LCD-CORR A120 CORROSIONE
3G6320A02532 COLLECTOR, OIL MAIN ROTOR	1,000	003 APPLICAZIONE P.T./B.T. P.T. / B.T. APPLICATION
3G6320A21051 BAFFLE OIL MAST	1,000	003 APPLICAZIONE P.T./B.T. P.T. / B.T. APPLICATION
NAS1802-3-20 VITE	10,000	003 APPLICAZIONE P.T./B.T. P.T. / B.T. APPLICATION
NAS1149C0332R RONDELLA	10,000	003 APPLICAZIONE P.T./B.T. P.T. / B.T. APPLICATION
3G6320A21131 PLATE RETAIN ASSY	5,000	003 APPLICAZIONE P.T./B.T. P.T. / B.T. APPLICATION
3G6320V03951 FILLER, CAP WITH BREATHER	1,000	010 DANNI DAMAGE
3G6320A06931 CUP, OIL DRAIN ASSY	1,000	010 DANNI DAMAGE
3G6320V00451 SEAL, LIP 170.5X195.5X12	1,000	010 DANNI DAMAGE
3G6320A014651 WASHER,BOLT SPHERICAL	10,000	010 DANNI DAMAGE

LEONARDO
HELICOPTERS
Casclina Costa

C.S. A14
035
Alberto Baroni

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

13 DEC 2021

Alberto Baroni

Baroni
A14
001

Alberto Baroni

**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET

DI
OF

4

5

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

**SOSTITUZIONI
REPLACEMENT**

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N R304

P/N E DENOMINAZIONE
P/N AND PART NAME

N.PEZZI
N.PIECES

MOTIVO DELLA SOSTITUZIONE
REASON OF SOSTITUTION

3G6330A00234
UPPER FITTING ASSY

3,000

010 DANNI
DAMAGE
S/N:R5;R7;V2010

3G6320V00354
BEARING, ROLLER SPHERIC (SKF)

4,000

063 VAIOLATURA
PITTING

S/N:2421;2425;2426;2427
QUOTA RIMANENTE:186.052

PROPOSTE DI RECUPERO / REPAIR PROPOSAL
LCD-VAIO H010 PITTING

3G6320A01951
PIN, PLANETARY

1,000

007 CORROSIONE
CORROSION
S/N:DAT1532

PROPOSTE DI RECUPERO / REPAIR PROPOSAL
LCD-CORR A200 CORROSIONE

3G6320A09152
NUT, BEARING LOCK

5,000

003 APPLICAZIONE P.T./B.T.
P.T. / B.T. APPLICATION
OUT:3G6320A09151
S/N:Q1376;Q1377;Q1405;Q1406;Q1407

3G6320V00151
BEARING, BALL MAST

1,000

007 CORROSIONE
CORROSION
S/N:09110

PROPOSTE DI RECUPERO / REPAIR PROPOSAL
LCD-CORR A200 CORROSIONE

3G6320V01252
BEARING, BALL ACCESSORY

1,000

063 VAIOLATURA
PITTING
S/N:09391

PROPOSTE DI RECUPERO / REPAIR PROPOSAL
LCD-VAIO H060 PITTING

3G6340V00752
SENSOR ROTOR SPEED

1,000

010 DANNI
DAMAGE
S/N: 1202458

3G6320V03752
VALVE, RELIEF

2,000

026 INCONV. DURANTE PROVA AL BANCO/VOLO
TROUBLE DURING TEST-BENCH RUN OR FLIGHT
S/N: 25030/26; 25030/27

LEONARDO
HELICOPTERS

Cs.Costa

13 DEC 2021



Alberto Baroni

Alberto Baroni

(A14 001)

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni

RAPPORTO DI LAVORO
WORK REPORT

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
5

DI
OF
5

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

SOSTITUZIONI
REPLACEMENT


REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N R304

P/N E DENOMINAZIONE P/N AND PART NAME	N.PEZZI N.PIECES	MOTIVO DELLA SOSTITUZIONE REASON OF SOSTITUTION
---	----------------------------	---

SWITCH, OIL TEMPERATURE		026 INCONV. DURANTE PROVA AL BANCO/VOLO TROUBLE DURING TEST-BENCH RUN OR FLIGHT S/N: 0593
A866A31802W GUARNIZIONE AD ANELLO	2,000	046 RIMESSA IN EFFICIENZA SERVICEABLE RELEASE
AW002FP100 TAPPO RIEMPIMENTO OLIO	1,000	046 RIMESSA IN EFFICIENZA SERVICEABLE RELEASE
A537A02AA02-0150 ASSIEME CAVO ANTIFULMINE	2,000	046 RIMESSA IN EFFICIENZA SERVICEABLE RELEASE
3G6340V01051 THERMOCOUPLES, INPUT MODULE	1,000	020 FUNZIONAMENTO IRREGOLARE IRREGULAROPERATIONALITY



Alberto Baroni

Alberto Baroni



Alberto Baroni

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

PRINCIPALI COMPONENTI INSTALLATI SULL' ASSIEME
MAIN COMPONENTS INSTALLED ON THE ASSEMBLY

(CON LIMITI DI VITA E/O REQUISITI DI ISPEZIONE)
(WITH RETIREMENTS LIFE AND/OR INSPECTION REQUIREMENTS)

REF.ASSY GEARBOX ASSY MAIN

P/N 3G6320A00134

S/N R304

DENOMINAZIONE PART NAME	P/N	S/N	ORE TOTALI	ORE D.U.R.	TOTAL TIME	T.S.O.
GIMBAL SUPPORT ASSY		3K6320A01132	KHI-MMC-978	5988;80	00:00	
GIMBAL SUPPORT ASSY		3K6320A01132	KHI-MMC-993	5988;80	00:00	
CASE, TOP ASSY		3G6320A01035	V186 (5997.09 FH)	8062 LDGS	00:00	
SHAFT, MAIN ROTOR		3G6320A01853	V366 (6886 LDGS)	5985;90	00:00	
CASE, MAIN ASSY		3G6320A02738	R299 (13848LDGS)	5988;80	00:00	
UPPER FITTING ASSY		3G6330A00234	R6	13848 LDGS	00:00	
UPPER FITTING ASSY		3G6330A00234	ACC0042	00:00	NEW	
UPPER FITTING ASSY		3G6330A00234	ACC0043	00:00	NEW	
UPPER FITTING ASSY		3G6330A00234	ACC0047	00:00	NEW	
ANTITORQUE BEAM ASSY		3G6330A00532	MMA0100	00:00	NEW	
NUT, BEARING LOCK		3G6320A09152	DAT5143	00:00	NEW	
NUT, BEARING LOCK		3G6320A09152	DAT5144	00:00	NEW	
NUT, BEARING LOCK		3G6320A09152	DAT5145	00:00	NEW	
NUT, BEARING LOCK		3G6320A09152	DAT5146	00:00	NEW	
NUT, BEARING LOCK		3G6320A09152	DAT5078	00:00	NEW	
PUMP, LUBRICATION		3G6320V04252	2547	00.00	NEW	
PUMP, LUBRICATION		3G6320V04252	2548	00.00	NEW	

LUOGO E DATA
PLACE AND DATA

LEONARDO
HELICOPTERS
Cascina Costa
13 DEC 2021

CERTIFYING STAFF
FIRMA(SIGNATURE)



Alberto Baroni

Alberto Baroni

CONTROLORE
FIRMA(SIGNATURE)



[Signature]

AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35

Alberto Baroni



**RAPPORTO DI LAVORO
WORK REPORT**

DATA
05.10.2021

NR. DOCUMENTO
RV 30001120332

PAG.
SHEET
1

DI
OF
1

Leonardo Helic. - Cs.Costa R.G

N. 65805450

DATA 19.07.2021

WBS 4802476971

REF.ASSY GEARBOX ASSY MAIN

P/N IN 3G6320A00134
P/N OUT 3G6320A00134

S/N IN R304
S/N OUT R304

NOTE
NOTES

At present time, the Main Gearbox has performed 13848 landings
-
Applied "VARIANT" p/n 3G6320P01611

LUOGO E DATA
PLACE AND DATA

LEONARDO
HELICOPTERS
Cascina Costa
13 DEC 2021

CERTIFYING STAFF
FIRMA(SIGNATURE)

C.S. A14
035

CONTROLLORE
FIRMA(SIGNATURE)

AUTORIZZAZIONE
AUTHORIZATION

Alberto BARONI
C.I.T. N° 35-CS
C.A. N° 35









LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 2

ATA Chapter

ASSY PIN (26)		3G6320A00134		ASSY SN (27)		R304												
COMPONENT DATA				INSTALLATION				REMOVAL										
DESCRIPTION (28)	PIN (29)	MANUFACTURING DATE (31)	RETIREMENT LIFE / TIME LIMITS (32)	ASSY			COMPONENT			ASSY			COMPONENT					
				TOTAL HOURS (33)	TOTAL LANDINGS (34)	TOTAL LIFTS/CYCLES (34)	TOTAL HOURS (35)	LANDINGS SINCE OH (35)	LIFTS/CYCLES SINCE OH (35)	TOTAL HOURS (38)	TOTAL LANDINGS (38)	TOTAL LIFTS/CYCLES (38)	TOTAL HOURS WITH PENALTY FACTOR (40)	TOTAL LANDINGS WITH PENALTY FACTOR (40)	TOTAL LIFTS/CYCLES SINCE OH (41)	LANDINGS SINCE OH (41)	LIFTS/CYCLES SINCE OH (41)	DATE (42)
CASE TOP, assy	3G6320A01035			5988.80	5441.09		13 DEC.2021											
	V186	120000 LDGS		13848	8062	0												
SHAFT, MAIN ROTOR	3G6320A01853			5988.80	5985.90	00.00	13 DEC.2021											
	V366	15300 54000 LDGS		13848	6886	0												
CASE MAIN, assy	3G6320A02738			5988.80	5988.80	00.00	13 DEC.2021											
	R299	12500 61800 LDGS		13848	13848	0												
UPPER FITTING, assy	3G6330A00234			13848	00.00	NEW	13 DEC.2021											
	ACC0042	133240 LDGS		13848	00.00	NEW												
UPPER FITTING, assy	3G6330A00234			13848	00.00	NEW	13 DEC.2021											
	ACC0043	133240 LDGS		13848	00.00	NEW												
UPPER FITTING, assy	3G6330A00234			13848	00.00	NEW	13 DEC.2021											
	ACC0047	133240 LDGS		13848	00.00	NEW												

Company General Use



LOG CARD

NOTICE THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Annex A

ATA Chapter

ASSY P/N (26)		3G6320A00134		ASSY S/N (27)		R304		COMPONENTS INSTALLED ON ASSY																		
COMPONENT DATA				INSTALLATION				ASSY						REMOVAL												
DESCRIPTION (28)	P/N (29)	MANUFACTURING DATE (31)	RETIREMENT LIFE / TIME LIMITS (32)	TOTAL HOURS (34)	TOTAL LANDINGS (34)	TOTAL LIFTS/CYCLES (34)	TIME SINCE OH (35)	LANDINGS SINCE OH (35)	LIFTS/CYCLES SINCE OH (35)	DATE (36)	STAMP AND SIGNATURE (37)	TOTAL HOURS (38)		TOTAL LANDINGS (38)		TOTAL LIFTS/CYCLES (38)		TOTAL HOURS WITH PENALTY FACTOR (40)	TOTAL LANDINGS WITH PENALTY FACTOR (40)	TOTAL LIFTS/CYCLES SINCE OH (41)	TIME SINCE OH (41)	LANDINGS SINCE OH (41)	LIFTS/CYCLES SINCE OH (41)	DATE (42)	STAMP AND SIGNATURE (43)	
												TOTAL HOURS (33)	TOTAL LANDINGS (33)	TOTAL LIFTS/CYCLES (33)	LANDINGS SINCE OH (39)	TOTAL HOURS (39)	TOTAL LANDINGS (39)									TOTAL LIFTS/CYCLES (39)
UPPER FITTING, assy	3G6330A00234			13848	13848	0				13 DEC.2021																
	R6	133240 LDGS																								
ANTITORQUE BEAM, assy	3G6330A00532		20000 63000 LDGS	5988.80	00.00	0	NEW			13 DEC.2021																
	MMA0100			13848																						
PUMP, LUBRICATION	3G6320V04252			5988.80	00.00	0	NEW			13 DEC.2021																
	2547	5000 OVH		13848																						
PUMP, LUBRICATION	3G6320V04252			5988.80	00.00	0	NEW			13 DEC.2021																
	2548	5000 OVH		13848																						
NUT BEARING LOCK	3G6320A09152	6000 28000 LDGS		5988.80	00.00	0	NEW			13 DEC.2021																
	DAT5143			13848																						
NUT BEARING LOCK	3G6320A09152	6000 28000 LDGS		5988.80	00.00	0	NEW			13 DEC.2021																
	DAT5144			13848																						



LOG CARD


NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY


Section 2

ATA Chapter

ASSY P/N (26)		INPUT MODULE, assy		ASSY S/N (27)		KHI-679		COMPONENTS INSTALLED ON ASSY														
COMPONENT DATA				INSTALLATION				ASSY						REMOVAL								
DESCRIPTION (28)	P/N (29)	MANUFACTURING DATE (31)	RETIREMENT LIFE / TIME LIMITS (32)	ASSY		COMPONENT		DATE (36)		TOTAL HOURS (38)		TOTAL HOURS (39)		TOTAL HOURS WITH PENALTY FACTOR (40)		TIME SINCE OH (41)		DATE (42)				
				TOTAL HOURS (33)	TOTAL LANDINGS (34)	TOTAL HOURS (34)	LANDINGS SINCE OH (35)	DATE (37)	TOTAL HOURS (38)	TOTAL LANDINGS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	DATE (42)									
	S/N (30)			TOTAL LANDINGS (33)	TOTAL LANDINGS SINCE OH (34)	LANDINGS SINCE OH (35)	STAMP AND SIGNATURE (37)	TOTAL HOURS (38)	TOTAL LANDINGS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	DATE (42)	TOTAL HOURS (39)	TOTAL LANDINGS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	DATE (42)	TOTAL HOURS (39)	TOTAL LANDINGS (39)	TOTAL HOURS WITH PENALTY FACTOR (40)	LANDINGS SINCE OH (41)	DATE (42)
GIMBAL, assy	3K6320A01132		46000 FH	5988.80	5988.80	NEW	13 DEC 2021															
	Yr C KHI-NPC-078						<i>[Signature]</i>															

[Handwritten signature]
ATA
035

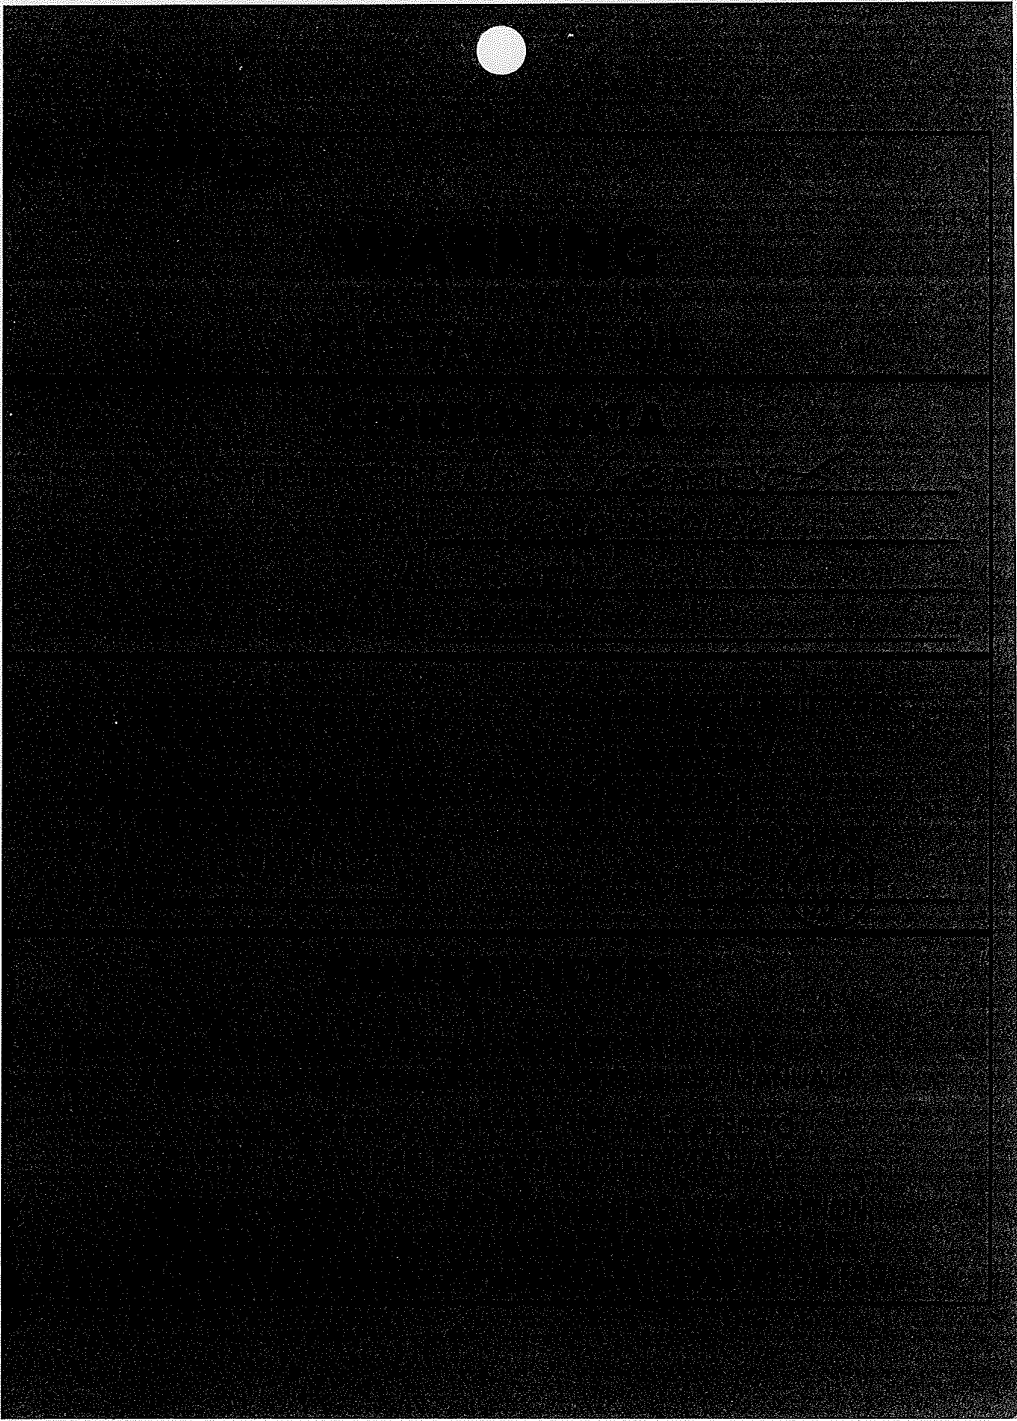

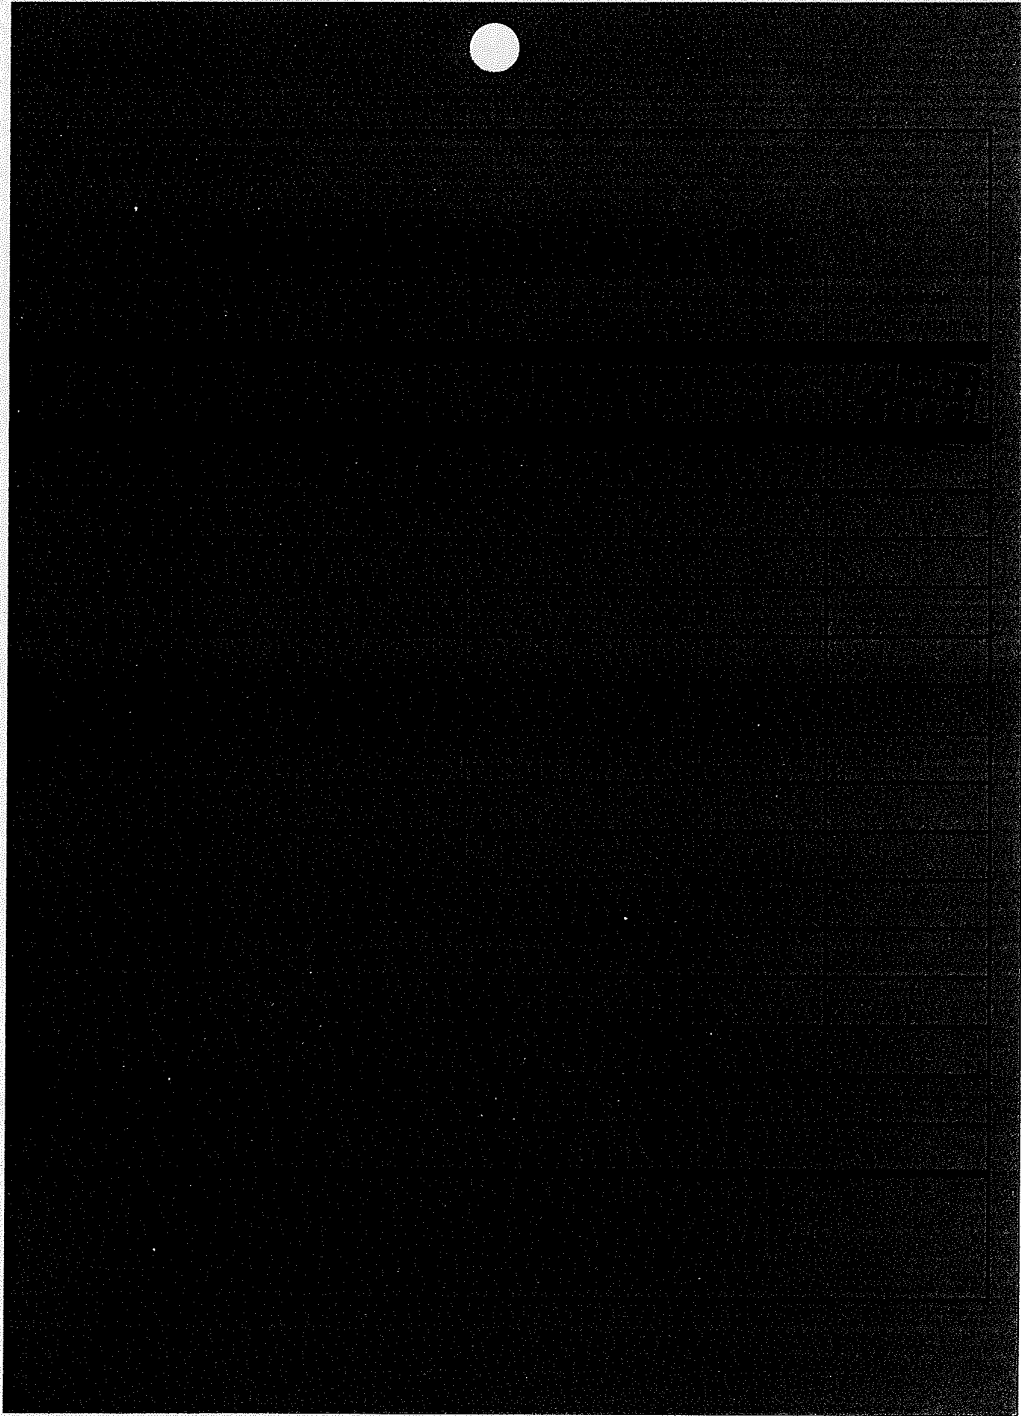

Check List Ricezione Parti Manutenute

DPR.CSI.047.13 F01 Issue 04

Page 1

September 2019

N° Lotto di Controllo: 80002093113

No.	Verifiche da effettuare	SI	NO
LHD PLANT + General			
1	Integrità dell'imballaggio	✓	
2	Presenza Testo di controllo	✓	
3	Documenti di Conformità e documentazione di fornitura richiesta	✓	
4	Verifica presenza LOG CARD/SIA/LOG BOOK if applicable	✓	
5	Verifica correttezza LOG CARD/SIA/LOG BOOK if applicable	✓	
6	Disponibilità elenco parti sostituite per parti proprietà MoD Italia		✓
7	Evidenza Approvazione LH Report di indagine quando applicabile		✓
8	Spoglio del SB, AD, PA, PTA, SIB	✓	
9	Limitazioni di immagazzinamento/preservazione	✓	
10	Verifica stato di approvazione fornitore	✓	
VENDORS			
11	Disponibilità ATP per MoD Italia		
12	Disponibilità dati di calibrazione Tools/GSE/AGE quando applicabile		
13	Evidenza Approvazione LH Report di indagine quando applicabile		
14	Ispezione Visiva		
Note :			

Timbro e Firma: _____

Data: 16/12/21

A8E
1106

Istruzioni di compilazione

Inserire "✓" per attestare l'esecuzione della verifica effettuata

Ove non applicabile il controllo, apporre "✓" e definire la motivazione nel campo note.

Per le Non Conformità rilevate barrare il corrispondente campo numerato della colonna No. con il simbolo **X**. Riportare nel campo "Note" il numero della NC istruita con il relativo riferimento della colonna No.

Campo Note: per ciascuna nota inserita indicare sempre il corrispondente riferimento numerico della colonna No.

[Bar Code]	P/N 366320 A00134 Description ASSY MAINS CABINETS S/N R304	Quantity SAP S/N SAP Batch SAP Equipment Number Work Order BEIM	Total Hours / Landings 1588 Hours / Landings since Overhaul 338 00,00 LdC / Inspection Batch	Notes REMOVED FROM LEONARDO 2134 AW139-44234/11/19/19 A939 RC WORK REPORT N. 65805490 INSPECTED <input type="checkbox"/> <input checked="" type="checkbox"/> REPAIRED <input type="checkbox"/> <input checked="" type="checkbox"/> OVERHAUL <input type="checkbox"/> <input checked="" type="checkbox"/>
This part or material has been produced in compliance to approved design data				Inspector: Booker Date: 13 DEC 2007 A14 001



Stabilimento di
Leonardo Helic. - Cascina Costa Rev.
Via Giovanni Agusta 520
21017 Cascina costa di Samarate (VA)

Leonardo S.p.a
Sede legale: Piazza Monte Grappa, 4 - 00195 Roma -
Capitale Sociale €2.543.861.738,00 i.v.
Registro Imprese c/o la CCIAA di Roma, Codice Fiscale, n 00401990585
Partita Iva: P.I.: IT 00881841001

<input type="checkbox"/> RIF.DICHIARAZIONE DI CONFORMITA' N° <input type="checkbox"/> AVVISO DI SPEDIZIONE N°			DOCUMENTO DI TRASPORTO 8304235 N° FG. 1 / 1		
DATA	CAUSALE TRASPORTO	CODICE CLIENTE	DESTINATARIO		
15.12.2021	Trasferimento	21000005	Leonardo Spa # DIV 20 (TRAN) Logistic Centre Prod.Support Bldg26 Scarico merce via Cascina Nuova SP47 I-21029 VERGIATE VA		
COMMESSA	ORDINE CLIENTE				
4802476971					
MEZZO DI TRASPORTO		LUOGO DI SPEDIZIONE			
NostroMezzo		CASCINA COSTA			
ITEM	IDENTIFICATIVI/DESCRIZIONE	U.M.	QUANTITA'	ANNOTAZIONI	
20	3G6320A00134 GEARBOX ASSY MAIN S/N: R304 (304) La parte è stata verificata per corretto prelevamento, movimentazione, immagazzinamento e imballaggio, e per corretta applicazione di eventuali bollettini tecnici e prescrizioni di aeronavigabilità, prima della consegna. Data <i>Impronta e Firma</i>	N	1,000 = A,ZZZ	<div style="font-size: 2em; font-family: cursive;">70619803</div>	
1=A 2=B 3=G 4=H 5=M 6=P 7=S 8=T 9=K 0=Z , =,					
TIPO E N°COLLI		VEETTORE	DATA RITIRO	FIRMA VETTORE	
1 CASSA			16 DEC 2021		
		FIRMA CONDUCENTE	DATA RITIRO	FIRMA DESTINATARIO	
PESO LORDO 0,000 NETTO 0,000		INDICARE OBBLIGATORIAMENTE UNA DELLE SEGUENTI CAUSE IN CASO DI COMPILAZIONE MANUALE E' SUFFICIENTE APPORRE UNA CROCETTA NELLA CASELLA CORRISPONDENTE			
TRASPORTO <input type="checkbox"/> MITTENTE A CURA DEL <input type="checkbox"/> DESTINATARIO <input type="checkbox"/> VETTORE		<input type="checkbox"/> Vendita <input type="checkbox"/> Garanzia <input type="checkbox"/> Trasferimenti interni <input type="checkbox"/> Conto lavorazione <input type="checkbox"/> Reso da		<input type="checkbox"/> Conto visione <input type="checkbox"/> Conto prestito d'uso <input type="checkbox"/> Conto deposito <input type="checkbox"/> Conto omaggio	

LEONARDO ELICOTTERI
STABILIMENTO DI VERGIATE
CARPINO SIMONE

16 DIC 2021

ACCELTATO CON DIRITTO DI RISERVA
FIRMA VETTORE

AUTOTRASPORTI ANDRICCIOLA
di Andricciola Peppino e C. s.a.s.
Via Nuova, 8 - 28040 BORGIO TICINO (NO)
Cod. Fisc. e P.IVA 02098420033
N. Iscr. Albo Trasp. NO 0653544Q
mail: info@autotrasportiandricciola.it