


DETAILS ¹	
Aircraft Reg. / Component P/N:	9M-LKE
Aircraft Type:	AS350 B3
Aircraft/Component S/N:	8297
Envision Ref:	8297000016#2 
Prepared by:	CRISTHO
Requested by:	NIK AMIRUL

TYPE OF INSPECTION ²	
Scheduled	<input checked="" type="checkbox"/>
Defect Rectification	<input type="checkbox"/>
Component	<input type="checkbox"/>
Others	<input type="checkbox"/>

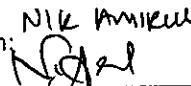
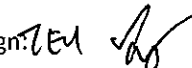
BMR Required ³	Yes	No
	<input type="checkbox"/>	<input checked="" type="checkbox"/>



Approved Maintenance Programme ⁴	Aircraft Maintenance Manual ⁵	Engine Maintenance Manual ⁶
AHM/CAM/AMP/AS350B3 Iss.1 Rev.1 Dated 05 Jun 2020	Rev.20 dated 01.11.2021	Rev.23 Dated 30.12.2021

Airframe Hours (Induction) ⁷

Work Details ⁸
1. 150H P.O Insp. Tail Rotor Drive Shaft

AD/SB ⁹
2. 50H (AD 2021-0282) ASB 05.01.03 R0 Check of absence of rotation
3. 150H (AD 2021-0048) ASB 05.01.01 R0 marking on upper link

PNP ¹⁰	LAE ¹¹
Maintenance Start Date: 9/2/22	Entry in Aircraft Journey Log no.: 02198
Work Order completed <input checked="" type="checkbox"/>	
Parts used sheet attached (Yes/Not required) BMR issued (Yes/Not required)	
Name & Sign:  Date: 10/2/22	Name & Sign:  Date: 10/2/22


CAMO ¹²			
Worksheet			
Total pages issued	02	Total pages used	00
Total pages added	-	Total pages disposed	02
Documents issued with this work order:			
No.	Description	No. of pages	
1	Envision Work Order 82970000162	05072	
2	C.O.S	01	
3	ESI/AS350/331	05	
4	ESI/AS350/461	06	
5			
6			
7			
8			
9			
10			
Aircraft Journey Log updated <input checked="" type="checkbox"/>		Remarks: - NIL -	
Name: AFIQ		Sign & Stamp:  	Date: 23 Feb 2022



1. Work Order No.:

2022 022 001

2. Item	3.	Work Required			
		5. Sign	Performed by Auth. no.	6. Sign	Inspected by - CRS * Auth. no. Date

0020	FOR TIME CLOCKING				
Remarks	For time purpose only 				



7. * The work recorded above has been carried out in accordance with the requirements of the ** Malaysian Civil Aviation Regulation / FAA Regulations / _____
 for the time being in force an in that respect the aircraft /equipment is considered fit for Release to Service.
 ** Delete as required.

WORK ORDER REFERENCE 82970000162	SUPPLIER AIRBUS	CUSTOMER KIHUAT TIMBER (M) SDN. BHD.	CUSTOMER CONTRACT REF
--	---------------------------	--	------------------------------

H/C TYPE AS350B3	A/C SERIAL NUMBER 8297	H/C REG 9M-LKE	AMP / REV NO / DATE ECMP/KIHUAT/AS350B3 / 009
----------------------------	----------------------------------	--------------------------	---

CURRENT T.S.N.	LANDING	LOCATION SZB	SAP Reference 2022 022 001
-----------------------	----------------	------------------------	--------------------------------------

DUPLICATE INSPECTION : YES <input type="checkbox"/>	ORDER CREATED ON : 12/01/2022	BY : Benjamin C
--	--------------------------------------	------------------------

PERFORM :
 P.O 150H TRDS INSPECTION, 50H AD 2021-0282; 150H AD 2021-0048

Closed Date : 26 FEB 2022

COMPONENT EXCHANGE					
Task No.	Description	Part Number	Serial Number	PO Number	Reason for Removal
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		
			R / I		

SUMMARY WORK ORDER SIGNOFF SHEET			
CUSTOMER	A/C Registration	A/C MSN	Work Order No
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000162

Tools				
Task No	Description	Part Number	Serial Number	Expiration Date

SUMMARY WORK ORDER SIGNOFF SHEET

CUSTOMER	A/C Registration	A/C MSN	Work Order No
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000162




MI No: AS350B3/65/10/00/000/000/030 MI Title : 150H-TAIL ROTOR DRIVE SHAFT

Work Description :
TAIL ROTOR DRIVE SHAFT

Each time after the component is installed.
Balance check after each removal/installation the shaft
FT, GR.

IAW AMM 65-11-00, 5-1

Life	0:00AH	Work Card	AS350B3.65.11.00.§5-1A
Work Card Task Reference			AMM 65-11-00, 5-1A

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0001 AS350-TAIL ROTOR DRIVE SHAFT P/N : 65-10 S/N : 8297	401:11AH	N/A				10/2/22	CARRIED OUT, FOUND SATISFACTORY. VIBRATION RESULT : 0.68 IPS @ 01:20 REFER ATTACHED FOR RESULT.


MI No: AS350B3/65/10/00/000/000/030 MI Title : 150H-TAIL ROTOR DRIVE SHAFT

Work Description :
TAIL ROTOR DRIVE SHAFT

Each time after the component is installed.
Balance check after each removal/installation the shaft
FT, GR.

IAW AMM 65-11-00, 5-1

Life	0:00AH	Work Card	AS350B3.65.11.00.§5-1B
Work Card Task Reference			AMM 65-11-00, 5-1B

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0002 AS350-TAIL ROTOR DRIVE SHAFT P/N : 65-10 S/N : 8297	401:11AH	N/A					N/A. STEADY CONTROL NOT BEING USED TO DO VIBRATION CHECK. REFER TASK LKE0001 FOR VIBRATION CHECK RESULT.

"Certifies that the work specified, except as otherwise specified was carried out i.a.w CAAM Part 145 and in that respect the aircraft/ aircraft component is considered ready to release to service."

SUMMARY WORK ORDER SIGNOFF SHEET			
CUSTOMER	A/C Registration	A/C MSN	Work Order No
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000162

MI No: AD 2021-0048 R0 [AS350]-MARKING (O) MI Title : 150H-Initial compliance: Marking on the main rotor rod upper link

Work Description :
 [INITIAL COMPLIANCE]
 Within 150FH after 02-Mar-21, apply markings i.a.w. para 3.B.2.a of ASB AS350-05.01.01 R0. Refer ESI/AS350/331.

Life	0:00AH	Work Card	AD 2021-0048
Work Card Task Reference			N/A

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0004 AS350-ROD END FITTING P/N : 12-6891P S/N : AMD 0730	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0005 AS350-ROD END FITTING P/N : 12-6891P S/N : AMD 0732	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0006 AS350-ROD END FITTING P/N : 12-6891P S/N : AMD 0731	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0007 AS350-ROD END FITTING P/N : 12-6892P S/N : AMD 0735	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0008 AS350-ROD END FITTING P/N : 12-6892P S/N : AMD 0734	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0009 AS350-ROD END FITTING P/N : 12-6892P S/N : AMD 0733	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.




"Certifies that the work specified, except as otherwise specified was carried out i.a.w CAAM Part 145 and in that respect the aircraft/ aircraft component is considered ready to release to service."

SUMMARY WORK ORDER SIGNOFF SHEET			
CUSTOMER	A/C Registration	A/C MSN	Work Order No
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000162

MI No: AD 2021-0282 R0-INITIAL (O) **MI Title :** 50H-Check for absence of rotation of the bearing spacer and applied black paint marking

Work Description :
Within 50 FH after 31-Dec-21, comply with paragraph 3.B.2.a of ASB AS350-05.01.03 R0. (ESI/AS350/461)







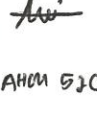





Life	0:00AH	Work Card	N/A
Work Card Task Reference			N/A

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0010 AS350-PITCH CHANGE UNIT P/N : 350A33-2167-01 S/N : MA103768	415:30AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.

MI No: ASB 05.01.01 R0-MARKING (O) **MI Title :** 150H-INITIAL COMPLIANCE: MARKING OF PITCH ROD UPPER LINK

Work Description :
[INITIAL COMPLIANCE]
Within 150FH after 09-Feb-21, apply markings i.a.w. para 3.B.2.a. Refer ESI/AS350/331.

Life	0:00AH	Work Card	ASB 05.01.01 R0
Work Card Task Reference			ASB 05.01.01 R0

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0011 AS350-ROD END FITTING P/N : 12-6892P S/N : AMD 0734	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0012 AS350-ROD END FITTING P/N : 12-6892P S/N : AMD 0735	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0013 AS350-ROD END FITTING P/N : 12-6891P S/N : AMD 0732	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0014 AS350-ROD END FITTING P/N : 12-6892P S/N : AMD 0733	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.

"Certifies that the work specified, except as otherwise specified was carried out i.a.w CAAM Part 145 and in that respect the aircraft/ aircraft component is considered ready to release to service."







SUMMARY WORK ORDER SIGNOFF SHEET

CUSTOMER	A/C Registration	A/C MSN	Work Order No
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000162

MI No: ASB 05.01.01 R0-MARKING (O) **MI Title : 150H-INITIAL COMPLIANCE: MARKING OF PITCH ROD UPPER LINK**

Work Description :
 [INITIAL COMPLIANCE]
 Within 150FH after 09-Feb-21, apply markings i.a.w. para 3.B.2.a. Refer ESI/AS350/331.




Life	0:00AH	Work Card	ASB 05.01.01 R0
Work Card Task Reference			ASB 05.01.01 R0

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0015 AS350-ROD END FITTING P/N : 12-6891P S/N : AMD 0731	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.
Task n° : LKE0016 AS350-ROD END FITTING P/N : 12-6891P S/N : AMD 0730	421:42AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.

MI No: ASB 05.01.03 R0-INITIAL (O) **MI Title : 50H-Check for absence of rotation of the bearing spacer and applied black paint marking**

Work Description :
 Within 50 FH from 16-Dec-21, comply with paragraph 3.B.2.a of ASB AS350-05.01.03 R0. (ESI/AS350/461)

Life	0:00AH	Work Card	N/A
Work Card Task Reference			N/A

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0017 AS350-PITCH CHANGE UNIT P/N : 350A33-2167-01 S/N : MA103768	415:30AH	N/A	 AHM 520			9/2/22	CARRIED OUT, FOUND SATISFACTORY.

"Certifies that the work specified, except as otherwise specified was carried out i.a.w CAAM Part 145 and in that respect the aircraft/ aircraft component is considered ready to release to service."

SUMMARY WORK ORDER SIGNOFF SHEET




CUSTOMER	A/C Registration	A/C MSN	Work Order No
KIHUAT TIMBER (M) SDN. BHD.	9M-LKE	8297	82970000162

MI No: AS350B3-AIRCRAFT GENERAL VERIFICATION **MI Title : AIRCRAFT GENERAL VERIFICATION**

Work Description :
GENERAL VERIFICATION TO BE CARRIED OUT ON AIRCRAFT OR COMPONENT AS FOLLOWS:

- A) CLEAR OF ALL TOOLS, EQUIPMENT AND ANY EXTRANEIOUS PARTS OR MATERIAL, AND
- B) ALL ACCESS PANELS REMOVED HAVE BEEN DULY REFITTED.

Life	N/A	Work Card	N/A
Work Card Task Reference		N/A	

Task n°	Due at	Dup Insp	Tech Sign	Eng Sign	Eng Stamp	Date	Remarks/Action Taken
Task n° : LKE0018 AS350B3 P/N : AS350B3 S/N : 8297	N/A	N/A				15/2/22	CARRIED OUT, FOUND SATISFACTORY.

"Certifies that the work specified, except as otherwise specified was carried out i.a.w CAAM Part 145 and in that respect the aircraft/ aircraft component is considered ready to release to service."