


# SAFETY INFORMATION NOTICE

**SUBJECT: ROTOR FLIGHT CONTROLS**

**Hoist cartridge control buttons on the collective sticks**

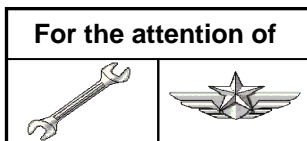

AIRCRAFT CONCERNED	Version(s)	
	Civil	Military
AS355	E, F, F1, F2, N, NP	
AS555		AF, AN, SN, UF, UN
AS365	N, N1, N2, N3	F, Fs, K
SA366		GA
EC155	B, B1	
SA330		Sm
EC225	LP	
AS332	C, C1, L, L1, L2	B, B1, F1, M, M1
AS532		A2, U2, AC, AL, SC, UE, UL

Airbus Helicopters has been informed of a case of activation of the hoist cartridge during a maintenance inspection.

The investigations revealed that a cap had been installed on the hoist cartridge control button on one of the collective grips of the helicopter.

This cap caused interference between the pushbutton and its safety guard, which led to the unintended activation.

According to the definition of the collective grips listed below and the corresponding CMM, no cap is installed on this pushbutton.

### No. 3889-S-67

#### Pushbutton without cap



#### List of affected grips by helicopter version:

Helicopter Model	P/N
AS355 E; F; F1; F2; N AS555 AF; AN; SN; UF; UN	704A41-1100-60
AS355 NP	704A41-1100-60 704A41-1101-43
AS365 F	704A41-1100-73 704A41-1100-75
AS365 FS	704A41-1100-75 704A41-1100-76
AS365 K	704A41-1100-56 704A41-1100-57
AS365 N	704A41-1100-67 704A41-1100-68 704A41-1100-74
AS365 N1	704A41-1100-56 704A41-1100-57 704A41-1100-67 704A41-1100-68
AS365 N2	704A41-1100-56 704A41-1100-57 704A41-1100-98 704A41-1100-99
AS365 N3	704A41-1101-32
AS366 GA	704A41-1100-79
EC155 B and EC155 B1	704A41-1101-32
SA330 SM	704A41-1100-97
AS332 B	704A41-1100-42 704A41-1100-97
AS332 B1, F1	704A41-1100-42 704A41-1100-50 704A41-1100-97

### No. 3889-S-67

Helicopter Model	P/N
AS332 C	704A41-1100-42 704A41-1100-50 704A41-1100-97
AS332 C1	704A41-1100-42 704A41-1100-97
AS332 L and AS332 L1	704A41-1100-42 704A41-1100-97
AS332 L2	704A41-1100-97 704A41-1101-14 704A41-1101-30
AS332 M	704A41-1100-42 704A41-1100-97
AS332 M1	704A41-1100-42 704A41-1100-50 704A41-1100-97 704A41-1101-00 704A41-1101-02
AS532 A2, U2	704A41-1100-97 704A41-1101-30 704A41-1101-31
AS532 AC, AL, SC, UE	704A41-1100-97
AS532 UL	704A41-1100-97 704A41-1101-02
EC225 LP	704A41-1101-14