

DELIVERY NOTE WP

DELIVER TO:


GALAXY AEROSPACE (M) SDN. BHD.
CAMO DEPARTMENT
Lot 11, MRO Centre,
Malaysia International Aerospace Centre,
Sultan Abdul Aziz Shah Airport,
47200 Subang, Selangor
Malaysia.
Attn: Zaty Nadhira binti Mohamed Zuhari

DN NUMBER: GAM/DN/23/133
OUR REFERENCE: 9M-BOB-14712
WO REFERENCE: 2023-14712
DATE COMPLETION: 30 August 2023
AJL NUMBER: 000117

A/C DETAILS					
A/C TYPE	AW139	A/C REG	9M-BOB	A/C S/N	11212
OWNER / OPERATOR	FIRE AND RESCUE DEPT. OF MALAYSIA	A/C TOTAL TIME	3843:53	LANDINGS	4450
ENGINE #1 S/N	PCE-BC0308	T.S.N	1068:43	T.S.O	-
ENGINE #2 S/N	PCE-BC0358	T.S.N	3047:23	T.S.O	-

LIST OF TASKS PERFORMED	WP NUMBER	NUMBER OF PAGES						
		*WS	*PR	*TR	*ARC	*S	*SBC	*OTH
ASB NO 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE/ INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	-001	1	1	1	-	-	1	-
SB 109EP-173 REV. A PART I (EASA AD 2022-0153)/ ATA 53-CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPECTION (EVERY 100FH)	-002	1	1		-	-	1	-

*THIS IS TO CERTIFY THAT TASKS LISTED ABOVE HAS BEEN ACCOMPLISHED AS PER PO/WORK ORDER/SERVICE ORDER NO. 1AS ABOVE.

NAME	NURUL AMIRA	SIGNATURE		DATE	5 SEPTEMBER 2023
------	-------------	-----------	---	------	------------------

VERIFIED AND ACCEPTED BY	NUR HUSNINA BINTI MUHAMAD ZURAIDI CAMO Planner Galaxy Aerospace (M) Sdn Bhd (1040262-D)
DATE	07/09/23

*WS – WORKSHEET

*S – SERVICEABLE LABEL

WORK ORDER



To: GALAXY AEROSPACE (M) SDN. BHD.

Address: Lot 11-14, MRO Centre, Malaysia
International Aerospace Centre, SAAS Airport,
Subang
Malaysia

Attention: Mr. Syafrul Yamani
Engineering Manager
syafrul@galaxy aerospace.my

Work Order Number: 2023-14712

Work Pack Reference: 9M-BOB-14712

Date Issued: 22/02/2023

A/C Registration / SN: 9M-BOB/11212

Sheet: 1 of 1

Description:

Item	Description/Task/Inspection	Reference	Man Hours
1	ASB NO 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE/INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	ASB NO 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE	<u>1.0</u> (PLEASE ADVISE)
2	SB109EP-173 REV. A PART I (EASA AD 2022-0153)/ ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPECTION (EVERY 100FH)	SB109EP-173 REV. A PART I (EASA AD 2022-0153)	<u>6.0</u> (PLEASE ADVISE)

DUE AT 3851:58 FH

Remark/Notes:

1. State this Work Order reference on your Work Package. Should there is any additional job/defect (unless specified in the work package) the maintenance organization must notify GAM Continuing Airworthiness Manager prior to proceed with rectification.
2. Work must be carried out in accordance with approved data and perform by qualified personnel/ approved LAE from the maintenance organization.
3. Parts used must be written in Parts Report Form and accompanied by ARC, Serviceable Label or equivalent document.
4. Test report, parameter reading or any supporting data must be attached with the worksheet if applicable.
5. The maintenance organization shall be responsible for any damages made on the aircraft/ components during maintenance.
6. Softcopy of completed Work Package shall be submitted or as mutual agreed and GAM Continuing Airworthiness Manager must be informed once the aircraft is Release to Service.
7. Completed Work Package (original) must be submitted to GAM Continuing Airworthiness Manager office within 3 days of date of completion.

I hereby declare that an approved and up to date maintenance data has been referred for the issuance of this work order.

Thank you.
Best Regards,



CLIENT/OWNER: JABATAN BOMBA DAN PENYELAMAT MALAYSIA	SERIAL NO.	HOURS	LDG/CYCLE	WORKPACK NO:	9M-BOB-14712
AIRCRAFT TYPE: A109E	AIRCRAFT 11212	3843:53	4450	WORK/INSP/DESC:	SCHEDULED INSPECTION
REGISTRATION: 9M-BOB	#1 ENGINE: PCE-BC0308	1068:43	-	AERONET JOB NO.:	2023-14712
BASE/FACILITY: MIAT	#2 ENGINE: PCE-BC0358	3047:23	-	AJL REF NO.:	000117
DATE IN: 30-8-23 OUT: 30-8-23			NG / N1 NF / N2	SHEET:	1 OF 1

Reason for raising: SCHEDULED INSPECTION TO BE CARRIED OUT I.A.W. EMM PW206C/PW207C REVISION 46 (05-12-2022). IETP A109E, 33rd Issue: 2022-06-10 UPDATE 001 - 2022-11-16. AMP NO. JBPM/CAMO/AMP/A109E ISSUE 2 REV. 0	Raised by and date: CAMO; Mohd Haffiz Ismail 22/02/2023	Other requirements/information: NIL
---	---	--

List of scheduled inspection and all work carried out under this workpack including individual reference			DATE INSPECTION COMPLETED	Master Signature Schedule		
NO.	INSPECTION / WORK	WORKSHEET REF		NAME	SIGNATURE	APP/STAMP
1	ASB NO 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE/INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	14712-001	30-8-23	ADZRAEI HASIFF	<i>Husiff</i>	
2	SB109EP-173 REV. A PART I (EASA AD 2022-0153)/ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPECTION (EVERY 100FH)	14712-002	30-8-23	AKMAL HADAYAT	<i>Ahmad</i>	8320
<div style="border: 2px solid green; padding: 10px; margin: 10px auto; width: 80%;"> <p>Galaxy Aerospace (M) Sdn. Bhd.</p> <p><i>I hereby certify the following task has been performed and found satisfactory:</i></p> <p><i>1) All the tools and equipment used for maintenance has been removed from aircraft. 2) All the access panels removed for maintenance access has been reinstalled. 3) All the excess spares and materials have been notified to AMO Planner for return plan. 4) FOD check has been done.</i></p> <p>Sign & Stamp: <i>Husiff</i> Date & Time: 30-8-23 1600</p> </div>						

PART 145 - AMO RELEASE STATEMENT AMO/2016/02 THIS IS TO CERTIFY THAT ALL WORK LISTED ABOVE HAS BEEN INSPECTED AND ACCOMPLISHED IN ACCORDANCE WITH CONTRACTED AMO EXPOSITION AND PROCEDURE LATEST REVISION, AND <input checked="" type="checkbox"/> * OEM PUBLICATION/REVISION AS PER REASON FOR RAISING ABOVE <input type="checkbox"/> *IF DIFFERENT FROM ABOVE. OEM PUBLICATION/REVISION..... <input type="checkbox"/> * TICK ✓ WHERE APPLICABLE	NAME	ADZRAEI HASIFF
	SIGN & APPROVAL	<i>Husiff</i>
	FIRM	GAM
	DATE	30-8-2023

PART M - CAMO ACCEPTANCE STATEMENT THIS IS TO CERTIFY THAT THE ABOVE MENTIONED WORK PACKAGE HAS BEEN REVIEWED, CHECKED FOR COMPLETION AND UPDATED IN THE	NAME	SIGN & APPROVAL	DATE
	NUR HUSNINA BINTI	<i>Husnina</i>	07/09/23



CLIENT/OWNER: JABATAN BOMBA DAN PENYELAMAT MALAYSIA	SERIAL NO.	HOURS	LDG/CYCLE	WORKSHEET NO:	14712-001
AIRCRAFT TYPE: A109E	AIRCRAFT	11212	REFER WORKPACK	WORK/INSP/DESC:	INSPECTION OF ROTOR
REGISTRATION: 9M-BOB	#1 ENGINE: PCE-BC0308	REFER WORKPACK		WORKPACK REF:	9M-BOB-14712
BASE/FACILITY: <i>MIAT</i>	#2 ENGINE: PCE-BC0358	REFER WORKPACK		AJL REF NO.:	REFR WORKPACK
DATE IN: REFER WORKPACK OUT: REFER WORKPACK			NG / N1 NF / N2	SHEET:	1 OF 1

Reason for raising: SCHEDULED INSPECTION TO BE CARRIED OUT I.A.W. EMM PW206C/PW207C REVISION 46 (05-12-2022). IETP A109E, 33rd Issue: 2022-06-10 UPDATE 001 - 2022-11-16. AMP NO. JBPM/CAMO/AMP/A109E ISSUE 2 REV. 0 INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	Raised by and date: CAMO; Mohd Haffiz Ismail 22/02/2023	Other requirements/information: NIL
--	---	--

Item	Description	Technician	* Eng. CRS	Date
1	ASB 109EP-176 TO INSPECT THE CONTROL CABLE IN PROXIMITY OF THE CONTROL QUADRANT TO VERIFY ITS INTEGRITY. REF: ASB 109EP-176 // AD 2021-0067 REMARKS: <i>CARRIED OUT. SATISFACTORY.</i>	<i>AM</i> 7390	<i>Muhammad</i> 	<i>30-8-23</i>

*Certifies that the work specified above, except as otherwise specified, was carried out in accordance with CAA Malaysia Requirements and in respect to that work the aircraft / aircraft component is considered ready for release to service. *AMO/2016/02*

*Certifies that the work specified above, except as otherwise specified, was carried out in accordance with _____ and in respect to that work the aircraft / aircraft component is considered ready for release to service.



TICK ✓ WHERE APPLICABLE

Please send to the following address: LEONARDO S.p.A. CUSTOMER SUPPORT & SERVICES - ITALY PRODUCT SUPPORT ENGINEERING & LICENSES DEPT. Via Giovanni Agusta, 520 21017 Cascina Costa di Samarate (VA) - ITALY Tel.: +39 0331 225036 Fax: +39 0331 225988	SERVICE BULLETIN COMPLIANCE FORM	Date: 30-8-2023
	Number: 109EP - 176	
	Revision: /	

Customer Name and Address: GALAXY AEROSPACE (M) SDN BHD Suite 11-14, Helicopter Centre, Malaysia International Aerospace Centre, Sultan Abdul Aziz Shah Airport, 47200 Subang, SELANGOR DARUL EHSAN	Telephone: 603-7734 7226
	Fax: 603-7734 7226
	B.T. Compliance Date:

Helicopter Model	S/N	Total Number	Total Hours	T.S.O.
A109E	11212	1	3843:53	

Remarks: CARRIED OUT AND FOUND SATISFACTORY.



 30-8-23
 



CLIENT/OWNER: JABATAN BOMBA DAN PENYELAMAT MALAYSIA AIRCRAFT TYPE: A109E REGISTRATION: 9M-BOB BASE/FACILITY: MIAT DATE IN: REFER WORKPACK OUT: REFER WORKPACK	SERIAL NO.	HOURS	LDG/CYCLE		WORKSHEET NO: 14712-001
	AIRCRAFT	11212	REFER WORKPACK		WORK/INSP/DESC: INSPECTION OF ROTOR
	#1 ENGINE:	PCE-BC0308	REFER WORKPACK		WORKPACK REF: 9M-BOB-14712
	#2 ENGINE:	PCE-BC0358	REFER WORKPACK		AJL REF NO.: REFR WORKPACK
			NG / N1	NF / N2	SHEET: 1 OF 1

REASON FOR RAISING: SCHEDULED INSPECTION TO BE CARRIED OUT I.A.W. EMM PW206C/PW207C REVISION 46 (05-12-2022). IETP A109E, 33rd Issue: 2022-06-10 UPDATE 001 - 2022-11-16. AMP NO. JBPM/CAMO/AMP/A109E ISSUE 2 REV. 0 INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	Raised by and date: CAMO; Mohd Haffiz Ismail 22/02/2023	Other requirements/information: NIL
---	---	--

Item	Part No	Description	Serial Number		Qty	Position	Reason	Lifed Item Information TSN/TSO/DUE/TIMEX	Release Reference
			Off	On					
(This table area is crossed out with a diagonal line)									

NAME	FIRM	SIGN & APPROVAL	DATE
ADZRAEI HASIFF	GAM	<i>Hasiff</i> 	30-8-2023


- *Certifies that the work specified above, except as otherwise specified, was carried out in accordance with CAA Malaysia Requirements and in respect to that work the aircraft / aircraft component is considered ready for release to service. **AMO/2016/02**
- *Certifies that the work specified above, except as otherwise specified, was carried out in accordance with _____ and in respect to that work the aircraft / aircraft component is considered ready for release to service.

TICK WHERE APPLICABLE



CLIENT/OWNER: JABATAN BOMBA DAN PENYELAMAT MALAYSIA	SERIAL NO.	HOURS	LDG/CYCLE	WORKSHEET NO: 14712-002
AIRCRAFT TYPE: A109E	AIRCRAFT: 11212	REFER WORKPACK		WORK/INSP/DESC: ATA 53 - CENTRAL
REGISTRATION: 9M-BOB	#1 ENGINE: PCE-BC0308	REFER WORKPACK		WORKPACK REF: 9M-BOB-14712
BASE/FACILITY: MIAT	#2 ENGINE: PCE-BC0358	REFER WORKPACK		AJL REF NO.: REFR WORKPACK
DATE IN: REFER WORKPACK OUT: REFER WORKPACK			NG / N1 NF / N2	SHEET: 1 OF 1

Reason for raising: SCHEDULED INSPECTION TO BE CARRIED OUT I.A.W. EMM PW206C/PW207C REVISION 46 (05-12-2022). IETP A109E, 33rd Issue: 2022-06-10 UPDATE 001 - 2022-11-16. AMP NO. JBPM/CAMO/AMP/A109E ISSUE 2 REV. 0 ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPECTION (EVERY 100FH)	Raised by and date: CAMO; Mohd Haffiz Ismail 22/02/2023	Other requirements/information: NIL
---	---	--

Item	Description	Technician	* Eng. CRS	Date
1	<p>EASA AD 2020-0256 (SB109EP-173 REV. A PART I) (EVERY 100FH) ATA 53 - CENTRAL FUSELAGE FRAME ASSY - INSPECTION</p> <p>INSPECT EACH AFFECTED AREA (CENTRE FUSELAGE FRAME ASSEMBLY AT STATION (STA) 1815, THE INTERSECTION OF LATERAL PYLON WITH FLOOR SPAR, LEFT-HAND (LH) AND RIGHT-HAND (RH) SIDES) IN ACCORDANCE WITH THE INSTRUCTIONS OF ALERT SB 109EP-173.</p> <p>NOTES: THE HELICOPTERS POSTS THAT HAVE BEEN REPAIRED IN ACCORDANCE WITH PART II (LH SIDE) OR PART III (RH SIDE) OF THIS SERVICE BULLETIN, OR IN ACCORDANCE WITH REPAIR DRAWING P/N 109-0952-67-117 (LH SIDE) OR P/N 109-0952-67-102 (RH SIDE) SHALL BE INSPECTED IN ACCORDANCE WITH PART I AFTER THEY HAVE ACCUMULATED MORE THAN 1000 FH OF 3500 LANDINGS SINCE REPAIR. SUBSEQUENTLY, INSPECTIONS OF THAT AREA MUST BE ACCOMPLISHED AT INTERVALS NOT EXCEEDING 100 FH.</p> <p>NOTES: PART II AND PART III SHOULD BE CARRIED OUT BEFORE THE NEXT FLIGHT AFTER THE CRACKS ARE FOUND DURING COMPLIANCE WITH PART I OF THE SERVICE BULLETIN.</p> <p>REF: EASA AD 2020-0256 ISSUE 17 NOV 2020, ALERT SB 109EP-173 REV. A - 21 JULY 2022 DATED ON 10 NOV 2020 ERRATA CORRIGE</p> <p>REMARKS: CARRIED OUT AND FOUND SATISFACTORY</p>	<p><i>Handwritten signature</i> 4320</p> 	<p><i>Handwritten signature</i></p>	<p>30-8-23</p>

*Certifies that the work specified above, except as otherwise specified, was carried out in accordance with CAA Malaysia Requirements and in respect to that work the aircraft / aircraft component is considered ready for release to service. **AMO/2016/02**

*Certifies that the work specified above, except as otherwise specified, was carried out in accordance with _____ and in respect to that work the aircraft / aircraft component is considered ready for release to service.


TICK ✓ WHERE APPLICABLE

Please send to the following address: LEONARDO S.p.A. CUSTOMER SUPPORT & SERVICES - ITALY PRODUCT SUPPORT ENGINEERING & LICENSES DEPT. Via Giovanni Agusta, 520 21017 Cascina Costa di Samarate (VA) - ITALY Tel.: +39 0331 225036 Fax: +39 0331 225988	SERVICE BULLETIN COMPLIANCE FORM	Date: 30.8.2023
	Number: 109EP-173	
	Revision: B - AUGUST 24, 2023	

Customer Name and Address: GALAXY AEROSPACE (M) SDN BHD Suite 11-14, Helicopter Centre, Malaysia International Aerospace Centre, Sultan Abdul Aziz Shah Airport, 47200 Subang, SELANGOR DARUL EHSAN	Telephone: 603-7734 7226
	Fax: 603-7734 7226
	B.T. Compliance Date:

Helicopter Model	S/N	Total Number	Total Hours	T.S.O.
A109E	11212	1	3843 : 53	

Remarks: CARRIED OUT. FOUND SATISFACTORY.

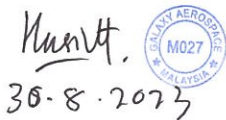

 30.8.2023



CLIENT/OWNER: JABATAN BOMBA DAN PENYELAMAT MALAYSIA	SERIAL NO.	HOURS	LDG/CYCLE	WORKSHEET NO: 14712-002
AIRCRAFT TYPE: A109E	AIRCRAFT: 11212	REFER WORKPACK		WORK/INSP/DESC: ATA 53 - CENTRAL
REGISTRATION: 9M-BOB	#1 ENGINE: PCE-BC0308	REFER WORKPACK		WORKPACK REF: 9M-BOB-14712
BASE/FACILITY: MIAT	#2 ENGINE: PCE-BC0358	REFER WORKPACK		AJL REF NO.: REFR WORKPACK
DATE IN: REFER WORKPACK OUT: REFER WORKPACK		NG / N1	NF / N2	SHEET: 1 OF 1

REASON FOR RAISING: SCHEDULED INSPECTION TO BE CARRIED OUT I.A.W. EMM PW206C/PW207C REVISION 46 (05-12-2022). IETP A109E, 33rd Issue: 2022-06-10 UPDATE 001 - 2022-11-16. AMP NO. JBPM/CAMO/AMP/A109E ISSUE 2 REV. 0 ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPECTION (EVERY 100FH)	Raised by and date: CAMO; Mohd Haffiz Ismail 22/02/2023	Other requirements/information: NIL
---	---	--

Item	Part No	Description	Serial Number		Qty	Position	Reason	Lifed Item Information TSN/TSO/DUE/TIMEX	Release Reference
			Off	On					
(Table content is crossed out with a diagonal line)									

NAME	FIRM	SIGN & APPROVAL	DATE
ADZRAEI HASIFF	GAM	<i>Nusatt</i> 	30.8.23

*Certifies that the work specified above, except as otherwise specified, was carried out in accordance with CAA Malaysia Requirements and in respect to that work the aircraft / aircraft component is considered ready for release to service. **AMO/2016/02**

*Certifies that the work specified above, except as otherwise specified, was carried out in accordance with _____ and in respect to that work the aircraft / aircraft component is considered ready for release to service.

TICK ✓ WHERE APPLICABLE

Tools Report



Aircraft Serial No:	11212	Work Pack No:	9M-BOB-14712
Aircraft Type:	A109E	DESC:	SCHEDULED
Aircraft Reg:	9M-BOB	PAGE:	1 Of 1

Description	Part No	Serial Number	Worksheet Ref No. / Item No.	Calibration Due Date
-------------	---------	---------------	---------------------------------	----------------------

