


Information Notice

SUBJECT: LIGHTS

O.T.L. of the Gimbal Arms fitted on Spectrolab SX5 & SX16 searchlights

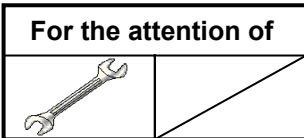

AIRCRAFT CONCERNED	Version(s)	
	Civil	Military
AS355	N, NP	
AS365	N2, N3	
EC225	LP	
EC725		AP
AS332	C, C1, L, L1, L2	B, B1, F1, M, M1
AS532		A2, U2, AC, AL, SC, UE, UL

Rev. 1: addition of EC725 AP

Equipment manufacturer SPECTROLAB issued Service Bulletin #SL0899-01A in CMM 33-45-96, which defines an OTL for the Gimbal Arms that are fitted on the Gimbal assemblies of the SX5 & SX16 searchlights.

These OTLs (7 years for Aluminum Gimbal Arms and 10 years for Steel Gimbal Arms) have been introduced in the maintenance programs (PRE & MSM) of the helicopters listed above.

The Manufacturer Part Numbers of the Gimbal Arms concerned by this OTL are as follows:

1. For the SX5 searchlight:
 - a. MP/N 030041: Aluminum Gimbal Arm fitted on all Gimbal assemblies.
2. For the SX16 searchlight:
 - a. MP/N 019058: Aluminum Gimbal Arm fitted on Gimbal assemblies MP/N 019059-4, -5, -10, -104, -105, -110, -130.
 - b. MP/N 019058-21: IFCO Aluminum Gimbal Arm fitted on Gimbal assemblies MP/N 019059-11, -111, -140.
 - c. MP/N 022929: Steel Gimbal Arm fitted on Gimbal assemblies MP/N 022955-21, -121, -130.
 - d. MP/N 022929-11: IFCO Steel Gimbal Arm fitted on Gimbal assemblies MP/N 022955-22, -122, -140.
 - e. MP/N 022929-81: Steel Gimbal Arm fitted on Gimbal assembly MP/N 022955-51.
 - f. MP/N 021715: Long Arm Aluminum Gimbal Arm fitted on Gimbal assemblies MP/N 021716-21, -31, -121, -131.