



DELIVERY NOTE WP

DELIVER TO :

GALAXY AEROSPACE (M) SDN. BHD.
CAMO DEPARTMENT
Lot 11, MRO Centre,
Malaysia International Aerospace Centre,
Sultan Abdul Aziz Shah Airport,
47200 Subang, Selangor
Malaysia.
Attn : Zaty Nadhira binti Mohamed Zuhari

DN NUMBER : GAM/DN/BOB/21-144
OUR REFERENCE : 9M-BOB-8470
WO REFERENCE : 2021-8470
DATE COMPLETION: 26 NOVEMBER 2021
AJL NUMBER : 000941

A/C DETAILS							
A/C TYPE	A109E	A/C REG	9M-BOB	A/C S/N	11212		
OWNER / OPERATOR	FIRE AND RESCUE DEPT. OF MALAYSIA	A/C TOTAL TIME	3661:30	LANDINGS	4009		
ENGINE #1 S/N	PCE-BC0308	T.S.N	886:20	T.S.O	-		
ENGINE #2 S/N	PCE-BC0358	T.S.N	2865:00	T.S.O	-		
LIST OF TASK PERFORMED	WP NUMBER	NUMBER OF PAGES					
		*WS	*PR	*ARC	*S	*SBC	*OTH
SB109EP-176	001	1	1	-	-	1	-
SB109EP-173 PART I	002	1	1	-	-	1	-
*THIS IS TO CERTIFY THAT TASKS LISTED ABOVE HAS BEEN ACCOMPLISHED AS PER PO/WORK ORDER/SERVICE ORDER NO. AS ABOVE.							
NAME	NURUL LYANA MUHAMAD	SIGNATURE		DATE	6 DECEMBER 2021		
VERIFIED AND ACCEPTED BY				MUHAMMAD IHSAN MASRI CAMO Planner Galaxy Aerospace (M) Sdn. Bhd. (1040262-D)			
DATE				09/10/2021			

- *WS – WORKSHEET
- *PR – PART REPORT
- *ARC – AUTHORISED RELEASE CERTIFICATE
- *S – SERVICEABLE LABEL
- *SBC – SERVICE BULLETIN COMPLIANCE
- *OTH – OTHERS

WORK ORDER



To: GALAXY AEROSPACE (M) SDN. BHD.

Address: Lot 11-14, MRO Centre, Malaysia
International Aerospace Centre, SAAS Airport,
Subang
Malaysia

Attention: Mr. Syafrul Yamani
Engineering Manager
syafrul@galaxy aerospace.my

Work Order Number: 2021-8470

Work Pack Reference: 9M-BOB-8470

Date Issued: 20/10/2021

A/C Registration / SN: 9M-BOB/11212

Sheet: 1 of 1

Description:

Item	Description/Task/Inspection	Reference	Man Hours
1	SB 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE/INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113 <i>Due at 3670:25 FH</i>	SB 109EP-176	0 (PLEASE ADVISE)
2	ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPE/SB109EP-173 PART I (EASA AD NO.: 2020-0256) <i>Due at 3670:25 FH</i>	SB109EP-173 PART I	1.0 (PLEASE ADVISE)

Remark/Notes:

1. State this Work Order reference on your Work Package. Should there is any additional job/defect (unless specified in the work package) the maintenance organization must notify GAM Continuing Airworthiness Manager prior to proceed with rectification.
2. Work must be carried out in accordance with approved data and perform by qualified personnel/ approved LAE from the maintenance organization.
3. Parts used must be written in Parts Report Form and accompanied by ARC, Serviceable Label or equivalent document.
4. Test report, parameter reading or any supporting data must be attached with the worksheet if applicable.
5. The maintenance organization shall be responsible for any damages made on the aircraft/ components during maintenance.
6. Softcopy of completed Work Package shall be submitted or as mutual agreed and GAM Continuing Airworthiness Manager must be informed once the aircraft is Release to Service.
7. Completed Work Package (original) must be submitted to GAM Continuing Airworthiness Manager office within 3 days of date of completion.

I hereby declare that an approved and up to date maintenance data has been referred for the issuance of this work order.

Thank you.
Best Regards,

Zaty Nadhira Mohamed Zuhari
Continuing Airworthiness Management Manager
Email: zaty@galaxy aerospace.my



CLIENT/OWNER: FIRE AND RESCUE DEPT. OF MALAYSIA AIRCRAFT TYPE: A109E REGISTRATION: 9M-BOB BASE/FACILITY: <u>MUAT</u> DATE IN: <u>26/11/2021</u> OUT: <u>26/11/2021</u>	SERIAL NO.	HOURS	LDG/CYCLE		WORKPACK NO:	9M-BOB-8470	
	AIRCRAFT	11212	3661:30	4009	WORK/INSP/DESC:	SCHEDULED INSPECTION	
	#1 ENGINE:	PCE-BC0308	866:20	N/A	N/A	AERONET JOB NO.:	2021-8470
	#2 ENGINE:	PCE-BC0358	2865:00	N/A	N/A	AJL REF NO.:	
			NG / N1	NF / N2	SHEET:	1 OF 1	

Reason for raising: SCHEDULED INSPECTION TO BE CARRIED OUT IN ACCORDANCE WITH JBPM/CAMO/AMP/A109E ISSUE 2 REV 0 DATE 06 MAY 2021 A109E IETP - 32ND ISSUE: 2021-09-15 OR ANY LATEST APPROVED REVISION	Raised by and date: Muhammad Ihsan Masri 20/10/2021	Other requirements/information: NIL
---	---	--

List of scheduled inspection and all work carried out under this workpack including individual reference.	Master Signature Schedule
---	---------------------------

NO.	INSPECTION / WORK	WORKSHEET REF	NAME	TECH/INITIAL	SIGNATURE	APP/STAMP
1	SB 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE/INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	8470-001	<u>Ihsan</u>		<u>Ihsan</u>	
2	ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPE/SB109EP-173 PART 1 (EASA AD NO.: 2020-0256)	8470-002	NORAI SYAH		<u>Norai</u>	-

PART 145 - AMO RELEASE STATEMENT				
THIS IS TO CERTIFY THAT ALL WORK LISTED ABOVE HAS BEEN INSPECTED AND ACCOMPLISHED IN ACCORDANCE WITH CONTRACTED AMO EXPOSITION AND PROCEDURE LATEST REVISION, AND OEM PUBLICATION: <u>A109E SB109EP-173, SB109EP-173</u> REVISION:.....	NAME	FIRM	SIGN & APPROVAL	DATE
	<u>Ihsan</u>	<u>GAM</u>	<u>Ihsan</u>	<u>20/11/2021</u>

PART M - CAMO ACCEPTANCE STATEMENT				
THIS IS TO CERTIFY THAT THE ABOVE MENTIONED WORK PACKAGE HAS BEEN REVIEWED, CHECKED FOR COMPLETION AND UPDATED IN THE MAINTENANCE SOFTWARE. ALL RELEVANT AIRCRAFT/ENGINE/ MODIFICATION LOGBOOK HAS BEEN UPDATED.	NAME	FIRM	SIGN & APPROVAL	DATE
	<u>MUHAMMAD IHSAN MASRI</u> CAMO Planner Galaxy Aerospace (M) Sdn. Bhd. (1040262-D)	<u>GAM</u>	<u>Muhammad Ihsan Masri</u>	<u>30/11/2021</u>



CLIENT/OWNER: FIRE AND RESCUE DEPT. OF MALAYSIA AIRCRAFT TYPE: A109E REGISTRATION: 9M-BOB BASE/FACILITY: <i>MAT</i> DATE IN: REFER WORKPACK OUT: REFER WORKPACK	SERIAL NO.	HOURS	LDG/CYCLE	WORKSHEET NO:	8470-001
	AIRCRAFT	11212	REFER WORKPACK	WORK/INSP/DESC:	ASB 109E0-176
	#1 ENGINE:	PCE-BC0308	REFER WORKPACK	WORKPACK REF:	9M-BOB-8470
	#2 ENGINE:	PCE-BC0358	REFER WORKPACK	AJL REF NO.:	REFER WORKPACK
			NG / N1	NF / N2	SHEET: 1 OF 1

Reason for raising: SCHEDULED INSPECTION TO BE CARRIED OUT IN ACCORDANCE WITH JBPM/CAMO/AMP/A109E ISSUE 2 REV 0 DATE 06 MAY 2021 A109E IETP - 32ND ISSUE: 2021-09-15 OR ANY LATEST APPROVED REVISION SB 109EP-176 // EASA AD NO. 2021-0067, NEW ISSUE/INSPECTION OF ROTOR BRAKE CONTROL CABLE P/N 109-0506-17-113	Raised by and date: Muhammad Ihsan Masri 20/10/2021	Other requirements/information: NIL
---	---	--

Item	Description	Technician	* Eng. CRS	Date
1	ASB 109EP-176 TO INSPECT THE CONTROL CABLE IN PROXIMITY OF THE CONTROL QUADRANT TO VERIFY ITS INTEGRITY. REF: ASB 109EP-176 // AD 2021-0067 REMARKS: <i>clear - satisfactory.</i>	<i>[Signature]</i>		<i>26/11/2021</i>

*The work recorded above has been carried out in accordance with the requirements of the Malaysian Civil Aviation Regulation for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

*The work recorded above has been carried out in accordance with the requirements of the _____ for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

TICK WHERE APPLICABLE


PARTS LABELLED & RETURNED	I.D. RAISED	DUPLICATE INSP	GROUND RUN	FLIGHT TEST	TORQUE CHK	ADDITIONAL WORKSHEET	MONITORED DEFECT	PLANNING FORECAST	DIARY UPDATE	STATUS UPDATE	I.D. STATUS	AIRCRAFT LOG BOOK	ENGINE LOG BOOK	PROPELLER LOG BOOK	LOG CARD	OEM/COMP LOG CARD	MOD RECORD BOOK
---------------------------	-------------	----------------	------------	-------------	------------	----------------------	------------------	-------------------	--------------	---------------	-------------	-------------------	-----------------	--------------------	----------	-------------------	-----------------



CLIENT/OWNER: FIRE AND RESCUE DEPT. OF MALAYSIA AIRCRAFT TYPE: A109E REGISTRATION: 9M-BOB BASE/FACILITY: MIAT DATE IN: REFER WORKPACK OUT: REFER WORKPACK	SERIAL NO.	HOURS	LDG/CYCLE		WORKSHEET NO: 8470-001
	AIRCRAFT	11212	REFER WORKPACK		WORK/INSP/DESC: ASB 109E0-176
	#1 ENGINE:	PCE-BC0308	REFER WORKPACK		WORKPACK REF: 9M-BOB-8470
	#2 ENGINE:	PCE-BC0358	REFER WORKPACK		A.JL REF NO.: REFER WORKPACK
			NG / N1	NF / N2	SHEET: 1 OF 1

REASON FOR RAISING: SCHEDULED INSPECTION TO BE CARRIED OUT IN ACCORDANCE WITH JBPM/CAMO/AMP/A109E ISSUE 2 REV 0 DATE 06 MAY 2021 A109E IETP - 32ND ISSUE: 2021-09-15 OR ANY LATEST APPROVED REVISION	Raised by and date: Muhammad Ihsan Masri 20/10/2021	Other requirements/information: NIL
---	---	--

Item	Part No	Description	Serial Number		Qty	Position	Reason	Lifed Item Information TSN/TSO/DUE/TIMEX	Release Reference
			Off	On					
(Table content is crossed out with a diagonal line)									

NAME	FIRM	SIGN & APPROVAL	DATE
<i>Othman</i>	<i>Gam</i>	<i>[Signature]</i> 	<i>26/11/2021</i>

*The work recorded above has been carried out in accordance with the requirements of the Malaysian Civil Aviation Regulation for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

*The work recorded above has been carried out in accordance with the requirements of the _____ for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

TICK ✓ WHERE APPLICABLE

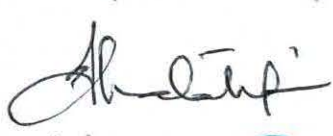

PARTS LABELLED & RETURNED	I.D. RAISED	DUPLICATE INSP	GROUND RUN	FLIGHT TEST	TORQUE CHK.	ADDITIONAL WORKSHEET	MONITORED DEFECT	PLANNING FORECAST	DIARY UPDATE	STATUS UPDATE	I.D. STATUS	AIRCRAFT LOG BOOK	ENGINE LOG BOOK	PROPELLER LOG BOOK	LOG CARD	OEM/COMP LOG CARD	MOD RECORD BOOK
---------------------------	-------------	----------------	------------	-------------	-------------	----------------------	------------------	-------------------	--------------	---------------	-------------	-------------------	-----------------	--------------------	----------	-------------------	-----------------

Please send to the following address: LEONARDO S.p.A. CUSTOMER SUPPORT & SERVICES - ITALY PRODUCT SUPPORT ENGINEERING & LICENSES DEPT. Via Giovanni Agusta, 520 21017 Cascina Costa di Samarate (VA) - ITALY Tel.: +39 0331 225036 Fax: +39 0331 225988	SERVICE BULLETIN COMPLIANCE FORM	Date: 26/11/2021
	Number: SB 109EP - H6	
	Revision: 10'	

Customer Name and Address:	Telephone:
	Fax:
	B.T. Compliance Date: 26/11/2021

Helicopter Model	S/N	Total Number	Total Hours	T.S.O.
A109F	11212	1	3661:30.	

Remarks:

check and completed found
 'Satisfactory'

 26/11/2021 

Information:

We request your cooperation in filling this form, in order to keep out statistical data relevant to aircraft configuration up-to-date. The form should be filled in all its parts and sent to the above address or you can communicate the application also via Technical Bulletin Application Communication Section placed in Leonardo AW Customer Portal - MyCommunications Area. We thank you beforehand for the information given.



CLIENT/OWNER: FIRE AND RESCUE DEPT. OF MALAYSIA	SERIAL NO.	HOURS	LDG/CYCLE	WORKSHEET NO:	8470-002
AIRCRAFT TYPE: A109E	AIRCRAFT 11212	REFER WORKPACK		WORK/INSP/DESC:	SB109EP-173 PART I
REGISTRATION: 9M-BOB	#1 ENGINE: PCE-BC0308	REFER WORKPACK		WORKPACK REF:	9M-BOB-8470
BASE/FACILITY: <i>MIAT</i>	#2 ENGINE: PCE-BC0358	REFER WORKPACK		AJL REF NO.:	REFER WORKPACK
DATE IN: REFER WORKPACK OUT: REFER WORKPACK			NG / N1	NF / N2	SHEET: 1 OF 1

Reason for raising: SCHEDULED INSPECTION TO BE CARRIED OUT IN ACCORDANCE WITH JBPM/CAMO/AMP/A109E ISSUE 2 REV 0 DATE 06 MAY 2021 A109E IETP - 32ND ISSUE: 2021-09-15 OR ANY LATEST APPROVED REVISION SB109EP-173 PART I (EASA AD NO.: 2020-0256)	Raised by and date: Muhammad Ihsan Masri 20/10/2021	Other requirements/information: NIL
---	---	--

Item	Description	Technician	* Eng. CRS	Date
1	<p>SB109EP-173 PART I ATA 53 - CENTRAL FUSELAGE FRAME ASSY AT STA 1815, INSPECTION AND REPAIR OF</p> <p>TO PERFORM INSPECTION TO DETECT CRACKS IN THE CENTER FUSELAGE AT INTERSECTION OF LATERAL PYLON (LH AND RH SIDE) WITH FLOOR SPAR</p> <p>NOTES: THE HELICOPTERS POSTS THAT HAVE BEEN REPAIRED IN ACCORDANCE WITH PART II (LH SIDE) OR PART III (RH SIDE) OF THIS SERVICE BULLETIN, OR IN ACCORDANCE WITH REPAIR DRAWING P/N 109-0952-67-117 (LH SIDE) OR P/N 109-0952-67-102 (RH SIDE). SHALL BE INSPECTED IN ACCORDANCE WITH PART I AFTER THEY HAVE ACCUMULATED MORE THAN 1000 FH OF 3500 LANDINGS SINCE REPAIR</p> <p>NOTES: PART II AND PART III SHOULD BE CARRIED OUT BEFORE THE NEXT FLIGHT AFTER THE CRACKS ARE FOUND DURING COMPLIANCE WITH PART I OF THE SERVICE BULLETIN.</p> <p>REF: SB109EP-173</p> <p>REMARKS: <i>CRACK FOUND 'SATISFACTORY'</i></p>	<i>[Signature]</i>	<i>[Signature]</i> <i>20/10/2021</i>	<i>20/10/2021</i>

- *The work recorded above has been carried out in accordance with the requirements of the Malaysian Civil Aviation Regulation for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.
- *The work recorded above has been carried out in accordance with the requirements of the _____ for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

TICK WHERE APPLICABLE


PARTS LABELLED & RETURNED	D/D RAISED	DUPLICATE INSP	GROUNDRUN	FLIGHTTEST	TORQUE CHK	ADDITIONAL WORKSHEET	MONITORED DEFECT	PLANNING FORECAST	DIARY UPDATE	STATUS UPDATE	D/D STATUS	AIRCRAFT LOG BOOK	ENGINE LOG BOOK	PROPELLER LOG BOOK	LOG CARD	DEM/COMP LOG CARD	MOD RECORD BOOK
---------------------------	------------	----------------	-----------	------------	------------	----------------------	------------------	-------------------	--------------	---------------	------------	-------------------	-----------------	--------------------	----------	-------------------	-----------------



CLIENT/OWNER: FIRE AND RESCUE DEPT. OF MALAYSIA AIRCRAFT TYPE: A109E REGISTRATION: 9M-BOB BASE/FACILITY: <i>MIAT</i> DATE IN: REFER WORKPACK OUT: REFER WORKPACK	SERIAL NO.	HOURS	LDG/CYCLE		WORKSHEET NO: 8470-002
	AIRCRAFT	11212	REFER WORKPACK		WORK/INSP/DESC: SB109EP-173 PART I
	#1 ENGINE:	PCE-BC0308	REFER WORKPACK		WORKPACK REF: 9M-BOB-8470
	#2 ENGINE:	PCE-BC0358	REFER WORKPACK		AJL REF NO.: REFER WORKPACK
			NG / N1	NF / N2	SHEET: 1 OF 1

REASON FOR RAISING: SCHEDULED INSPECTION TO BE CARRIED OUT IN ACCORDANCE WITH JBPM/CAMO/AMP/A109E ISSUE 2 REV 0 DATE 06 MAY 2021 A109E IETP - 32ND ISSUE: 2021-09-15 OR ANY LATEST APPROVED REVISION	Raised by and date: Muhammad Ihsan Masri 20/10/2021	Other requirements/information: NIL
---	---	--

Item	Part No	Description	Serial Number		Qty	Position	Reason	Lifed Item Information TSN/TSO/DUE/TIMEX	Release Reference
			Off	On					
(This table area is crossed out with a diagonal line)									

NAME	FIRM	SIGN & APPROVAL	DATE
<i>M. Ihsan</i>	<i>GAM</i>	<i>[Signature]</i> 	<i>26/11/2021</i>

*The work recorded above has been carried out in accordance with the requirements of the Malaysian Civil Aviation Regulation for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

*The work recorded above has been carried out in accordance with the requirements of the _____ for the time being in force and in that respect the aircraft / equipment is considered fit for release to service.

TICK ✓ WHERE APPLICABLE

PARTS LABELED & RETURNED	D/D RAISED	DUPLICATE INSP	GROUND RUN	FLIGHT TEST	TORQUE CHR.	ADDITIONAL WORKSHEET	MONITORED DEFECT	PLANNING FORECAST	DIARY UPDATE	STATUS UPDATE	D/D STATUS	AIRCRAFT LOG BOOK	ENGINE LOG BOOK	PROPELLER LOG BOOK	LOG CARD	GEN/COMP LOG CARD	MOD RECORD BOOK
--------------------------	------------	----------------	------------	-------------	-------------	----------------------	------------------	-------------------	--------------	---------------	------------	-------------------	-----------------	--------------------	----------	-------------------	-----------------

Please send to the following address: LEONARDO S.p.A. CUSTOMER SUPPORT & SERVICES - ITALY PRODUCT SUPPORT ENGINEERING & LICENSES DEPT. Via Giovanni Agusta, 520 21017 Cascina Costa di Samarate (VA) - ITALY Tel.: +39 0331 225036 Fax: +39 0331 225988	SERVICE BULLETIN COMPLIANCE FORM	Date: 26/11/2021
	Number: SB/09 EP-173 PART 1.	
	Revision: /	

Customer Name and Address:	Telephone:
	Fax:
	B.T. Compliance Date: 26-11-2021


Helicopter Model	S/N	Total Number	Total Hours	T.S.O.
A109E	11212	1	3661.30	

Remarks:

Clear And Computer Found Satisfactory.

[Signature]

26/11/2021



Information:

We request your cooperation in filling this form, in order to keep out statistical data relevant to aircraft configuration up-to-date. The form should be filled in all its parts and sent to the above address or you can communicate the application also via Technical Bulletin Application Communication Section placed in Leonardo AW Customer Portal - MyCommunications Area. We thank you beforehand for the information given.