

LOG CARD

NOTICE: THIS FORM, DULY UPDATED, MUST FOLLOW THE ASSY

Section 1


ATA Chapter 25

DESCRIPTION (1) LIFERAFT LH	P/N (2) 362560V00332	S/N (3) 215	MANUFACTURER NAME (4) AEROSE KUR	ASSEMBLY/MANUFACTURING DATE (5)	RETIREMENT LIFE / TIME LIMITS (6)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE / TIME LIMITS (11)
	P/N (7)	S/N (8)	MANUFACTURER NAME (9)	DATE OF CHANGE (10)	RETIREMENT LIFE / TIME LIMITS (11)

NOTES

ASSEMBLY HISTORICAL RECORD

INSTALLATION						REMOVAL						
DATE (12)	A/C		ASSY		ORGANIZATION, STAMP AND SIGNATURE (18)	DATE (19)	A/C		ASSY		REASON FOR REMOVAL (24)	ORGANIZATION, STAMP AND SIGNATURE (25)
	R. MARKS (13)	TOTAL FLIGHT HOURS (15)	TOTAL HOURS (16)	TIME SINCE OH (17)			TOTAL FLIGHT HOURS (20)	ACTUAL TOTAL HOURS (21)	TOTAL HOURS WITH PENALTY FACTOR (22)	TIME SINCE OH (23)		
	S/N (14)	TOTAL LANDINGS (15)	TOTAL LANDINGS (16)	LANDINGS SINCE OH (17)			TOTAL LANDINGS (20)	ACTUAL TOTAL LANDINGS (21)	TOTAL LANDINGS WITH PENALTY FACTOR (22)	LANDINGS SINCE OH (23)		
		TOTAL LIFTS/CYCLES (15)	TOTAL LIFTS/CYCLES (16)	LIFTS/CYCLES SINCE OH (17)		TOTAL LIFTS/CYCLES (20)	ACTUAL TOTAL LIFTS/CYCLES (21)		LIFTS/CYCLES SINCE OH (23)			
23.04.2021	M72-02	3373.0	3269.2	1067.1	GAM Daly GAM N003 DGTA	23.08.2021	3500.5	3396.7		1194.6	TO SERVICE M72-03	GAM Daly GAM N003 DGTA
	31315	3826						3939				
23.08.21	M72-03	2591.8	3396.7	1194.6	GAM Daly GAM N003 DGTA	22.04.22	2699.1	3504.0		1301.9	DUE FOR ANNUAL INSPECTION	GAM Daly GAM N010 DGTA
	31316	3957						4136				
09.05.22	M72-01	4111.5	3504.0	1301.9	GAM Daly GAM N010 DGTA	03.06.22	4142.9	3535.4		1333.3	REMOVED FOR PAINTING	GAM Daly GAM N010 DGTA
	31307	4536										
05.06.22	M72-03	2736.2	3535.4	1333.3	GAM Daly GAM N010 DGTA	26.09.22	2797.7	2023.6		1294.8	REMOVED TO SERVICE M72-03.	GAM
	31316											
26.09.22	M72-03	2969.7	2023.6	1294.8	GAM							

1. Country MALAYSIA		2. AUTHORISED RELEASE CERTIFICATE CAAM Form 1			3. Form Tracking Number: 819.210422	
4. Organisation Name and Address: HRD Aero Systems Sdn Bhd LOT 16683 JALAN DELIMA 1 KAWASAN PERINDUSTRIAN NILAI 3 71800 NILAI, NEGERI SEMBILAN, MY GST ID NO: 000794513408				5. Work Order/Contract/Invoice Number: ML819		
Approval Holder: AMO / 2017 / 22						
6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial Number:	11. Status/Work:	
1	LIFE RAFT ASSY, LH	3G2560V00332	1	215	INSPECTED/TESTED	
12. Remarks This article was inspected / tested and repaired IAW Aerosekur CMM 95-61-04 Revision 9 Date 22 Aug 2019. Raft Assembly P/N: 00051252, S.N: 4549400100320, D.O.M: 11/2009. Reservoir P/N: 45521002, S/N: OL 42142, D.O.M: 07/2009, Reservoir Hydrostatically Tested: 02/2019. ELT P/N: 500-12Y, S/N: 12301, HEX ID: C2AC40C034001BD. Part Replaced: First Aid Kit P/N: 306000A Exp: 12/23, Screw's P/Ns: V-GL0008 / V-GB0008, Washer P/N: G-H10038, Closing Belt P/N: J-E30003, Seal P/N: 202387A, Anti Skid P/N: A-E70001. See Tear Down for Work Details.						
13a. Certifies the items identified above were manufactured in conformity to:			14a. <input checked="" type="checkbox"/> CAR Reg. 30; Release to Service <input type="checkbox"/> Other regulation specified in Block 12			
<input type="checkbox"/> Approved design data and are in a condition for safe operation. <input type="checkbox"/> Non-approved design data specified in Block 12			Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with CAAM Part 145 requirements and in respect to that work, the items are approved for return to service.			
13b. Authorised Signature:		13c. Approval Authorisation No.:		14b. Authorised Signature:		14c. Certificate of Approval Ref. No:
						AMO / 2017 / 22
13d. Name (Typed or Printed):		13e. Date (day/month/year):		14d. Name (Typed or Printed):		14e. Date (day/month/year):
				Ooi Men See		22 Apr 2021
User/Installer Responsibilities						
It is important to understand that the existence of this document alone does not automatically constitute authority to install the part/component/assembly. Where the user/installer performs work in accordance with the national regulations of an Airworthiness Authority different than the Airworthiness Authority specified in block [2] it is essential that the user/installer ensures that his/her Airworthiness Authority accepts parts/components/assemblies from the Airworthiness Authority specified in block [2]. Statement in Blocks 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.						



HRD Aero Systems, Sdn Bhd
 Lot# 16683, Jalan Delima 1
 Kawasan Perindustrian Nilai 3
 Nilai, Negeri Sembilan Malaysia 71800

FAA CRS# 3HYV536C
 DCAM AMO/2017/22
 EASA.145.0732

TEARDOWN REPORT

CUSTOMER NAME: GALAXY AEROSPACE		CUSTOMER PO#:	PO-21-2685
HRD WO#: ML 819	MFG P/N: 303090A	S/N: 215	DOM: 02/2010
Reservoir Assy P/N: 45521002	S/N: OL 42142	D.O.M.: 07/2009	Hydrostatic Test Date: 02/2019

SECTION 1, REMOVAL REPORT.

Reason for Removal: ANNUAL INSPECTION Unit received deployed Confirmed Unconfirmed
 See Section 3 Warranty Requested

SECTION 2, STANDARD TASKS PERFORMED IAW CMM.

- Functional Test
- PRV Test
- Proof Pressure Test / Bulk Head Test
- Air Retention Test
- Survival Kit Insp / OH
- 1 Bottle 2 Bottles N/A
- Hydro Test
- Valve Overhaul
- Valve Flow Test
- Hose Pressure Test

SECTION 3, DETAILS OF WORK PERFORMED BELOW

FIRST AID KIT (expired) -replaced-	306000A	1
SCREW (used) -replaced-	V-GL0008	4
SCREW (used) -replaced-	V-GB0008	4
WASHER (used) -replaced-	G-H10038	4
CLOSING BELT (used) -replaced-	J-E30003	4
SEAL (used) -replaced-	202387A	1
ANTI SKID (torn) -replaced-	A-E70001	1
AGUSTAWESTLAND P/N: 3G2560V00332, S/N: 215, D.O.M: 02/2010	N/A	N/A
NEXT INSPECTION DUE: 04/2022	N/A	N/A

SECTION 4, LIFE LIMITED COMPONENTS INSTALLED ON ASSEMBLY

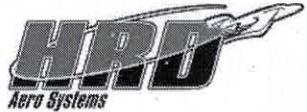

DESCRIPTION	P/N	S/N	DATE OF MFG	EXP. DATE
CYLINDER / ELT BATT.	L62M / A0696Y	OL 42142 / 118361	(07/09) / (06/18)	(07/24) / (06/23)
FLARE / FIRST AID KIT	306634A / 306000A	N/A	(11/19) / (07/20)	(05/23) / (12/23)
FLASH LIGHT / WATER	304526A / 306009A	N/A	(10/19) / (10/18)	(12/29) / (04/24)
ANTI-SEASICKNESS / RB2	306014A / 306499A	N/A	(N/A) / (06/18)	(11/22) / (05/23)

SECTION 5, SERVICE BULLETINS, AIRWORTHINESS DIRECTIVES, or ENGINEERING ORDERS ACCOMPLISHED.

S.B./A.D./E.O. #	DESCRIPTION
N/A	N/A

EXAMINED AND ACCEPTED BY
 SIGNATURE OF INSPECTOR:

DATE: 22 APRIL 2021

1. Approving Competent Authority/Country EASA		2. EASA Form 1 header AUTHORISED RELEASE CERTIFICATE EASA FORM 1			3. Form Tracking Number 819.210422
4. Organization Name and Address:  HRD Aero Systems		HRD Aero Systems SDN. BHD. Lot 16683 Jalan Delima 1 Kawasan Perindustrian Nilai 3 71800 Nilai, Negeri Sembilan, Malaysia Tel. +606-7993680/81; Fax +606-7993673			5. Work Order/Contract/Invoice ML819
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
1	LIFE RAFT ASSY, LH	3G2560V00332	1	215	INSPECTED/TESTED
12. Remarks <i>This article was inspected / tested and repaired IAW Aerosekur CMM 95-61-04 Revision 9 Date 22 Aug 2019.</i> <i>Raft Assembly P/N: 00051252, S.N: 4549400100320, D.O.M: 11/2009.</i> <i>Reservoir P/N: 45521002, S/N: OL 42142, D.O.M: 07/2009, Reservoir Hydrostatically Tested: 02/2019.</i> <i>ELT P/N: 500-12Y, S/N: 12301, HEX ID: C2AC40C034001BD.</i> <i>Part Replaced: First Aid Kit P/N: 306000A Exp: 12/23, Screw's P/Ns: V-GL0008 / V-GB0008, Washer P/N: G-H10038, Closing Belt P/N: J-E30003, Seal P/N: 202387A, Anti Skid P/N: A-E70001.</i> <i>See Tear Down for Work Details.</i>					
13a. Certifies that the items identified above were manufactured in conformity to: <input type="checkbox"/> approved design data and are in condition for safe operation <input type="checkbox"/> non-approved design data specified in block 12			14a. <input checked="" type="checkbox"/> Part 145.A.50 Release to Service <input type="checkbox"/> Other regulation specified in block 12 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part 145 and in respect to that work the items are considered ready for release to service.		
13b. Authorised Signature		13c. Approval/Authorisation Number		14b. Authorised Signature	
					
13d. Name		13e. Date (dd/mmm/yyyy)		14c. Certificate/Approval Ref. No.	
				145.0732	
13d. Name		13e. Date (dd/mmm/yyyy)		14d. Name	
				Ooi Men See	
13d. Name		13e. Date (dd/mmm/yyyy)		14e. Date (dd/mmm/yyyy)	
				22 Apr 2021	
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s). Where the user / installer performs work in accordance with regulations of an Airworthiness Authority different then the Airworthiness Authority specified in block 1, it is essential that the user / installer ensures that his / her Airworthiness Authority accepts items from the Airworthiness Authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulation by the user / installer before aircraft may be flown.					



HRD Aero Systems, Sdn Bhd
 Lot# 16683, Jalan Delima 1
 Kawasan Perindustrian Nilai 3
 Nilai, Negeri Sembilan Malaysia 71800

FAA CRS# 3HY536C
 DCAM AMO/2017/22
 EASA.145.0732

TEARDOWN REPORT

CUSTOMER NAME: GALAXY AEROSPACE		CUSTOMER PO#: PO-21-2685	
HRD WO#: ML 819	MFG P/N: 303090A	S/N: 215	DOM: 02/2010
Reservoir Assy P/N: 45521002	S/N: OL 42142	D.O.M.: 07/2009	Hydrostatic Test Date: 02/2019

SECTION 1, REMOVAL REPORT.

Reason for Removal: ANNUAL INSPECTION Unit received deployed Confirmed Unconfirmed
 See Section 3 Warranty Requested

SECTION 2, STANDARD TASKS PERFORMED IAW CMM.

- Functional Test
- PRV Test
- Proof Pressure Test / Bulk Head Test
- Air Retention Test
- Survival Kit Insp / OH
- 1 Bottle 2 Bottles N/A
- Hydro Test
- Valve Overhaul
- Valve Flow Test
- Hose Pressure Test

SECTION 3, DETAILS OF WORK PERFORMED BELOW

FIRST AID KIT (expired) -replaced-	306000A	1
SCREW (used) -replaced-	V-GL0008	4
SCREW (used) -replaced-	V-GB0008	4
WASHER (used) -replaced-	G-H10038	4
CLOSING BELT (used) -replaced-	J-E30003	4
SEAL (used) -replaced-	202387A	1
ANTI SKID (torn) -replaced-	A-E70001	1
AGUSTAWESTLAND P/N: 3G2560V00332, S/N: 215, D.O.M: 02/2010	N/A	N/A
NEXT INSPECTION DUE: 04/2022	N/A	N/A

SECTION 4, LIFE LIMITED COMPONENTS INSTALLED ON ASSEMBLY

DESCRIPTION	P/N	S/N	DATE OF MFG	EXP. DATE
CYLINDER / ELT BATT.	L62M / A0696Y	OL 42142 / 118361	(07/09) / (06/18)	(07/24) / (06/23)
FLARE / FIRST AID KIT	306634A / 306000A	N/A	(11/19) / (07/20)	(05/23) / (12/23)
FLASH LIGHT / WATER	304526A / 306009A	N/A	(10/19) / (10/18)	(12/29) / (04/24)
ANTI-SEASICKNESS / RB2	306014A / 306499A	N/A	(N/A) / (06/18)	(11/22) / (05/23)

SECTION 5, SERVICE BULLETINS, AIRWORTHINESS DIRECTIVES, or ENGINEERING ORDERS ACCOMPLISHED.

S.B./A.D./E.O. #	DESCRIPTION
N/A	N/A

EXAMINED AND ACCEPTED BY
 SIGNATURE OF INSPECTOR: _____

DATE: 22 APRIL 2021